

# ADA TITLE II SELF-EVALUATION AND TRANSITION PLAN

*prepared for*

## City of Chino

13220 Central Avenue

Chino, CA 91710

Lisa Almilli, Accessibility Coordinator



## ADA TITLE II SELF-EVALUATION AND TRANSITION PLAN

OF

CITY OF CHINO

13220 CENTRAL AVENUE

CHINO, CALIFORNIA 91710

### PREPARED BY:

Bureau Veritas

10461 Mill Run Circle, Suite 1100

Owings Mills, Maryland 21117

800.733.0660

[www.us.bureauveritas.com](http://www.us.bureauveritas.com)

### BV CONTACT:

*Michael Cunniff*

*Program Manager*

800.733.0660 x7296214

[Michael.Cunniff@bureauveritas.com](mailto:Michael.Cunniff@bureauveritas.com)

### BV PROJECT #:

160001.23R000-FNL.206

160001.23R000-PGM.413

### DATE OF REPORT:

January 30, 2024

**Bureau Veritas**

# TABLE OF CONTENTS

- 1. CERTIFICATION..... 2**
- 2. OVERVIEW OF THE CITY OF CHINO ..... 3**
- 3. ACCESSIBILITY REQUIREMENTS ..... 4**
  - 3.1 Americans with Disabilities Act..... 4
  - 3.2 Accessibility in the Public Right-of-Way ..... 5
- 4. REQUIREMENTS FOR A SELF-EVALUATION AND ADA TRANSITION PLAN..... 6**
- 5. PUBLIC OUTREACH ..... 7**
  - 5.1 Public Comments ..... 7
- 6. SELF-EVALUATION: PROGRAMMATIC AND ADMINISTRATIVE REVIEW ..... 8**
  - 6.1 Community Services..... 8
  - 6.2 Housing..... 10
  - 6.3 Personnel and Internal Policies and Procedures ..... 10
  - 6.4 Human Resources: Position Descriptions ..... 12
  - 6.5 ADA Coordinator ..... 13
  - 6.6 Notice of the ADA’s Provisions..... 14
  - 6.7 Grievance Procedures..... 14
  - 6.8 General Effective Communications ..... 15
  - 6.9 9-1-1 and Emergency Communication Services ..... 17
  - 6.10 Website Accessibility ..... 17
  - 6.11 Curb Ramps and Pedestrian Crossing..... 18
  - 6.12 Emergency Management ..... 19
- 7. SELF-EVALUATION: FACILITY AND PROW ASSESSMENTS..... 22**
  - 7.1 City Facilities..... 22
  - 7.2 City PROW Pedestrian Facility..... 25
  - 7.3 Basis for Probable Costs ..... 27
- 8. COMPLIANCE STRATEGY ..... 28**
- 9. PHASING AND PRIORITIES ..... 29**
  - 9.1 City Facility Phasing and Individual Facility Barrier Priorities..... 29
  - 9.2 City PROW Barrier Phasing ..... 30
- 10. CITY OF CHINO FUNDING LEVELS ..... 32**
- 11. TRANSITION PLAN COMPONENTS ..... 33**
  - 11.1 Overview..... 33
  - 11.2 Barriers Summary..... 33
  - 11.3 Buildings and Parks Barrier Removal Strategy ..... 33
  - 11.4 PROW - Sidewalk Barrier Removal Summary ..... 36
  - 11.5 PROW - Curb Ramp Barrier Removal Summary ..... 38
  - 11.6 PROW - Bus Stops Barrier Removal Summary ..... 40
  - 11.7 PROW – Pedestrian Signals Barrier Removal Summary..... 41
  - 11.8 Schedule and Timeline ..... 43
- 12. APPENDICES ..... 44**



## 1. CERTIFICATION

---

Bureau Veritas has completed a Comprehensive Accessibility Evaluation of the City of Chino properties in San Bernardino County, California, in accordance with the requirements of 28 CFR Part 35, the 2010 ADA Design Standards for Accessible Design, and the State of California Building Code sections related to accessibility.

The conclusions and recommendations presented in this Self-Evaluation and Transition Plan are based on the evaluations of properties under the jurisdiction of the City of Chino, associated documentation related to the properties, and input from the City of Chino staff.

Accessibility evaluations were conducted by Bureau Veritas Project Architects and Project Engineers during site visits to individual properties. Project Architects' and Engineers' observations were made during site visits conducted in 2023. Cost estimates for barrier removal are planning level cost estimates based on Bureau Veritas's experience with similar properties. In addition, previous ADA assessment data collected by Calabrese Architect from 2017 - 2019 was used to create this Transition Plan.

The assessments were performed at the Client's request using methods and procedures consistent with good commercial and customary practice for assessing compliance with the Title II provisions of the Americans with Disabilities Act (ADA), including the requirements of 28 CFR Part 35, and applicable state requirements. Accessibility barriers in areas which were not readily accessible, and/or may not have been visible, may exist. Individual facility reports describe property conditions at the time that the observations and research were conducted. The individual facility reports are not an engineering evaluation of physical conditions. The Self-Evaluation did not include engineering evaluations or engineering calculations to determine the adequacy of the park or facility's original design or to determine engineered cost estimates.

The opinions Bureau Veritas expresses in this report were formed utilizing the degree of skill and care ordinarily exercised by any prudent architect or engineer in the same community under similar circumstances. Bureau Veritas assumes no responsibility or liability for the accuracy of the information contained in this report, which has been obtained from the Client or the Client's representatives, from other interested parties, or from the public domain. The conclusions presented represent Bureau Veritas's professional judgment based on information obtained during the course of this assignment. The conclusions presented are based on the data provided, observations made, and conditions that existed specifically on the date of the assessments of individual properties.

Bureau Veritas certifies that Bureau Veritas has no undisclosed interest in the subject property, Bureau Veritas's relationship with the Client is at arms-length, and that Bureau Veritas's employment and compensation are not contingent upon the findings or estimated costs to remedy any deficiencies.

This report has been prepared on behalf of and exclusively for the use of the City of Chino for the purposes stated herein. The purpose for which this report shall be used shall be limited to the use as stated in the contract between the client and Bureau Veritas.

This report, or any of the information contained therein, is not for the use or benefit of, nor may it be relied upon by any other person or entity, for any purpose without the advance written consent of Bureau Veritas. Any reuse or distribution without such consent shall be at the client's or recipient's sole risk, without liability to Bureau Veritas.

If you have any questions regarding this report, please contact Michael Cunniff, Program Manager at (800) 766-0660 x 7296214.

**Certified by:**

*Justin Vang*

---

Justin Vang, Lead Project Manager, CASp #0845  
[Justin.Vang@bureauveritas.com](mailto:Justin.Vang@bureauveritas.com)

## 2. OVERVIEW OF THE CITY OF CHINO

---

The City of Chino was incorporated as a general law City on February 28, 1910. Chino has a separately elected Mayor and four Council members, each elected to overlapping four-year terms. The Mayor and Council appoint the City Manager and City Attorney, with department directors appointed by the City Manager. The Council-Manager form of government allows for democratic participation, representation through City Council, professional implementation, and efficient operation and delivery of services.

Located in San Bernardino County, the City of Chino has a total area of 29.7 square miles and is a growing, vibrant community with residential, commercial, and industrial land. The mission statement of the City of Chino is “Together we take pride in providing quality, caring service to our community.” The City is guided by core organizational values that reflect the commitment to excellence in all facets of its operations and services. The City of Chino’s current staffing at the time of this evaluation consists of 565 total employees with 389 full-time and 176 part-time employees.

The City provides a full range of services for its citizens, including police services, parks and recreation programs, planning and development, and street maintenance and lighting. It also operates water, sewer, and storm drain utilities and provides other services, such as refuse collection, through outside contracts.

## 3. ACCESSIBILITY REQUIREMENTS

---

### 3.1 Americans with Disabilities Act

The Americans with Disabilities Act (ADA) of 1990 provides comprehensive, wide-ranging rights and protections to individuals with disabilities in the areas of employment, public accommodations, state and local government services, and telecommunications. Many consider it to be one of the most important civil rights laws since the Civil Rights Act of 1964. The goal of the ADA is to ensure equality of opportunity, full participation, and independent living to all individuals, including those with disabilities; it expressly prohibits all state and local governments and most private businesses from discriminating on the basis of disability. The ADA provides a clear and comprehensive national mandate for the elimination of discrimination against individuals with disabilities. The ADA includes the definition of a disability, and in 2008, the ADA Amendments Act expanded and better defined the definition of a disability.

The ADA defines a disability, with respect to an individual, in one of three ways: a physical or mental impairment that substantially limits one or more major life activities; a record or history of such impairment; or regarded as having such as an impairment. Major life activities include, but are not limited to, caring for oneself, performing manual tasks, seeing, hearing, eating, sleeping, walking, standing, lifting, bending, speaking, breathing, learning, reading, concentrating, thinking, communicating, and working.

The ADA is divided into five sections, or titles, covering specific areas: Employment (Title I), State and Local Government (Title II), Places of Public Accommodation (Title III), Telecommunication (Title IV), and Miscellaneous Provisions (Title V). This report focuses solely on Title II.

The Department of Justice (DOJ) is responsible for the enforcement of the provisions of the ADA other than employment policy related issues. The DOJ's regulations implementing Title II of the ADA dictate that local governments and public agencies, such as the City of Chino, must evaluate their services, programs, policies and practices, and identify barriers that may limit accessibility for individuals with disabilities and develop transition plans describing how they will address identified barriers.

In 2010, the DOJ issued revised and expanded ADA regulations. The new regulations revised and updated earlier standards as well as included new standards for various recreational uses such as play equipment, amusement rides, fishing piers, etc. These are collectively called the 2010 ADA Standards for Accessible Design (2010 Standards). These new standards guide all new construction and renovation projects. All facilities and parks have been evaluated and audited using the 2010 Standards.

Generally, Title II of the ADA prohibits discrimination by public entities to access and use of programs, services and activities on the basis of disability. In addition, public agencies must provide program access to all programs of the agency. Program, as used in the phrase "program access", is defined by the Department of Justice as "programs, services, and activities" of the public agency. Regardless of their age, facilities providing programs, services, and activities must be maintained and operated to comply with the Americans with Disabilities Act Accessibility Guidelines (ADAAG), and applicable state and local accessibility regulations.

Buildings completed and occupied after January 26, 1992, are required to comply fully with ADAAG. Existing facilities constructed prior to this date are held to the lesser standard of complying to the extent allowed by structural feasibility and the financial resources available, or a reasonable accommodation must be made. However, program access by the public is still required.

A full explanation of the ADA is located in Appendix A.

### 3.2 Accessibility in the Public Right-of-Way

As part of the Rehabilitation Act of 1973, the U.S. Access Board, originally known as the Architectural and Transportation Barriers Compliance Board was created with the purpose of promoting equality for individuals with disabilities and developing accessibility guidelines and standards in the built environment.

After the Americans with Disabilities Act was enacted in 1990, the Access Board began developing accessibility guidelines for pedestrian facilities in the public right-of-way. The Board issued proposed guidelines in 1992 followed by interim guidelines in 1994 but was met with numerous public comments that indicated that further research was needed on accessible pedestrian facilities in the public right-of-way.

In 1999, a Federal advisory committee was created to recommend accessibility guidelines in the public right-of-way. After various comments and revisions to draft recommendations, in July 2011, the Access Board initiated the instant rulemaking and issued a Notice of Proposed Rulemaking for Accessibility Guidelines for Public Rights-of-Way. In February 2013, the Board issued a Supplemental Notice of Proposed Rulemaking to include accessibility requirements for shared use paths.

The Board reviewed all public comments carefully, consulted with the Department of Justice and United States Department of Transportation (US DOT), and revised the new guidelines for final publication. The Public Right-of-Way Accessibility Guidelines (PROWAG) final rule came to a halt in January 2017 in response to Executive Order 13771 which required that agencies eliminate two regulations for every new regulation proposed and that total incremental cost of any new regulation and deregulation actions be zero.

In 2021, Executive Order 13772 rescinded Executive Order 13771, and work resumed on the PROWAG rulemaking. The Board published the final rule in the Federal Register on August 8, 2023 with an effective date of September 7, 2023. When the DOJ and US DOT adopt the final guidelines with or without modifications, they will become the minimum design standards enforceable under the ADA for new construction and alterations of pedestrian facilities in the public right-of-way.

Due to a lack of enforceable, technical requirements for accessibility in the public right-of-way, Title II entities have been left to determine on their own how to comply with their obligations under Title II of the ADA. The case of *Barden v. City of Sacramento*, 292 F.3d 1073 (2002), set a national precedent that required cities and other public entities to make all their public sidewalks accessible to people with disabilities. The United States Courts of Appeal, 9<sup>th</sup> circuit, decided that sidewalks and intersections constituted a service, program, or activity provided by a public entity, thus should be included in a public entity's ADA Transition Plan.

Amended in 2004 and 2009, California Government Code, Section 4450, required "all buildings, structures, sidewalks, curbs, and related facilities, constructed in this state by the use of state, county, or municipal funds, or the funds of any political subdivision of the state shall be accessible to and usable by persons with disabilities." This led to the enactment of the CBC section 1.9, which required all "Publicly funded buildings, structures, sidewalks, curbs, and related facilities shall be accessible to and usable by persons with disabilities" and the public rights-of-way (PROW) being subjected to Chapter 11B of the CBC.

## 4. REQUIREMENTS FOR A SELF-EVALUATION AND ADA TRANSITION PLAN

---

As part of the City of Chino's effort to comply with Title II of the Americans with Disabilities Act (ADA), the City has performed a comprehensive Citywide Self-Evaluation and developed an ADA Transition Plan that included programs, policies and procedures, public buildings and parks, and public right-of-way facilities. The purpose of this Self-Evaluation and Transition Plan is to plan accessibility compliance for the City of Chino with the requirements of Title II of the ADA and applicable state regulations contained in the accessibility and related chapters of the California Building Code.

This Self-Evaluation includes:

- a review of the City's current services, policies, and practices
- findings and recommendations regarding those policies and practices
- the opportunity to interested persons to participate in the self-evaluation process through comments and public outreach
- previous survey data of physical barriers to accessibility performed by Calabrese Architect (2017 - 2019)
- field survey data of physical barriers to accessibility at City owned and leased facilities and pedestrian facilities in the public right-of-way performed by Bureau Veritas

This Transition Plan includes:

- identified physical barriers to facilities and remediation methods to make the facilities accessible
- estimated cost for remediations
- a schedule for barrier removal including barrier removal prioritization
- official responsible for implementation of the plan

## 5. PUBLIC OUTREACH

---

### 5.1 Public Comments

The City of Chino recognizes the importance of public opinion. To provide all interested persons the opportunity to comment on the self-evaluation and transition strategies, the City of Chino has:

1. Announced on their website and in a public meeting that the City is in the process of developing an ADA transition plan.
2. Solicited public input via online survey from June 8, 2023 – August 22, 2023. See Appendix G for survey.
3. Hosted a community outreach event on June 23, 2023, 6pm at Chino Summer Nights on City Hall Lawn.
4. Hosted a public workshop with the City Council on September 12, 2023.
5. The draft ADA Transition Plan was made available for public inspection and comment prior to finalization from December 21, 2023 through January 27, 2024.

The City of Chino maintains a record of persons consulted, comments received, and any further audit or assessment performed based on the comments received and modifications made. These records will be maintained by the ADA Coordinator, Lisa Almilli, and will be made available for public inspection. Lisa Almilli can be reached by email at [lalmilli@cityofchino.org](mailto:lalmilli@cityofchino.org), by phone at 909-334-3524, or in person at 13220 Central Avenue, Chino, California 91710.

## 6. SELF-EVALUATION: PROGRAMMATIC AND ADMINISTRATIVE REVIEW

---

Program access under Title II of the ADA is required for public entities in all of their services, policies, and practices. Public entities shall modify any such services, policies and practices to meet the requirements of 28 CFR Part 35. An evaluation of the City's current programmatic and administrative requirements was completed with recommendations for modifications. The City of Chino is implementing modifications for non-structural program access immediately to be in compliance with the 28 CFR 35.105. This action plan will correct all deficiencies noted and create established policies and practices for the City to follow.

### 6.1 Community Services

#### **Requirement:**

Programs and services provided by the City of Chino must not discriminate against individuals with disabilities. This extends to providing programs (such as exercise, recreational, swimming, etc.) in an integrated setting. Providing segregated/separate programs for individuals with disabilities is not acceptable. Additionally, programs that have presentations and use audio/amplified communication (i.e., microphones) need to accommodate individuals with hearing disabilities.

#### **Findings:**

The City of Chino does not have a policy/procedure in place that speaks to accessibility for special events. This document should provide the basis of ADA requirements to where all special events are held.

The City of Chino does not have an accessibility page on their website that provides a list of all accessible features at the facilities, including parking, playgrounds, restrooms, and picnic shelters.

The City of Chino has a policy/procedure that provides staff with training in supporting individuals of all abilities in all programming where they meet prerequisite requirements with or without reasonable accommodation.

The City of Chino has policies regarding the use of service animals and wheelchairs and manually powered mobility aids.

The City of Chino does not provide a statement on their website under each program, service, and activity that accommodation can be provided.

The City of Chino does not have a preventative maintenance program to maintain accessible features at all facilities.

**Recommendations:**

- The following are recommended for policies/procedures for accessibility for special events.
  - It is recommended that the contact information of a knowledgeable person to respond to questions regarding disabilities be included in the printed material for the events.
  - It is recommended to include protocols to staff about the inquiry of a service animal:
    - Staff may only ask two questions.
      - Is the dog a service animal required because of a disability?
      - What work or task has the dog been trained to perform?
    - Staff cannot ask about the person's disability, require medical documentation, require a special ID or training documentation for the dog.
    - Staff cannot ask the dog to demonstrate its ability to perform the work or task
  - It is recommended to include a provision to work with vendors to ensure people with disabilities will have comparable access to food, drinks, merchandise, or services offered.
  - It is recommended to include a provision that all staff and volunteers should have a basic awareness of and sensitivity to disability issues. Staff should understand that people with disabilities expect to be treated like all other event participants.
  - It is recommended to include a provision to ensure events provide compliant dining/work surfaces, if provided.
  - It is recommended to include a provision that event holders should provide maintenance of accessible features including placement of temporary signs/trash receptacles/and other portable amenities to not obstruct required clearances.
- For any activity taking place in a swimming pool, ensure that the pool has a pool lift in accordance with the 2010 ADA Standards for Accessible Design.
- All notifications (written/print, website, posters, etc.) should state: *"if you need an accommodation in order to participate in this program (wheelchair access, sign language interpreter, written materials in alternate format) please contact....."*
- If a program has a fee assigned to it and an individual with a disability requires his own personal assistant to participate, it is advised that the assistant not be charged an admission fee. The City of Chino is not required to provide personal assistance for an individual with a disability.

- Information about the current accessibility of facilities where programs, services and activities take place needs to be coordinated with the offices who operate the programs and services. If an applicant or participant needs to be accommodated, it may require moving the program to an accessible location or the City of Chino employee must meet the resident at an accessible location within the variety of City facilities.
- Furniture placement throughout the facilities creates barriers to access. Maintenance of accessible feature policy shall be adopted to ensure accessibility of facilities.

## 6.2 Housing

### **Requirements:**

Residential facilities with residential dwelling units shall comply with Section 233 and with the technical and scoping requirements in Chapters 1 through 10 of the 2010 ADA Standards for Accessible Design. These facilities may also be subject to the requirements of the Fair Housing Act (FHA), Section 504 of the Rehabilitation Act of 1973, as amended and/or The US Department of Housing and Urban Development (HUD).

### **Findings:**

- The City of Chino has a robust housing plan to include senior, low, and moderate-income, and persons with disabilities rental programs as well as home buyer's assistance programs. Eligibility is income based.
- All applications are submitted online. However, many of the materials associated are provided as PDF's, which are not an accessible format for individuals with visual disabilities who use screen readers.
- Additionally, information regarding reasonable accommodation policies and procedures (i.e., modifications to a unit, allowing a tenant to have an emotional support animal and other disability-related issues) was not found in the materials.

### **Recommendations:**

- It is recommended that all housing applications be provided in an alternative format such as large print, Braille, audiotape, computer disk, pictorial signage, etc. for individuals with disabilities.
- It is recommended that reasonable accommodation policies and procedures are put in place by the city and that these policies and procedures are available for potential and current tenants.

## 6.3 Personnel and Internal Policies and Procedures

### **Requirements:**

No qualified individual with a disability shall, on the basis of disability, be subjected to discrimination in employment under any service, program, or activity conducted by a public entity.

**Findings:**

The City of Chino has very extensive and thorough policies ranging from administrative, personnel, rules and regulations, and other miscellaneous categories. Key administrative policies reviewed include:

- Policy Against Harassment: The policy is thorough and lists all forms of harassment including, basis of political opinions and affiliations, race, religious creed, color, national origin, ancestry, physical or mental disability, medical condition, marital status, gender, age, sexual orientation, denial of family and medical care leave, or pregnancy disability. Compliant procedure and disciplinary actions are outlined.
- Alcohol and Substance Abuse: The policy details requirements related to use of controlled substances while on City property or when working off property. Disciplinary policies are thoroughly detailed, and the Employee Assistance Program (EAP) is described.
- Tobacco-Free Workplace: The policy states that smoking is prohibited in all City buildings. Smoking is allowed during break and lunch periods outside of City buildings.
- Workplace Security: The policy provides a thorough analysis of what constitutes workplace violence (ranging from threats to assault), and the disciplinary actions which may result. The policy does not address the issue of individuals experiencing symptoms of a mental illness or emotional disturbance that may affect their behavior.
- Non-Discrimination: The policy is direct, concise, and adequate for compliance.
- Workers Compensation: The policy addresses returning to work from a work-related (worker's compensation) injury, returning from a temporary disability, and those workers who may have a permanent disability. The majority of the policy is related to worker's compensation and short-term light duty; however, permanent disability terminology is mixed into the text.
- Long-Term Disability Coverage: The policy addresses partial salary continuation and benefits offered by the city.
- Pregnancy Disability Leave: The policy addresses unpaid leave of absence granted to employees who are temporarily unable to work due to disability related to pregnancy, childbirth, or related medical conditions.
- Resolution of Complaints and Grievances: The policy speaks to work-related concerns and gives steps to take to resolve complaints and grievances. Information regarding ADA concerns is not provided.
- Family Medical Leave Act (FMLA): The City has an extensive policy on FMLA.
- Personnel Files: The City does not have in writing a policy that all medical and accommodation information is kept separate from the employee's personnel file and kept confidential.

The City of Chino does not have any written policies/procedures on ADA Grievances for employees covered under Title I of the ADA.

The City of Chino does not have a written policy/procedures on reasonable accommodation for employees covered under Title I of the ADA.

The City of Chino does not have a written policy on short-term disability.

**Recommendations:**

- It is recommended that the disability policies for short-term disabilities be developed. Careful use of terms such as “reasonable accommodation” should be utilized in discussions of employees with permanent disabilities. Such terms may not necessarily be applied to employees returning to work from worker’s compensation or a short-term disability.
- It is important to note in all documentation that all medical and accommodation information is kept separate from the employee’s personnel file and kept confidential.
- The City of Chino should develop policies/procedures on grievances regarding ADA for employees covered under Title I of the ADA.
- The City of Chino should develop reasonable accommodation and short-term disability policies/procedures.

## 6.4 Human Resources: Position Descriptions

**Requirements:**

Title I of the ADA prohibits employers from discriminating against qualified individuals with disabilities in job application procedures, hiring, firing, advancement compensation, job training, and other terms, conditions, and privileges of employment. The ADA covers employers with 15 or more employees and includes State and local governments. No qualified individual with a disability shall, on the basis of disability, be subjected to discrimination in employment under any service, program, or activity conducted by a public entity.

**Findings:**

Several position descriptions were reviewed.

- Accountant
- Assistant Project Coordinator
- Clerk Typist I
- Crime Analyst
- Engineering Technician
- Equipment Mechanic

Job descriptions are separated out by essential job functions.

All job descriptions provide a “Physical Profile” and “Physical Requirements” section that provides approximation of frequency of the work and work condition.

All job descriptions use inclusive language.

All job descriptions do not include an Equal Employment Opportunity (EEO) statement.

All job descriptions do not provide contact information for accommodation requests.

All job descriptions do not include a disclaimer language to remind employees/applicants that the description is subject to change.

**Recommendations:**

- Job descriptions shall add language for reasonable accommodations for specific job requirements. For example, if a job requires moving heavy objects, add “with accommodations upon request” at the end of the statement. It is also best practice to include language that “supervisors may assign additional duties or requirements” so applicants know they can safely apply regardless of disability status.
- It is recommended that disclaimer language be included in all job descriptions to remind employees/applicants that the description is subject to change.
- Provide contact information for accommodation requests during the hiring process.
- It is recommended that an Equal Employment Opportunity (EEO) statement be added to all job descriptions.

**6.5 ADA Coordinator**

**Requirements:**

Title II also requires a designated accessibility coordinator to ensure the resolution of complaints and by inference, an employee or employees who will coordinate removal of barriers. A public entity that employs 50 or more persons shall designate at least one employee to coordinate its efforts to comply with and carry out its responsibilities under this part, including any investigation of any complaint communicated to it, alleging its noncompliance with this part, or alleging any actions that would be prohibited by this part. The public entity shall make available to all interested individuals the name, office address, and telephone number of the employee or employees designated pursuant to this paragraph.

**Findings:**

The City of Chino has an ADA Coordinator who investigates all complaints alleging that the government does not comply with the ADA.

The ADA Coordinator has the expertise and time necessary to coordinate the efforts to comply with the ADA.

The City of Chino makes the name of the ADA coordinator available on their website.



All the roles and responsibilities of the ADA Coordinator are provided.

A standardized investigation into all complaints is provided.

**Recommendations:**

- No recommendation.

## 6.6 Notice of the ADA's Provisions

**Requirements:**

An ADA Public Notice is required by all state and local governments covered by Title II, even entities with less than 50 employees. The target audience for the notice includes everyone who interacts with or would potentially interact with the Title II entity. The notice should include relevant information regarding Title II of the ADA, and how it applies to programs, services, activities of the public entity, and the contact information of the ADA Coordinator. The head of the public entity shall determine the most effective way of providing the public notice and provide the information on an ongoing basis. Information must be accessible to all and available in alternative formats (recording, radio announcement, large print, Braille, HTML format)

**Findings:**

The City of Chino adopted an ADA public notice similar to that of the DOJ recommendation. See Appendix B for public notice.

The City of Chino posts the ADA public notice on their website.

**Recommendations:**

- The City of Chino should establish a policy to inform people of their protection of the ADA in public locations and make the notice available in alternate formats.

## 6.7 Grievance Procedures

**Requirements:**

Title II of the Americans with Disabilities Act (ADA) requires government entities to establish a complaint procedure for both the public and employees. A public entity that employs 50 or more persons shall adopt and publish grievance procedures providing for prompt and equitable resolution of complaints alleging any action that would be prohibited by the ADA. The complaint procedure must include an accessible method of filing an accessibility complaint, such as a grievance procedure and grievance form posted on the city website.

**Findings:**

The City of Chino adopted a grievance procedure similar to the DOJ's recommendation. See Appendix C for grievance procedure.

The grievance procedure is posted on the city's website.

A grievance form is posted on the city's website.

**Recommendations:**

- Establish a policy to provide the grievance procedure in alternate formats.
- Distribute grievance procedures to all agency heads.
- Post grievance procedure copies in public spaces.
- Provide policy to update procedure and contact information as necessary.

## 6.8 General Effective Communications

**Requirements:**

Title II of the ADA requires that all state and local government take steps to ensure their communications with people with disabilities are as effective as communications with others. This requirement is referred to as "effective communication" and is required except where a state or local government can show that providing effective communication would fundamentally alter the nature of the service or program in question or would result in an undue financial and administrative burden. Effective communication applies to all members of the public with a disability, including job applicants, program participants, people who contact the state or local government seeking information about programs, services, or activities.

**Findings:**

The City of Chino does not have a written policy and procedures in place to deal with requests from the general public for sign language, oral, cued speech interpreters.

The City of Chino does not have employees who are qualified interpreters but does have arrangements with one or more vendors to provide interpreting services when needed.

The City of Chino does not have a written policy or procedure to deal with requests from the general public for documents in Braille, large print, audio, recording, and accessible electronic format.

The City of Chino does not have a written policy or procedure to deal with requests from the general public for notetakers, computer-assisted real-time transcription services, and other auxiliary aids.

The City of Chino does not have equipment or arrangements with vendors to provide written materials in alternative formats.

The City of Chino does not have a dedicated text telephone number for the public for all departments.

**Recommendations:**

- Develop policy to include information on interpreter:
  - time required to obtain interpreter
  - statement that a family member or companion of deaf persons shall not be requested to serve as sign language interpreter.
  - statement that a person with a hearing impairment shall not be charged for the cost of the interpreter
  - statement of when a request for an interpreter is denied based on undue financial and administrative burden and that the individual with a disability will receive the benefits or services provided
- Develop policies and procedures to provide auxiliary aids and services.
- Train employees so they know the policies and appropriate procedures to follow when they receive a request for interpreter or auxiliary aids.
- Make policy and procedures on the provision of interpreters/auxiliary aids available to employees in all departments who face the public.
- Make arrangements with vendors to provide written materials in alternate formats (e.g., Braille, large print, audio format, electronic format).
- Publish the City's effective communication policy on the City's website in an accessible format.
- Solicit feedback from the community who have different disabilities on the effectiveness of the communication policy.
- Where the City of Chino communicates by telephone with applicants and beneficiaries, text telephones (TTYs) or equally effective telecommunications systems shall be used to communicate with individuals who are deaf or hard of hearing or have speech impairments.
- Provide written policies and training to employees who answer telephone calls to ensure calls made through a relay service are handled as quickly and effectively as other calls

## 6.9 9-1-1 and Emergency Communication Services

### **Requirements:**

The ADA requires that all Public Safety Answering Points (PSAPs) provide direct and equal access to their services for people with disabilities who use teletypewriters (TTYs). PSAPs must directly receive TTY calls without relying on an outside relay service or third-party services. Telephone emergency services provided for TTY users must be as effective as those provided for people who make voice calls. All basic emergency services provided by public safety agencies are covered, including police, fire, and ambulance services. Direct, equal access must be provided to all services included in the system.

### **Findings:**

The City of Chino provides TTY and TTY-compatible equipment and procedures to maintain the equipment.

The City of Chino provides TTY users with equal access to other users including equal response time, quality of service, and hours of operations.

The City of Chino call takers respond to silent calls by querying the line with TTY.

The City of Chino makes TTY training mandatory and provides refresher training.

The City of Chino does not test their emergency services to ensure equal access for people using TTY.

### **Recommendations:**

- Conduct unannounced tests to all call-taking positions using both silent, open line calls and calls transmitting TTY tones.
- Keep record of results of all test calls including date and time of each call, identification of the call-taking position, whether the call was silent or transmitted tones, whether the caller received a TTY response and the content of the response, the time elapsed and the number of rings from the initiation of the TTY call until the call taker response by TTY, and whether the call was processed according to the City’s standard operating procedures.

## 6.10 Website Accessibility

### **Requirements:**

The Department of Justice (DOJ) has stated, as they have in the past with other elements, spaces, or technologies for which there are no technical accessibility specifications, that the absence of a technical standard does not “serve as a basis for noncompliance” with the ADA’s general obligation to ensure equal access to goods and services; rather, it means that entities have flexibility in how to facilitate that access. There are standards and guidelines that can help web developers create and maintain accessible websites. For example, the Web Content Accessibility Guidelines (WCAG) developed by the global Web Accessibility Initiative (WAI), which is part of the

World Wide Web Consortium, the main international standards organization for the Internet, have long been available, and the DOJ has often referred to these guidelines as a way of measuring the accessibility of websites.

**Findings:**

The City of Chino has performed an extensive analysis of the City's website for accessibility.

The City of Chino has an accessibility policy posted on their website but does not include specific steps and timeframes.

The City of Chino does not invite people with disabilities to test the City's webpages.

**Recommendations:**

- A thorough review for ADA compliance has been performed. Results can be found in Appendix E.
- Include specific steps and time frames to the existing website accessibility statement.
- Periodically invite people with a variety of disabilities to test the City's webpages for accessibility and ease of use.
- It is recommended that in-house staff and contractor staff receive copies of the Department of Justice's technical assistance document "Accessibility of State and Local government Websites to People with Disabilities" provided in Appendix D.

## 6.11 Curb Ramps and Pedestrian Crossing

**Requirements:**

Title II of the ADA requires State and local governments to make pedestrian crossings accessible to people with disabilities by providing curb ramps. This requirement applies if your state or local government has responsibility or authority over highways, streets, roads, pedestrian crossing, or walkways. Some public entities have extensive responsibilities for the street, roads, sidewalk, and pedestrian crossing in their area, but most public entities have limited responsibility for them.

**Findings:**

The City of Chino has adopted their "Policy on Accessible Pedestrian Facilities". The policy has technical requirements on curb ramps, pedestrian street crossings, and sidewalks. The policy also requires designers to specify measurements more than the minimum and less than the maximum requirements.

The City of Chino does not have written procedures used to evaluate requests for installation of, or modification to curb ramps.

**Recommendations:**

- Provide a curb ramp request form on the City’s website.
- Ask for input from people with disabilities to determine priority of curb ramp remediation.
- Ensure all curb ramps are upgraded at pedestrian crossings and roadway alterations since 1992.

**6.12 Emergency Management**

**Requirements:**

One of the primary responsibilities of state and local governments is to protect residents and visitors from harm, including assistance in preparing for, responding to, and recovering from emergencies and disasters. State and local governments must comply with Title II of the ADA in the emergency- and disaster-related programs, services, and activities they provide. This requirement applies to programs, services, and activities provided directly by state and local governments as well as those provided through third parties, such as the American Red Cross, private nonprofit organizations, and religious entities. Under Title II of the ADA, emergency programs, services, activities, and facilities must be accessible to people with disabilities and generally may not use eligibility criteria that screen out or tend to screen out people with disabilities. The ADA also requires making reasonable modifications to policies, practices, and procedures when necessary to avoid discrimination against a person with a disability and taking the steps necessary to ensure effective communication with people with disabilities. The ADA generally does not require state or local emergency management programs to take actions that would fundamentally alter the nature of a program, service, or activity or impose undue financial and administrative burdens.

**Findings:**

The City of Chino’s Emergency Operations Plan was last updated in 2014. The city is developing a Mass Care & Sheltering Plan. Most of the procedures/policies in this plan offer accessibility features to ensure emergency programs, services, and activities are accessible to people with disabilities.

The City of Chino has an agreement with Red Cross for sheltering, but the agreement does not address ADA requirements.

The City of Chino does not have written procedures to regularly seek and use input from persons with a variety of disabilities and organizations with expertise in disabilities in all phases of emergency planning.

The City of Chino does not have written procedures to ensure that their community evacuation plan enables people with a variety of disabilities to safely self-evacuate and, for those who cannot self-evacuate, to receive assistance.

The City of Chino does not have policy/procedures to train shelter staff and volunteers with site-specific instructions for providing people with disabilities access to all services at emergency shelters.



The City of Chino does not have a written policy or procedure to ensure that facilities used as a shelter in the future be surveyed for accessibility and have barriers to access removed.

The City of Chino does not have supplies of informational materials routinely handed out at emergency shelters available in alternative formats (Braille, large print) for people who are blind or have low vision.

The City of Chino does not provide “stress-relief” zones at any emergency shelters.

The City of Chino does not provide TTYs at all emergency shelters.

The City of Chino allows for service animals at emergency shelters but does not have a policy to allow people to take their animals outside for relief without unnecessary delays during security screening.

The City of Chino does not have back-up generators or a way to keep medication refrigerated.

The City of Chino emergency management plan does not include a way for people with disabilities to request and receive durable medical equipment and medication while in shelter.

The City of Chino does not have policies to provide immediate access to food and refrigerated medications for shelter residents and volunteers.

The City of Chino does not have policies and procedures to ensure medical and social services and other benefit programs are accessible to people with disabilities.

**Recommendations:**

- Ensure third party organizations contracted or arranged to help with emergency preparedness or management commit to compliance with the requirements of Title II of the ADA in formalized agreements.
- Seek and use input from people with different types of disabilities and organizations with expertise on disability issues regarding all phases of the emergency management plan.
- Adopt policies to ensure people with disabilities, including those who have mobility, vision, hearing, cognitive, and psychiatric disabilities, can safely self-evacuate or be evacuated by others.
- Consider creating voluntary, confidential registries of people with disabilities who may need individualized notification, evacuation assistance, or transportation. Establish procedures to ensure the registries are voluntary and guarantee confidentiality, and include a process to update information in the registry.
- Publicize the optional voluntary registries, including outreach to people with disabilities, and organizations with expertise on disability issues. Outreach should explain the purpose of the registries and emphasize the confidential nature of the registry.
- Establish policies and procedures to ensure facilities considered as possible emergency shelters are surveyed and that barriers to access are removed before facilities are designated as emergency shelters.



- Adopt procedures to provide effective communication for people who are deaf or have low vision.
- If space allows, offer low-stimulation “stress-relief zones”. Adopt policies and procedures to give priority to people whose disabilities are aggravated by stress.
- Adopt policies to provide TTYs at all emergency shelters.
- Modify “service animal” policies to allow people with disabilities to take their animals outside for relief without unnecessary delays for screening upon re-entry.
- Ensure shelters have back-up generators and a way to keep medication refrigerated. These shelters shall give priority to people whose disabilities require access to electricity and refrigeration. Routinely notify the public about the location of shelters with these features.
- Modify kitchen-access policies to allow residents and volunteers whose disabilities may require it can obtain immediate access to food and refrigerated medication. In planning, ensure that at least some kinds of foods and beverages are available for people with dietary restrictions.
- Establish policies and procedures to ensure medical, social service, and other benefit programs are accessible to people with disabilities.

## 7. SELF-EVALUATION: FACILITY AND PROW ASSESSMENTS

A public entity shall evaluate all existing programs and facilities to ensure they are readily available to and usable by people with disabilities. This includes buildings, parks, and public right-of-way pedestrian facilities. Assessments were completed not only for buildings and facilities that were existing prior to the enforcement date of January 26, 1992, but also buildings and facilities that were constructed or altered after this date. These new programs and facilities were required to comply with the standards at the time of construction or alteration, however, the City selected to survey these facilities to note any existing deficiencies to be able to take corrective action and to ensure regulatory compliance.

### 7.1 City Facilities

The table below lists the locations of all city buildings and parks where programs, services, and activities are provided by the City of Chino.

FACILITY	ADDRESS
7th Street Park	7th Street/Riverside Drive, Chino, CA 91710
7th Street Theater	13123 7th Street, Chino, CA 91710
Aguiar Square	13191 6th Street, Chino, CA 91710
Ayala Park	14225 Central Avenue, Chino, CA 91710
Ayala Park Operations Center	5575 Edison Avenue, Chino, CA 91710
Carolyn Owens Centennial Square	12732 Central Avenue, Chino, CA 91710
Carolyn Owens Community Center	13201 Central Avenue, Chino, CA 91710
Central Park	13219 Central Avenue, Chino, CA 91710
Chaffey College Business Office	13160 7th Street, Chino, CA 91710
Chaffey College IT Center	13170 7th Street, Chino, CA 91710
Chaffey College/Chino Center	13106 Central Avenue, Chino, CA 91710
Chino Branch Library	13180 Central Avenue, Chino, CA 91710
Chino Community Garden	5976 Riverside Drive, Chino, CA 91710
City Hall	13220 Central Avenue, Chino, CA 91710
Classics Park	14212 Haverford Street, Chino, CA 91710
Community Building	5443 B Street, Chino, CA 91710
Community Building Park	5443 B Street, Chino, CA 91710
Community Garden	5136 D Street, Chino, CA 91710
Constellation Park	6903 Eucalyptus Avenue, Chino, CA 91710
Cypress Trails Park	6571 Schaefer Avenue, Chino, CA 91710
Discovery Park	16461 Discovery Park Avenue, Chino, CA 91710
Energy Park	14209 Regis Street, Chino, CA 91710
Evergreen Park	8200 Garden Gate Street, Chino, CA 91708
Family Services Center	13271 Central Avenue, Chino, CA 91710
Fire Station #1 & Training Center Facility	5078 Schaefer Avenue, Chino, CA 91710
Fire Station #5	12220 Ramona Avenue, Chino, CA 91710
Fire Station #63	75500 Kimball Avenue, Chino, CA 91708

ADA TITLE II SELF-EVALUATION AND TRANSITION PLAN

CITY OF CHINO

BUREAU VERITAS PROJECT: 160001.23R000-FNL.206

Fire Station #7	5980 Riverside Drive, Chino, CA 91710
Forest Park	8706 Bridle Path, Chino, CA 91708
Founders Park	8151 West Preserve Loop, Chino, CA 91708
Gallery Park	14484 San Antonio Avenue, Chino, CA 91710
Garden Park	16001 Huntington Garden Avenue, Chino, CA 91708
Golden Tree Park	7815 Meridian Street, Chino, CA 91708
Gray Building/Chamber of Commerce	13150 7th Street, Chino, CA 91710
Harvest Park	14424 Temple Avenue, Chino, CA 91710
Heritage Park	4250 Chino Avenue, Chino, CA 91710
Hidden Hallow	15784 Canopy Avenue, Chino, CA 91708
Inspiration Park	6540 Wheaton Street, Chino, CA 91710
Liberty Park	11860 Telephone Avenue, Chino, CA 91710
Liberty Park Recreation Center	11860 Telephone Avenue, Chino, CA 91710
Lotus Park	6388 Merrimack Street, Chino, CA 91710
McLeod Park	12550 Carissa Avenue, Chino, CA 91710
Meridian Park - North	8075 Moonspinner Street, Chino, CA 91708
Meridian Park - South	8077 Moonspinner Street, Chino, CA 91708
Monte Vista Park	13196 Monte Vista Avenue, Chino, CA 91710
Monte Vista Park Recreation Center/Teen Center	13196 Monte Vista Avenue, Chino, CA 91710
Mountain View Park	13351 Mountain Avenue, Chino, CA 91710
Mulberry Park	15737 Edgewood Street, Chino, CA 91708
Nature Retreat Park	15846 Rincon Meadows Avenue, Chino, CA 91708
Neighborhood Activity Center (NAC)	5201 D Street, Chino, CA 91710
Oak Tree Square Park	5112 Riverside Avenue, Chino, CA 91710
Old Schoolhouse Museum	5493 B Street, Chino, CA 91710
Olympic Park	6310 Southwestern Street, Chino, CA 91710
Owen's Bistro	5210 D Street, Chino, CA 91710
Police Department	5450 Guardian Way, Chino, CA 91710
Preserve Community Center	15800 Main Street, Chino, CA 91710
Public Works Services Center	5050 Schaefer Avenue, Chino, CA 91710
Sebring Park	12379 Sycamore Avenue, Chino, CA 91710
Secret Garden Park	15779 Starfighter Avenue, Chino, CA 91708
Senior Center	13170 Central Avenue, Chino, CA 91710
Shady Grove Park	6776 Chino Avenue, Chino, CA 91710
Symphony Park	14395 Haverford Avenue, Chino, CA 91710
Villa Park	13513 3rd Street, Chino, CA 91710
Walnut Park	4600 Walnut Avenue, Chino, CA 91710
Water Environmental Building	13179 & 13191 9th Street, Chino, CA 91710
Youth Museum	13191 6th Street, Chino, CA 91710

A full list of programs and services currently provided by the City of Chino is provided in Appendix H.



The scope of the individual assessments comprised of the exterior features/amenities of the site and the interior of the buildings on site. Exterior elements assessed include accessible parking and exterior accessible pedestrian paths of travel to and from all amenities and features provided at each site. Interior spaces consist of the common corridors, public restrooms, conference rooms, offices, and other interior elements along the common path of travel, such as water fountains.

A Bureau Veritas Subject Matter Expert visited each property within the City of Chino to evaluate the facilities in accordance with the ADA and State of California Building Code and assess the existing property improvements' compliance with the Title II provisions of the Americans with Disabilities Act (ADA) and applicable state requirements.

The field observer conducted a thorough review of the facility to observe and identify barriers to accessibility and formulate recommendations to remedy the physical barriers. As a part of the review, the field observer met with a property representative with specific knowledge of the facility to gain a clear understanding of overall features, public use patterns, and relevant historical data. All features of the property are subject to observation, which includes but is not limited to parking lots, sidewalks, access ramps, and all common areas accessible to the public, as well as employee areas.

During the site walk-through, the field observer followed a Survey Form that meets or exceeds the current ADAAG format and utilized a digital level, measuring tape, pressure gauge, and digital camera. The field observer identified and prioritized any existing improvements not in accordance with the applicable ADA requirements in the order of preference as set out by the DOJ in general categories and refined by Bureau Veritas.

The Bureau Veritas team assessed exterior and interior in order to identify existing conditions that are not in accordance with the applicable regulations. Examples of elements required to be accessible are:

- Parking- adequacy as to automobile number, van accessible number, signage, and markings
- Parking and passenger loading zones
- Accessible routes: sidewalks and paths, interior routes
- Space allowance and ranges
- Protruding objects
- Ground and floor surfaces
- Curb and other ramps; size, distance, slope, rails, and surface finishes
- Exterior and interior common stairs
- Platform lifts (wheelchair lifts)
- Entrances and exits to common areas and employee areas
- Handrails and grab bars
- Alarms (visual and audible) and warnings
- Signage, Braille, and visual
- Switches and outlets


Individual assessment reports for each property surveyed included:

- Summary of Findings for all amenity features (parking stalls, curb ramps, paths of travel, etc.)
- Individually recorded barriers
- Digital photos of observed deficiencies and representative photos of elements observed to be in compliance
- Geocode GPS references for the location of observed deficiencies
- Applicable ADA and State of California regulatory references
- Recommendations for viable corrective measures necessary to comply with regulations
- Planning level cost estimates for each barrier

Assessment results were tabulated into an ADA database using AssetCALC™, an online interactive database created by Bureau Veritas to manage ADA and state accessibility code information. The AssetCALC™ asset management database used by Bureau Veritas establishes an online database in [www.Assetcalc.net](http://www.Assetcalc.net), which is used to compile records of all deficiencies and accessibility barriers, store photos, and documents related to the individual facilities, and create reports. AssetCALC™ provides the ability to list, prioritize, query, and track accessibility barrier removals. Cost data in the database is calculated using rounding. Any minor discrepancies in the costs shown in this report are the result of rounding.


### 7.2 City PROW Pedestrian Facility

As part of the City of Chino’s effort to comply with Title II of the ADA, the City’s pedestrian facilities in the public right-of-way were evaluated for ADA compliance using the proposed PROWAG and applicable state and local accessibility regulations. 4,260 curb ramps, 85 transit stops, 844 pedestrian signals, and 369.59 miles of sidewalk were assessed for physical barriers to accessibility from April 2023 to August 2023. The figure below displays all areas evaluated as part of the City owned public right-of-way. The full sidewalk and curb ramp evaluation maps are provided in Appendix F.

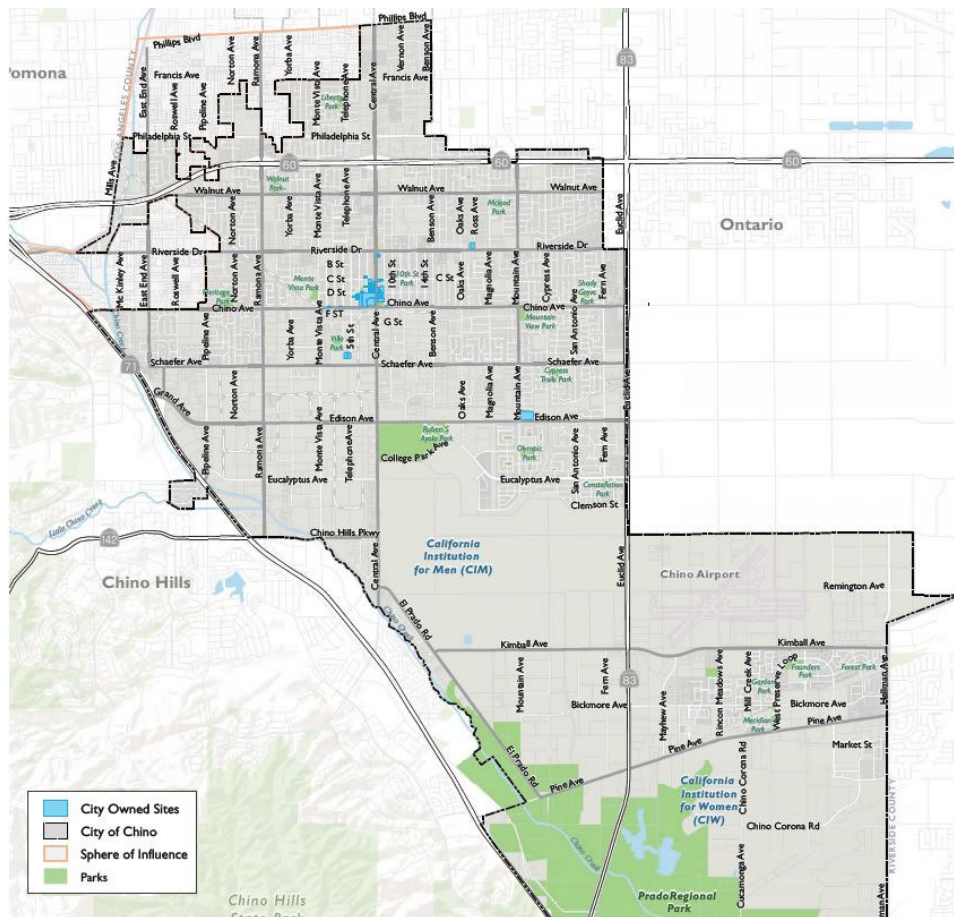

Map View of City PROW Facility

Sidewalk data was collected using pathVu's "pathMet" sidewalk profiler, which was developed for sidewalk ADA assessments. *pathMet* is a manually propelled, multi-sensor, stroller-type profiling tool. It uses GPS and high-resolution cameras, lasers, and sensors to measure ADA compliance of sidewalks including cross slope, running slope, surface roughness, clear width of sidewalks, protruding hazards, and level changes. Deviations from the required ADA standards and other applicable guidelines pertaining to PROW are identified using detailed information on slopes and surface variations. A comprehensive data set has been provided to the City for inclusion into the City's existing GIS system.

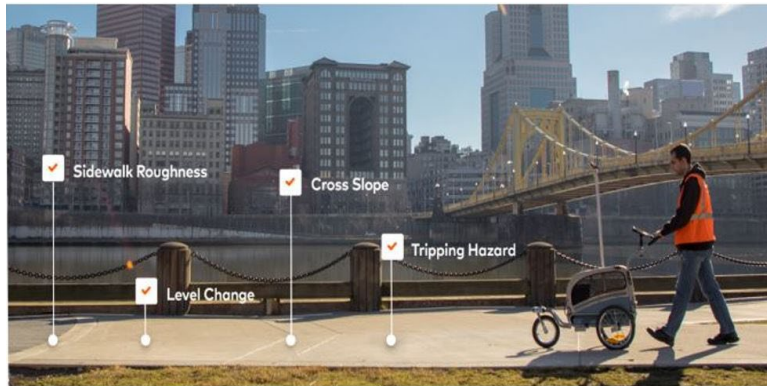

Curb ramps were assessed using pathVU's "curbMet" assessment tool. Data collected included: running slope, cross slope, width and length dimensions, flare information, the presence of detectable warnings, damages, obstructions, landing slopes, as well as several other attributes. The internal data collection checklist is based on ADA and the California Building Code requirements as well as the Public Right of Way Accessibility Guidelines (PROWAG) recommendations. A comprehensive data set has been provided to the City for inclusion into the City's existing GIS system.



### 7.3 Basis for Probable Costs

The estimates for the repair and capital reserves items noted within this report are summarized in Section 11.2. Individual observation details for City facilities are provided in Appendix J.

The estimates are based on invoice or bid documents provided either by the Owner/facility and construction costs developed by construction resources such as *R.S. Means* and *Marshall & Swift*, Bureau Veritas's experience with past costs for similar properties, city cost indexes, and assumptions regarding future economic conditions. Typically, barrier removal allowances are based upon the removal of the specific element being evaluated (for example, parking stalls, curb ramps, ramps). Grading plans based on field surveys using land surveyor instrumentation could result in significantly different material quantities and subsequent higher project costs. Bureau Veritas has no control over the final scope of work, pricing methods, and costs associated with a contractor constructing the project. The opinion of probable costs within this report cannot guarantee that the costs will accurately reflect the actual bids for construction.

## 8. COMPLIANCE STRATEGY

---

The proposed strategy for ADA compliance is a multi-phase approach for facility access as well as programmatic access. The goal of this strategy is to ensure that the programs, services, and opportunities offered by the City of Chino are accessible to the citizens of the City of Chino community, regardless of abilities, yet provide a realistic plan for barrier removal, which is within the fiscal capabilities of the City of Chino.

The provision of facility access is proposed to be based on a park/facility level, with the initial focus on the highest use properties. As its foundation, the proposed strategy is to ensure amenities which are in highest demand are accessible, subject to various limitations such as technically infeasible conditions and undue financial and administrative burdens. The strategy takes into account numerous factors such as population density, usage levels, amenity uniqueness, and other factors. This strategy will enable the best use of available funds to provide the optimal facility access to the City's programs for all citizens.

Programmatic access will be an ongoing effort. The City of Chino will initiate efforts to improve facility access, develop, and expand its review of its many programs with a focus on policy initiatives, inclusion, and reasonable accommodation needs. Not all structural barriers must be removed, as long as the disabled community is accommodated, and the unique programs, facilities, and services of the city are made available for disabled users. Selected recurring amenities will be made barrier-free, so that at least one of each type of amenity is accessible.

Additionally, the City will develop a maintenance program to ensure all accessible features in facilities remain compliant over time. This program will maintain the accessibility requirements of elements as they are replaced or improved at buildings, parks and within the public right-of-way. It will also be a way to ensure any new facilities to the City comply with the requirements when they are being maintained or improved.

The level of funding is expected to continue at the same level going forward. Therefore, the majority of barrier removal is not anticipated to be funded as a separate initiative, but rather as part of larger capital projects. Barrier removal must be accomplished in phases, as funding becomes available.

## 9. PHASING AND PRIORITIES

### 9.1 City Facility Phasing and Individual Facility Barrier Priorities

With feedback from the public during development of the Transition Plan and according to facility usage levels, priority groupings of facilities were identified to guide the barrier removal work. Facility usage rates were primarily determined by the number of amenities, services, and programs available at a facility and general visual observation by City staff. Phasing plans based on priorities are:

- Phase One (Fiscal Years 2024 – 2029) - Ayala Park, Ayala Park Operations Center, Carolyn Owens Community Center, City Hall, Chaffey College Business Office, Chaffey College IT Center, Chaffey College/Chino Center, Chino Branch Library, Community Building, Heritage Park, Mountain View Park, Founders Park, Gray Building, Preserve Community Center
- Phase Two (Fiscal Years 2028 – 2031) - 7<sup>th</sup> Street Theater, Aguiar Square, Carolyn Owens Centennial Square, Community Garden on Riverside Drive, Community Garden on D Street, Family Services Center, Neighborhood Activity Center, Old School House Museum, Olympic Park, Owen’s Bistro, Senior Center, Villa Park, Water Environmental Building, Youth Museum
- Phase Three (Fiscal Years 2030 – 2033) – Parks with Multiple Programs and Amenities
- Phase Four (Fiscal Years 2032 – 2035) – Parks with Some Programs and Amenities
- Phase Five (Fiscal Years 2034 – 2037) – Fire Stations, Police Department, Public Works Service Center

The following priority levels have been used to assign priorities to barriers within each property and facility.

**Priority 1: *Path of Travel-***

***Accessible Van Parking*** – Access to a public facility begins with accessible parking. Van accessible parking is deemed the most important barrier. Those with the most severe disabilities tend to require a van accessible space to accommodate their vehicle and mobility device. In addition, when only the minimum number of accessible spaces is required, it must be a van accessible space. This priority includes all barriers associated with the compliance of a van accessible space including signage, restriping, constructing, or reconfiguring the pavement to accommodate the required number of spaces.

***Accessible Car Parking*** – Access to a public facility begins with accessible parking. Car accessible parking is deemed the second most important barrier. This priority includes all barriers associated with the compliance of a van accessible space including signage, restriping, constructing, or reconfiguring the pavement to accommodate the required number of accessible spaces.

***Accessible Approach and Entrances*** – A public agency is required to take measures to provide access to a place of public accommodation and employee areas from public sidewalks, parking, or public transportation. The DOJ dictates the minimum width, cross and running slope, signage, and handrail requirements associated with pedestrian accessible routes of travel. These measures include, for example, installing an entrance ramp, correcting tripping hazards or lessening the slope of a curb ramp. At least one route of travel to each amenity or feature should be safe and accessible for everyone, including people with disabilities.



**Priority 2: *Elements used for programs, services, and activities-*** Barriers may include play equipment, picnic tables, public counters, benches, and trash receptacles.

**Priority 3: *Restrooms, Signage*** - Barriers may include widening of toilet stalls, installation of grab bars, and lowering lavatories and mirrors.

**Priority 4: *Access to Auxiliary Features and Amenities*** – A public agency is required to take measures to provide access to auxiliary features and amenities along paths of travel, for instance, kiosks, water fountains, and kitchen appliances.

**Priority 5: *Employee-only Areas***- Employee-only areas are required to have accessible entrances and exits, and accessible paths of travel within interior work areas and workstations. Corridors in employee-only areas, employee-only restrooms, employee-only kitchens and employee-only break rooms are considered public areas (rather than employee-only areas) under the ADA, and therefore, are required to fully comply with accessibility regulations governing those types of areas.

Employee areas have been set as the lowest priority, due to the fact that the total estimated cost for barrier removal in public areas is the more pressing need.

Some of the existing accessibility barriers require a minimal amount of effort or expense to remove and are found throughout the system. These types of barrier removals are called “Low Hanging Fruit,” or easy barrier removal. “Low hanging fruit” is defined as accessibility barrier removal which can be incorporated into recurring work being completed on a life cycle basis, and which is relatively low in cost.

## 9.2 City PROW Barrier Phasing

The City of Chino has adopted a 20-year plan to complete barrier remediation for pedestrian facilities within the public right-of-way (PROW). Barrier remediation has been prioritized into three phases based on the severity and location of the barriers. To provide a method to determine the severity, a sidewalk Route Accessibility Index (RAI) score and a curb ramp score was created and assigned to each sidewalk section and curb ramp. Phasing for barrier removal in the PROW was prioritized using the RAI value and curb ramp score. The estimated fiscal years to remove barriers to accessibility in each phase are summarized below.

- Phase 1 – Fiscal Years 2024 – 2028
- Phase 2 – Fiscal Years 2028 – 2035
- Phase 3 - Fiscal Years 2035 – 2044

The sidewalk RAI scores range from 0 to 100 and are a weighted scale of the vertical level changes, smoothness of the surface, running and cross slopes. A sidewalk section with a score of 0 to 40 is considered inadequate with multiple barriers to access and a score of 90 - 100 is considered great to good with zero to little barriers to access. For example, a sidewalk section with an RAI of 0 - 40 may be identified with vertical changes in level, excessive cross slopes, and a rough surface with multiple cracks. The purpose of the RAI is to provide a weighted usability average to each segment of sidewalk. The RAI can be adjusted based on City of Chino’s needs. The current weights are set at 40% level changes, 15% roughness, 40% cross slope, and 5% running slopes.


Similarly, the curb ramp score is a weighted calculation of the various measured attributes including cross slopes, running slopes, flare slopes, landing slopes, clear width, obstructions, and the presence of detectible warnings. It is intended only to provide a general usability rating (0 – 4 being missing / poor, and 10 being fully or nearly fully compliant), and can be adjusted based on the City of Chino’s needs.

In addition, criteria for removal of barriers in the right-of-way also include the following:

- Locations of citizen complaint or request (ADA Title II program access),
- Locations serving government offices and public facilities,
- Locations serving transportation,
- Locations serving commercial districts and employers; and
- Residential areas

For example a Phase 1 curb ramp serving an area with government offices and public facilities will take priority over a Phase 1 curb ramp serving a transportation area and so forth. Citizen’s complaint or request will take priority above all else.

In conjunction with the City’s 2016 Bicycle and Pedestrian Master Plan, the City of Chino has identified several priority areas surrounding frequently accessed public buildings, schools, and retail areas. Sidewalk, curb ramp, bus stop, and pedestrian signal barriers have been identified within these areas and a budgetary cost to remove them has been established.

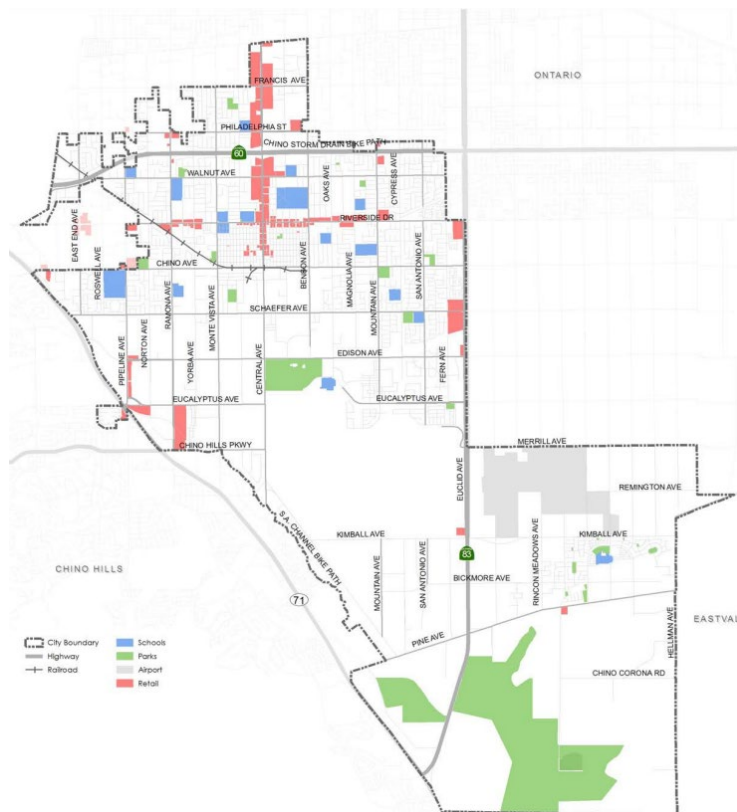

(City of Chino Bicycle and Master Plan 2016)

---

## 10. CITY OF CHINO FUNDING LEVELS

---

The total amount of revenue in the 2023 budget was approximately \$362,133,235. The majority of the funds are allocated to expenses not related to physical facility improvements, such as wages, insurance, equipment, and other program expenses. The existing revenue level is not anticipated to increase significantly in the future. The City of Chino generates its funding from several sources:

- Special Revenues
- City DIF
- Preserve DIF
- Enterprises
- Internal Service

The Capital Improvement Plan proposed budget for fiscal year 2023-2024 is approximately \$120.3 million with \$10,342,246 going towards accessibility improvements.

Based on the information above, the annual funding level for barrier removal can be no greater than the funds available for Capital Projects at a maximum, although some barriers may be removed through maintenance project funds, such as “low hanging fruit”.

## 11. TRANSITION PLAN COMPONENTS

### 11.1 Overview

The 2023 Transition Plan is a snapshot in time to evaluate and prioritize accessibility barrier removal throughout the City of Chino system. The Transition Plan will be a living document and not a static view of the existing state of ADA compliance at the City of Chino. As such, it can be modified and updated on a periodic basis to reflect barrier removal efforts, changes in economic conditions, new and revised strategies, and reflect future public input.

The Transition Plan is a flexible document, as strategies, priorities, and funding opportunities change. The City of Chino demographics may vary from the current demographic composition of San Bernardino County. Public preferences for recreational types may change, while funding priorities and funding levels may change as well.

The Transition Plan will require modification as conditions and priorities are changed, new ADA requirements are issued by the DOJ, and/or unanticipated policy, or fiscal needs occur.

As the ADA Coordinator for the City of Chino, Lisa Almilli is responsible for implementing and updating the City of Chino Transition Plan. At a minimum of at least once a year, the Transition Plan should be updated, noting the barriers removed and any changes to the funding noted. Lisa Almilli can be reached at [lalmilli@cityofchino.org](mailto:lalmilli@cityofchino.org) or by phone 909-334-3524 or in person at 13220 Central Avenue, Chino, California 91710.

### 11.2 Barriers Summary

The removal of all identified physical accessibility barriers for buildings, parks, and pedestrian facilities in the public right-of-way (PROW) in the City of Chino system is estimated to cost \$204,211,965. The existing barrier planning level cost estimate totals are summarized in table below:

Facility Type	Estimated Cost
Buildings and Parks	\$4,121,325
PROW	\$200,090,640
<b>Total</b>	<b>\$204,211,965</b>

For the accessibility summaries of individual facilities for buildings and parks, see Appendix I.

### 11.3 Buildings and Parks Barrier Removal Strategy

The City of Chino has adopted a multi-phase strategy using the ranking criteria of facility usage levels to determine the phases for barrier removal. The long-term goal is to make all unique amenities and at least one of each type of recurring amenity accessible. In order to meet the programmatic requirement for accessibility of programs, services, and activities to individuals with disabilities by local agencies, the City will make accommodations upon request. For further explanation of the obligations of a public agency, see Appendix A.

The planning level cost estimates for each phase are summarized below:

Facility / Building	Total	
	Est. Cost	Items
<b>Phase One (Fiscal Years 2024 – 2029)</b>		
Ayala Park	\$202,699	86
Ayala Park Operations Center	\$99,826	40
Carolyn Owens Community Center	\$37,326	54
City Hall	\$293,669	136
Chaffey College Business Office	\$12,825	19
Chaffey College IT Center	\$58,865	38
Chaffey College/Chino Center	\$89,787	53
Chino Branch Library	\$49,793	32
Community Building	\$324,785	99
Heritage Park	\$91,079	32
Mountain View Park	\$128,128	56
Founders Park	\$25,182	17
Gray Building/Chamber of Commerce	\$28,768	23
Preserve Community Center	\$126,315	29
<b>Total Phase One</b>	<b>\$1,569,046</b>	<b>714</b>
<b>Phase Two (Fiscal Years 2028 – 2031)</b>		
7th Street Theater	\$136,291	68
Aguilar Square	\$73,182	33
Carolyn Owens Centennial Square	\$24,470	12
Chino Community Garden	\$33,652	23
Community Garden	\$14,113	10
Family Services Center	\$154,743	55
Neighborhood Activity Center (NAC)	\$94,167	34
Old Schoolhouse Museum	\$22,464	22
Olympic Park	\$96,575	71
Owen's Bistro	\$50,012	37
Senior Center	\$183,350	56
Villa Park	\$71,182	31
Water Environmental Building	\$240,628	78
Youth Museum	\$156,971	39
<b>Total Phase Two</b>	<b>\$1,351,799</b>	<b>569</b>



<b>Phase Three (Fiscal Years 2030 – 2033)</b>		
Cypress Trails Park	\$37,416	27
Discovery Park	\$9,810	5
Forest Park	\$33,952	17
Gallery Park	\$14,653	10
Garden Park	\$58,696	26
Hidden Hallow	\$36,373	29
Liberty Park	\$61,295	33
Liberty Park Recreation Center	\$55,788	47
McLeod Park	\$31,800	18
Meridian Park - South	\$50,232	53
Monte Vista Park	\$19,793	4
Monte Vista Park Recreation Center/Teen Center	\$29,844	32
Nature Retreat Park	\$59,787	6
Sebring Park	\$5,876	8
Secret Garden Park	\$24,746	5
Shady Grove Park	\$39,074	19
Walnut Park	\$36,555	20
<b>Total Phase Three</b>	<b>\$605,687</b>	<b>359</b>
<b>Phase Four (Fiscal Years 2032 – 2035)</b>		
7th Street Park	\$6,105	4
Central Park	\$14,534	11
Classics Park	\$11,519	7
Community Building Park	\$22,587	17
Constellation Park	\$23,323	10
Energy Park	\$29,061	26
Evergreen Park	\$24,414	5
Golden Tree Park	\$8,000	1
Harvest Park	\$17,601	6
Inspiration Park	\$20,060	5
Lotus Park	\$56,885	8
Meridian Park - North	\$30,845	14
Mulberry Park	\$24,334	9
Oak Tree Square Park	\$20,249	7
Symphony Park	\$16,273	10
<b>Total Phase Four</b>	<b>\$325,792</b>	<b>140</b>




<b>Phase Five (Fiscal Years 2034 – 2037)</b>		
Fire Station #5	\$25,254	13
Fire Station #63	\$3,793	9
Fire Station #7	\$5,001	12
Fire Station No. 1 & Training Center Facility	\$4,824	10
Police Department	\$11,531	16
Public Works Services Center	\$218,598	131
<b>Total Phase Five</b>	<b>\$269,001</b>	<b>191</b>
<b>Grand Total</b>	<b>\$4,121,325</b>	<b>1973</b>

See Appendix J for the full listing of barriers in each phase.

### 11.4 PROW - Sidewalk Barrier Removal Summary

The data collected on this assessment was in continuous block runs of sidewalks. The data was captured into 10-foot run sections, so as not degrade an entire block for one 10 or 20 linear foot issue. Each 10-foot run segment provides an aggregated score of the roughness and the extreme value of vertical level changes, slope, or gap. The GIS data provided to the City is capable of being viewed in both ‘block-level’ runs and 10-foot run sections.

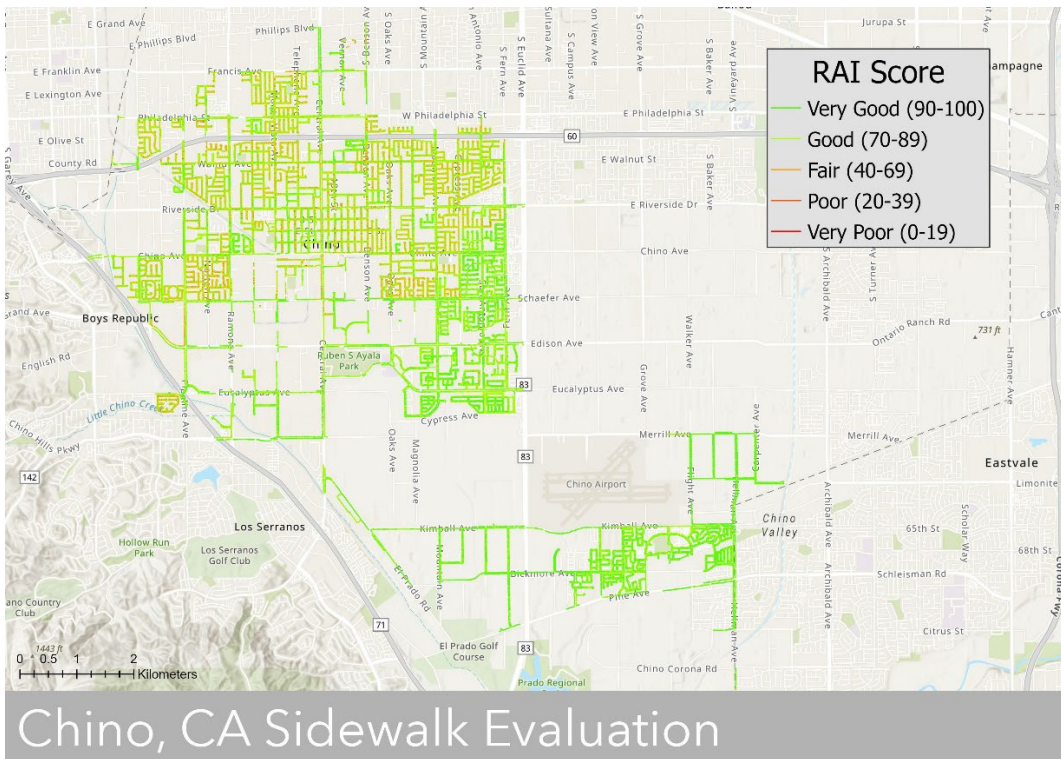

Overall GIS / Map View of Sidewalk Inventory

Based on the onsite review, Bureau Veritas found that barriers to accessibility exist within the city sidewalks. The observed elements were analyzed using the Access Board’s proposed Public Rights-of-Way Accessibility Guidelines (PROWAG) and the California Building Code.

The following table summarizes the sidewalk barriers that were identified including remediation method and cost and their priorities base on their RAI score.

**CHINO, CALIFORNIA - SIDEWALK ACCESSIBILITY SUMMARY**

Metric	As-Built	10' Seg	As-Built	10'Seg	As-Built	10' Seg	As-Built	10'Seg
Vertical Changes	1" Plus	420	0.5" to 1"	2,006	0.25" to 0.5"	31,710	<0.25"	160,995
Running Slope*	N/A	N/A	> 8.3%	5,866	5%-8.3%	22,251	< 5%	167,014
Cross Slope	> 5.0%	44,291	3.0% to 5.0%	41,643	2.08% to 3.0%	43,382	< 2.08%	65,815
Roughness	> 100	528	75 to 100	993	50 to 75	4,034	< 50	189,576

Total 10-Foot Segments = 195,141

- Running Slope is currently an issue with ADA. Running Slope issues have been addressed in the 2022 CBC and the US Access Board has published their final rule for the Public Right of Way Accessibility Guidelines (PROWAG). Both of these rules allow for the sidewalk running slope to match the running slope of the adjacent street. No costs were associated with the running slope barriers as they should come into compliance when the DOJ and DOT adopt the rule.

**CHINO, CALIFORNIA - SIDEWALK PHASING BY RAI**

Metric	Phase 1	10' Seg	Phase 2	10'Seg	Phase 3	10' Seg	Lifecycle Replacement	10'Seg
Route Accessibility Index (RAI)	0 - 40	1,920	40-70	29,986	60-90	104,158	90-100	59,067

Total 10-Foot Segments = 195,141

**CHINO, CALIFORNIA – SIDEWALK REMEDIATION COST BY PHASES**

Metric	Phasing	Remediation Method	Cost per section	# of 10' sections	Remediation Cost
Vertical Rise	Phase 1 (1" plus)	Grinding	\$115.00	420	\$48,300.00
	Phase 2 (0.5" – 1")	Grinding	\$115.00	2,006	\$230,690.00
	Phase 3 (0.25" – 0.5")	Grinding	\$115.00	31,710	\$3,646,650.00
	Total Cost				\$3,925,640.00
RAI Score (\$25/s.f.) (50 s.f. / section)	Phase 1 (0-40)	Replacement	\$1,250.00	1,920	\$2,400,000.00
	Phase 2 (40-70)	Replacement	\$1,250.00	29,986	\$37,482,500.00
	Phase 3 (70-90)	Replacement	\$1,250.00	104,158	\$130,197,500.00



Metric	Phasing	Remediation Method	Cost per section	# of 10' sections	Remediation Cost
	Lifecycle (90-100)	Replacement	\$0.00	59,067	\$0.00
	Total Cost				\$170,080,000.00
Totals	Phase 1				\$2,448,300.00
	Phase 2				\$37,713,190.00
	Phase 3				\$133,844,150.00
	Total Cost				\$174,005,640.00

Total 10-Foot Segments = 195,141


SUMMARY OF BARRIERS TO ACCESS – SIDEWALKS

- 369.59 miles of sidewalk were assessed
- 111.87 (30.27%) miles of sidewalk are nearly compliant or compliant
- 244.91 miles (35.71%) of sidewalk had cross slopes greater than the maximum of 2.08%
- 347 instances of sidewalk were identified with cracks and concrete deterioration.
- 34,136 instances where vertical change in level was greater than the allowable ¼”
- 251 instances where the vertical clearance was reduced to less than 80” by overhanging vegetation or other objects.
- 303 instances where overgrown vegetation reduced the sidewalk clear width to less than the minimum of 48”.
- 648 instances where utility pole, natural barrier, or other object reduces the sidewalk clear width to less than the minimum of 36” in the case where a 48” sidewalk cannot be achieved due to unreasonable hardship.

11.5 PROW - Curb Ramp Barrier Removal Summary

Based on the onsite review, Bureau Veritas found that barriers to accessibility exist within the City’s curb ramp inventory. The observed elements were analyzed using the Access Board’s proposed Public Rights-of-Way Accessibility Guidelines (PROWAG) and California Building Code (CBC).



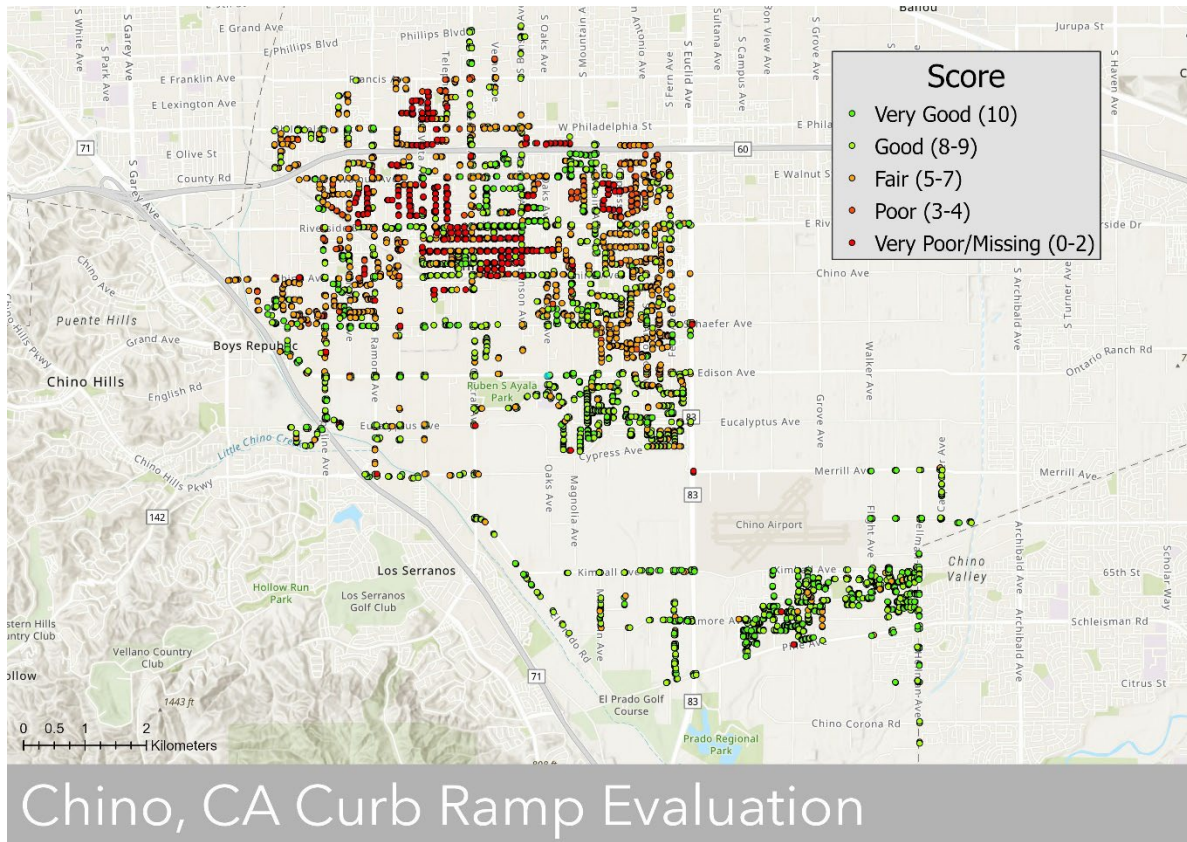

Overall GIS / Map View of Curb Ramp Inventory

The following table summarizes the curb ramp barriers that were identified including remediation method and cost and their priorities base on their curb ramp score.

**CHINO, CALIFORNIA – CURB RAMP ACCESSIBILITY SUMMARY**

Metric	As-Builts	Ramps	As-Builts	Ramps	As-Builts	Ramps	As-Builts	Ramps
Running Slope	> 9%	636	8.6% - 9%	132	8.4% - 8.6%	123	<8.3%	2,890
Cross Slope	> 5.0%	291	3% - 5%	327	2.08% - 3%	566	<2.08%	2,597
Width	< 32"	10	32" – 36"	5	36" - 48"	229	>48"	3,341
Landing Slope	> 5.0%	361	3% - 5%	471	2.08% - 3%	816	<2.08%	2,133

**CHINO, CALIFORNIA – CURB RAMP PHASING BY RAI**

Metric	Phase 1	Ramps	Phase 2	Ramps	Phase 3	Ramps	Lifecycle Replacement	Ramps
Curb Ramp Score	0 - 4	654	5-7	1,218	8-9	1,486	10	902

**CHINO, CALIFORNIA –CURB RAMP REMEDIATION COST BY PHASES**

Metric	Priority	Remediation Method	Cost per Ramp	# of Ramps	Remediation Cost
Curb Ramp Score	Phase 1 (0-4)	Install New/Replacement	\$7,500.00	654	\$4,905,000.00
	Phase 2 (5-7)	Replacement	\$7,500.00	1,218	\$9,135,000.00
	Phase 3 (8-9)	Replacement	\$7,500.00	1,486	\$11,145,000.00
	Lifecycle Replacement(10)*	Replacement	\$0.00	902	\$0.00
	Total Cost				\$25,185,000.00

\*Curb ramps with a score of 10 are compliant or nearly compliant. Replacement costs are not shown, and the ramps are recommended for future lifecycle replacement.

**SUMMARY OF BARRIERS TO ACCESS – CURB RAMPS**

- 4,260 curb ramps were assessed.
- 902 (21.17%) curb ramps were nearly compliant or compliant .
- 891 (20.91%) curb ramps had running slopes greater than the maximum allowed of 8.33%.
- 1,184 (27.79%) curb ramps had cross slopes greater than the maximum allowed of 2.08%.
- 244 (5.73%) curb ramps had clear width less than the minimum of 48”.
- 1,648 (38.69%) curb ramps had top landing slopes exceeding the maximum of 2.08%.
- 1,075 (25.23%) curb ramps were missing detectable warnings.
- 479 instances where curb ramps were not provided where they were required.

**11.6 PROW - Bus Stops Barrier Removal Summary**

Based on the onsite review, Bureau Veritas found that barriers to accessibility exist within the City’s bus stop inventory. The observed elements were analyzed using the Access Board’s proposed Public Rights-of-Way Accessibility Guidelines (PROWAG) and California Building Code (CBC). The following table summarizes the bus stop barriers that were identified including remediation method.



**CHINO, CALIFORNIA – BUS STOP ACCESSIBILITY SUMMARY**

Metric	Phase 1	Bus Stops	Phase 2	Bus Stops	Phase 3	Bus Stops
Boarding/Alighting Depth	<60" or missing	55	48"<84"	26	84"<96"	2
Boarding/Alighting Slope	>5.0%	0	3.0% - 5.0%	2	2.08% - 3.0%	6
Shelter Wheelchair Space Length	> 32"	0	32"<36"	0	36"<48"	5
Shelter Wheelchair Space Slope	> 5.0%	0	3% - 5%	1	2.08% - 3.0%	1

**CHINO, CALIFORNIA – BUS STOP BARRIER REMDIATION COST ESTIMATE**

Metric	Remediation Method	Cost per Bus Stop	# of Bus Stops	Remediation Cost
Bus Stop	Replacement	\$8,000.00	85	\$680,000

**SUMMARY OF BARRIERS TO ACCESS – BUS STOPS**

- 85 bus stops were assessed.
- 0 bus stops were nearly compliant or compliant.
- 76 (89.41%) bus stops have a boarding/alighting space less than 60" wide x 96" deep .
- 7 (8.24%) bus stops do not have a boarding/alighting space.
- 5 (31.25%) bus stops lacked a 30" x 48" adjacent to the bench within the bus shelter. 16 bus shelters were provided.
- 2 (12.5%) bus stops lacked a 30" x 48" space with less than 2.08% cross slope adjacent to the bench within the bus shelter. 16 bus shelters were provided.

**11.7 PROW – Pedestrian Signals Barrier Removal Summary**

Based on the onsite review, Bureau Veritas found that barriers to accessibility exist within the City’s pedestrian signal and accessible pedestrian signals (APS) inventory. The observed elements were analyzed using the Access Board’s revised draft guidelines for Accessible Public Rights-of-Way (PROWAG) and the California Building Code. The following table summarizes the pedestrian signal barriers that were identified including remediation method and cost and their priorities.



**CHINO, CALIFORNIA – PEDESTRIAN SIGNALS ACCESSIBILITY SUMMARY**

Metric	Phase 1	# of APS	Phase 2	# of APS	Phase 3	# of APS
Does the Signal Head Exist?	No	0	-	-	-	-
Does an APS Exist?	No	0	-	-	-	-
Do Signal Heads have a Countdown Timer?	-	-	No	43	-	-
What is the Signal Head Symbol Type?	-	-	None	4	-	-
Does the APS have an Audible Tone?	-	-	-	-	No	41

**CHINO, CALIFORNIA – PEDESTRIAN SIGNALS PRIORITIZATION**

Metric	Priority	Remediation Method	Cost per Pedestrian Signals	# of Signals	Remediation Cost
Pedestrian Signals	Phase 1	Install New	\$2,500.00	0	\$0.00
	Phase 2	Replacement	\$2,500.00	47	\$117,500.00
	Phase 3	Replacement	\$2,500.00	41	\$102,500.00
	Total Cost				\$220,000.00

**SUMMARY OF BARRIERS TO ACCESS – PEDESTRIAN SIGNALS**

- 844 pedestrian signals were assessed.
- 756 (89.57%) pedestrian signals were nearly compliant or compliant.
- 0 (0.0%) signalized intersections were missing pedestrian signal heads indicating “WALK” or “DON’T WALK”.
- 4 (0.47%) of pedestrian heads were either missing or used the incorrect text symbol to indicate “WALK” and “DON’T WALK” .
- 43 (5.09%) pedestrian signals are missing an interval countdown display in order to inform pedestrians of the number of seconds remaining in the pedestrian change interval
- 0 (0.0%) APS were missing at signalized intersections.
- 41 APS (4.85%) were missing an audible walk indication informing pedestrians when to cross.



## 11.8 Schedule and Timeline

The establishment of planned phases for barrier removal is determined by the criteria adopted by the City of Chino, the regulations of the Americans with Disabilities Act, and by the necessity to schedule barrier removals within an established framework. The timing of the completion of each phase of barrier removal is subject to a number of factors. The framework timeline will be determined by the following factors, as well as potential unknown additional factors, which will determine any changes to and specificity of the Transition Plan, which may be required in future years:

- Funding sources and funding timelines
- Level of ADA barrier removal, with the highest ranking given to the highest use areas
- Opportunity to combine ADA barrier removal with scheduled capital improvements, such as playground replacements, parking lot renovations, restroom repairs or park reconstruction
- Development of a work program to eliminate “low hanging fruit” (easily removed barriers)
- Realistic time frame for accomplishment based on fiscal capability
- Demographic distributions
- Input from the community
- Public citizen grievances/complaints

Planning level estimated values for barrier removal will change over time due to inflation, changes in construction practices and materials, and unanticipated changes or additions to accessibility regulations. It is expected that the total cost of required accessibility barrier removal will change over time due to the completion of individual barrier removal efforts and due to funding of capital projects which incorporate barrier removal in the immediate and distant future.

## 12. APPENDICES

---

APPENDIX A: ADA TITLE II REQUIREMENTS

APPENDIX B: CITY OF CHINO ADA PUBLIC NOTICE

APPENDIX C: CITY OF CHINO PUBLIC GRIEVANCE PROCEDURE

APPENDIX D: ACCESSIBILITY OF STATE AND LOCAL GOVERNMENTS  
WEBSITES TO PEOPLE WITH DISABILITIES

APPENDIX E: CITY OF CHINO WEBSITE ACCESSIBILITY INSPECTION

APPENDIX F: PUBLIC RIGHT-OF-WAY SIDEWALK AND CURB RAMP  
EVALUATION MAPS

APPENDIX G: CITY OF CHINO ACCESSIBILITY SURVEY

APPENDIX H: CITY OF CHINO PROGRAMS AND SERVICES

APPENDIX I: ACCESSIBILITY SUMMARIES BY FACILITY

APPENDIX J: BARRIERS BY TRANSITION PHASE

---

---

## APPENDIX A: ADA TITLE II REQUIREMENTS

---

---

## The Americans with Disabilities Act

With the passage of the Americans with Disabilities Act (ADA) in 1990, people with disabilities were, for the first time, assured of access to all programs and services provided by state and local government agencies. Previously, under Section 504 of the Rehabilitation Act of 1973, as amended, only those public entities that receive federal funding were explicitly prohibited from discriminating on the basis of disability. Signed into law by President George H.W. on July 26, 1990, Title I, II, and III of the ADA became effective on January 26, 1992. Title IV took effect in 1993.

The Americans with Disabilities Act is divided into five areas, Titles I through V.

Title I - Employment: Title I of the Americans with Disabilities Act prohibits all employers, including government agencies, from discriminatory practices in the hiring, training, advancement, compensation, or discharge of any employee, or in any terms, conditions, and rights of employment.

Title II - Public Services: Title II of the American Disabilities Act, which governs state and local government entities, prohibits all public entities, even those completely independent from federal funding, from discriminating against people with disabilities. Generally, Title II of the ADA prohibits discrimination to services, programs, and activities of public entities on the basis of disability.

Title II I- Public Accommodations and Services by Private Entities: Title III requires places of public accommodation (privately funded and operated facilities) and commercial facilities that serve the public to be accessible to and usable by people with disabilities.

Title IV - Telecommunications: Title IV covers private telecommunication carriers offering services to the public to increase the availability of interstate and intrastate telecommunication relay services to individuals with hearing and speech disabilities.

Title V - Miscellaneous Provisions: Title V contains miscellaneous provisions, including construction standards and practices, provisions for attorneys' fees, and technical assistance provisions.

Terms such as "Public Entity" and "Governmental Agency" are applicable to Title II entities, which are defined as state and local governments.

The Department of Justice (DOJ) is tasked with the enforcement of the ADA.

## Scope of Title II

Title II of the ADA is divided into two subtitles. This discussion focuses only on subtitle A, which is implemented by the DOJ's Title II regulation at 28 CFR § Part 35. Subtitle B of Title II of the ADA covers public transportation services, programs, and activities of public entities are subject to the regulation of the Department of Transportation (DOT) at 49 CFR Part 37 and are not covered by this part. The DOT's ADA regulation establishes requirements for construction of transportation facilities and acquisition of vehicles. Matters not covered by subtitle B, such as the provision of auxiliary aids, are covered by subtitle A. Activities that are covered by the DOT's regulation implementing subtitle B are not required to be included in the self-evaluation required by §35.105. The use of the term "Title II" anywhere in the Self-Evaluation and Transition Plan report refers only to Subtitle A.

## 28 CFR §35.102 Application

(a) Except as provided in paragraph (b) of this section, this part applies to all services, programs, and activities provided or made available by public entities.

(b) To the extent that public transportation services, programs, and activities of public entities are covered by Subtitle B of Title II (42 U.S.C.12141) of the ADA, they are not subject to the requirements of this part.

The obligation to comply with Title II extends to all public entities, including:

- Any state or local government
- Any department, agency, special purpose district, or other instrumentality of a state or local government

All local agencies, including municipalities, are required to comply with Title II because they are considered “instrumentalities” of the state government. All programs, activities, and services of local government, including municipalities, must be in compliance with Title II. Examples of activities covered include:

- The operation of all services and programs offered by the entity;
- All aspects of the employment relationship; and
- Services carried out by contractors.

Title II covers any and all events the local government system offers, for example, any public meetings, entertainment or lecture series, all events offered by the school system including after-school activities and social events, festivals or other special events, and all services provided for the public or staff. Services provided by any private contractors on behalf of the municipal system must also comply fully with relevant provisions of Title II.

Under Title II, a public entity (i.e. governmental agency) shall operate each service, program, or activity so that the service, program, or activity, when viewed in its entirety, is readily accessible to and usable by individuals with disabilities. The local government may not deny the benefits of its programs, activities, and services to individuals with disabilities because its facilities are inaccessible.

Public meeting rooms must be accessible to people with disabilities. Buildings where public meetings, services, programs, or activities take place must provide access to telephones and restrooms, if provided, for people with disabilities as well as the general public. When a program, service or activity is scheduled in an inaccessible location and a person with a disability notifies the agency of their desire or need to participate, that program, service, or activity must be moved to an accessible location.

The government must maintain equipment and features of facilities in working order if those features and equipment are required to provide ready access to individuals with disabilities. Isolated or temporary interruptions in access due to maintenance and repair of accessible features are not prohibited. For example, where the governmental agency must provide an accessible route, the route must remain accessible and not blocked by obstacles such as furniture, filing cabinets, or potted plants. An isolated instance of placement of an object on an accessible route, however, would not be a violation if the object is promptly removed. Similarly, accessible doors must be unlocked when the governmental agency’s offices are open for business.

Mechanical failures in equipment such as elevators or automatic doors will occur from time to time. The obligation to ensure that facilities are readily accessible to and usable by individuals with disabilities would be violated if repairs are not made promptly or if improper or inadequate maintenance causes repeated failures.

However, this does not --



- (1) Necessarily require a public entity to make each of its existing facilities accessible to and usable by individuals with disabilities;
- (2) Require a public entity to take any action that would threaten or destroy the historic significance of an historic property; or
- (3) Require a public entity to take any action that it can demonstrate would result in a fundamental alteration in the nature of a service, program, or activity or in undue financial and administrative burdens. In those circumstances where personnel of the public entity believe that the proposed action would fundamentally alter the service, program, or activity or would result in undue financial and administrative burdens, a public entity has the burden of proving that compliance with 35.150(a) of this part would result in such alteration or burdens. The decision that compliance would result in such alteration or burdens must be made by the head of a public entity or his or her designee after considering all resources available for use in the funding and operation of the service, program, or activity, and must be accompanied by a written statement of the reasons for reaching that conclusion. If an action would result in such an alteration or such burdens, a public entity shall take any other action that would not result in such an alteration or such burdens but would nevertheless ensure that individuals with disabilities receive the benefits or services provided by the public entity.

In summary, Title II requires state, county, and city governments to ensure that all of their programs, services, and activities, when viewed in their entirety, are accessible to people with disabilities. Program access is intended to remove physical barriers to state, county, and city services, programs, and activities, but it generally does not require that a government agency make each facility, or each part of a facility, accessible. For example, all restrooms in a facility may not be accessible. However, signage directing people with disabilities to the accessible features and spaces in a facility, including at least one accessible restroom, should be provided.

Program accessibility may be achieved in a variety of ways. State, county, and city governments may choose to make structural changes to existing facilities to achieve access or can pursue alternatives to structural changes to achieve program accessibility. For example, governments can move public meetings to accessible buildings, or can relocate services for individuals with disabilities to accessible levels or sections of buildings. When choosing between possible methods of program accessibility, governments must give priority to the choices that offer services, programs, and activities in the most integrated setting appropriate. [28 C.F.R. § 35.149, 35.150, 35.151, 35.163]

**Definition of Disability**

The ADA stipulates a three-pronged definition of disability. Disability is defined as an individual who:

- Has a physical or mental impairment that substantially limits one or more major life activities; or
- Has a record or history of such an impairment; or
- Is perceived or regarded as having such an impairment;
- Major life activities encompass activities such as caring for oneself, performing manual tasks, walking, seeing, hearing, speaking, breathing, learning, and working. [28 CFR § 35.104]

**Human Resources**

The ADA requires equal opportunity for individuals with disabilities in all areas of employment practices, including the application process, interviewing, testing, hiring, job assignment, evaluation, discipline, medical examinations, compensation, promotion, on-the-job training, layoff/recall, termination, leave and benefits such as health insurance. The non-discrimination requirement applies to the hiring process, as well as employees.



The ADA requires that all employees be provided equal access to benefits, such as health insurance, regardless of disability. However, the regulations also indicate that certain restrictions, such as pre-existing condition waiting periods or caps on particular types of services, such as out-patient physical therapy, are permissible unless proven to be a subterfuge for discrimination.

The ADA requirements for the hiring protocol and all areas of responsibility of the human resources department extend to seasonal workers, workers covered by collective bargaining agreements and works who may be hired through outside agencies. Volunteers, interns, or student teachers who may be placed at an agency program or recruiters are not necessarily defined as government employees.

An important factor in the Self-Evaluation process is the identification of unionized employees and the terms of union agreements. For example, the terms of a collective bargaining agreement may include job restructuring or reassignment requests, which may affect seniority provisions. If the granting of requests would create an undue hardship, the Equal Employment Opportunity Commission (EEOC) has the authority to determine on a case-by-case basis whether the claim of undue hardship is valid.

Employment regulations treat alcohol and drug use differently. Alcoholism is recognized as a disability under the ADA; however, employers do not have to tolerate poor work performance due to alcoholism. If a person with alcoholism is provided only one paid leave for treatment of the alcoholism, while persons with different diseases are provided multiple paid leave, then such a provision is a violation of the ADA.

The ADA does not protect an individual currently engaging in the illegal use of drugs. However, a person with a history of drug addiction who (1) has been successfully rehabilitated or is participating in a drug rehabilitation program and (2) is not engaging in the illegal use of drugs is protected if the person is a qualified individual with a disability. An individual who is erroneously regarded as being a drug addict is also protected. [28 CFR § 35.104, 131]

## Communications

People who have disabilities that affect hearing, seeing, speaking, reading, writing, or understanding may use different ways to communicate than people who do not. Governmental agencies are required to take steps to ensure that the agency's communications with people with disabilities are as effective as communications with others. [28 CFR § 35.160(a)(1)]

This effective communication requirement applies to all members of the public with disabilities, including job applicants, program participants, and even people who simply contact state or local government agencies seeking information about programs, services, events, or activities. The requirement applies to all agencies and to all modes of communication including written, spoken, telecommunications, television, and video. Specifically, where the governmental agency communicates by telephone with applicants and any other person, text phones (TTY's) or equally effective telecommunications systems are required to be used for individuals who are deaf, hard of hearing, or have speech impairments. [28 CFR § 35.161]

When the government uses an automated-attendant system, including, but not limited to, voice mail and messaging, or an interactive voice response system, for receiving and directing incoming telephone calls, that system must provide for real-time communication with individuals using auxiliary aids and services, including TTY's and all forms of FCC-approved telecommunications relay system, including Internet-based relay systems. [28 CFR § 35.161]

Under 28 CFR § 35.161, the ADA requires that all Public Safety Answering Points (PSAPs) provide direct and equal access to their services for people with disabilities who use text phones (TTYs). All basic emergency services are included in this requirement. Both primary and secondary PSAPs have the same responsibilities under the ADA. To be in compliance, every call-taking position within the PSAP must have its own TTY or TTY-compatible equipment.

Additionally, telephone emergency services, including 911 services, shall provide direct access to individuals who use telecommunication devices for the deaf (TDD's) or computer modems. [28 CFR § 35.162]

The governmental agency must provide equal access to the programs, services, and activities available on the agency's website(s). This can include making websites accessible to people with disabilities or providing an alternative format for people to access the information, programs, and services available through the web. In order to aid development of a government website which is accessible, the web administrator can consult the Web Content Accessibility Guidelines, developed by the Web Content Accessibility Working Group, which is part of the World Wide Web Consortium Web Accessibility Initiative, and available at <http://www.w3.org/TR/WCAG20>.

When an auxiliary aid or service is requested, the Department must provide an opportunity for the requester to specify aids or services of their choice, and that choice must be given primary consideration. There are many types of auxiliary aids and services that may be used to provide effective communication for people with disabilities, but not all ways work for all people or even for people with the same type of disability. The law does not require the agency to provide every one of these aids and services, but it does require that each person who interacts with the agency receives effective communication. [28 CFR § 35.160]

**Requirements for an ADA Coordinator**

A Title II entity with more than 50 employees must designate an ADA Coordinator who coordinates agency efforts to comply with and carry out the responsibilities of the ADA. The Coordinator provides a single point of contact for members of the public about ADA and the agency. In order to ensure that individuals can easily identify the ADA Coordinator, the governmental agency must provide the ADA Coordinator's name, office address, and telephone number to all interested individuals [28 CFR § 35.107].

The ADA Coordinator facilitates compliance with the ADA and provides expertise regarding the Americans with Disabilities Act and ADA Standards. The ADA coordinator receives and investigates complaints related to discrimination on the basis of disability.

Under 28 CFR § 35.107, a grievance procedure is required for public entities of 50 or more employees. Title II entities are required to adopt and publish grievance procedures providing for prompt and equitable resolution of complaints alleging any action that would be prohibited by 28 CFR § 35.

**New Construction and Alterations**

A public Title II entity may not deny the benefits of its programs, activities, and services to persons with disabilities because its existing facilities are inaccessible. Thus, it is the general availability of a program to persons with disabilities that must be evaluated, not compliance with facility standards developed for new construction and alterations.



While state and local governments may wish to measure the accessibility of their existing buildings against the scoping and technical provisions in the 2010 Standards, program accessibility may be achieved without making every existing facility - or every part of an existing building - accessible. Alternatives to building retrofit can include the temporary relocation of an activity to an accessible facility or the delivery of the service or benefit by other means. In many cases, however, permanent construction that provides physical access may be the most efficient and economical approach to program access, particularly when life cycle costs are considered.

Although physical changes are required only when there is no other feasible way to make a program accessible, public entities are nevertheless required to give priority to methods that result in the most integrated setting appropriate. The program access obligation is limited: Title II entities do not have to take actions that they can demonstrate would result in a fundamental alteration in the nature of a program or that would impose undue financial or administrative burdens.

In compliance with 28 CFR §35.151 (c), if new construction and alterations to a facility were begun prior to September 15, 2010, then the facility or portion of the facility that is affected by the alteration shall comply with the 1991 standards. If new construction and alterations to a facility were begun on or after September 15, 2010, and before March 15, 2012, then either the 1991 standards or the 2010 ADA Standards for Accessible Design are applicable. For all new construction or alterations begun on or after March 15, 2012, the 2010 ADA Standards for Accessible Design are applicable. New construction and alterations must fully comply with all applicable 2010 ADA Standards for Accessible Design if begun on or after March 15, 2012.

The DOJ definition of the commencement of construction is the establishment of a physical object, such as a foundation wall, rather than the groundbreaking first shovel and initial grading of the site.

Existing facilities (including all buildings, exterior facilities, and the on-site access to them) constructed prior to January 26, 1992, and not altered in any way since that date, are held to the lesser standard of complying, with the extent allowed by structural feasibility and the financial resources available, or when a reasonable accommodation can be made.

An alteration that affects or could affect the usability of or access to an area of a facility that contains a primary function shall be made so as to ensure that, to the maximum extent feasible, the path of travel to the altered area and the restrooms, telephones, and drinking fountains serving the altered area are readily accessible to and usable by individuals with disabilities, including individuals who use wheelchairs, unless the cost and scope of such alterations is disproportionate to the cost of the overall alteration. [28 C.F.R. § 35.151(b)(4)]

If the cost of providing a path of travel to an altered facility is more than 20% of the cost of the alteration to the primary function area, then the cost is disproportionate to the overall area and therefore not required. Costs that may be considered as part of the cost of providing an accessible path of travel may include: (1) the costs associated with providing an accessible entrance and an accessible route to the altered area, for example, the cost of widening doorways or installing ramps; (2) costs associated with making restrooms accessible, such as installing grab bars, enlarging toilet stalls, insulating pipes, or installing accessible faucet controls, if the restroom is not the primary function of the area (e.g. the restroom is not in a highway rest area); (3) costs associated with providing accessible telephones, such as relocating the telephone to an accessible height, installing amplification devices, or installing a text telephone (TTY); and (4) costs associated with relocating an inaccessible drinking fountain. [28 C.F.R. § 35.151(b)(4)(iii)]

When the cost of alterations necessary to make the path of travel to the altered area fully accessible is disproportionate to the cost of the overall alteration, the path shall be made accessible to the extent that it can without incurring disproportionate costs. In choosing which accessible elements to provide, priority should be given to those elements that will provide the greatest access, in the following order: (1) an accessible entrance; (2) an accessible route to the altered area; (3) at least one accessible restroom for each sex or a single unisex restroom; (4) accessible telephones; (5) accessible drinking fountains; and (6) when possible, additional accessible elements such as parking storage and alarms. [28 CFR § 35.151(b)(4)(iv)] A series of smaller alterations cannot be used to evade the requirement if the alterations are served by a single path of travel. [28 C.F.R. § 35.151(b)(4)(v)]

## Safe Harbor

The 2010 ADA Standards for Accessible Design use the terms incremental change and supplemental change. Incremental changes are those elements which were requirements under the 1991 standards, but which were changed in some way under the 2010 standards. Supplemental changes are those regulations or regulatory areas which were not included in the 1991 standards but are included in the 2010 standards.

“Safe harbor” is the term used in the 2010 ADA Standards to describe situations where the 2010 incremental changes to the ADA regulations are not required if alterations to the building or facility are not made. Specifically, “safe harbor” applies to a path of travel. “A ‘path of travel’ includes a continuous, unobstructed way of pedestrian passage by means of which the altered area may be approached, entered, and exited, and which connects the altered area with an exterior approach (including sidewalks, streets, and parking areas), an entrance to the facility and other parts of the facility. “[28 CFR § 35.151(b)(4)(ii)] “An accessible path of travel may consist of walks and sidewalks, curb ramps and other interior or exterior pedestrian ramps; clear floor paths through lobbies, corridors, rooms, and other improved areas; parking access aisles; elevators and lifts; or a combination of these elements. For the purposes of the section the term ‘path of travel’ also includes the restrooms, telephones and drinking fountains serving the altered area.” [28 C.F.R. § 35.151(b)(4)(ii)(B)]

Safe harbor applies only if a building or facility built after July 26, 1992, was compliant with the 1991 standards prior to the enforceable date of the 2010 regulations, which is March 15, 2012. “Safe harbor” is granted to facilities or buildings if and only if the facilities are fully in compliance with the 1991 standards prior to March 15, 2012. However, if alterations are made after March 15, 2012, the alteration of the building or facility must fully comply with the 2010 standards, and any other portions of the existing building or facility that are substantially affected by the alteration in terms of their use, must also comply with the 2010 standards. “Safe harbor” does not apply to areas of supplemental change. (i.e., elements for which there are neither technical nor scoping specifications in the 1991 Standards) For instance, the 2010 standards include regulations for residential facilities dwelling units, amusement rides, recreational boating facilities, exercise equipment or exercise areas, fishing piers and platforms, golf facilities, miniature golf facilities, play areas, saunas and steam rooms, swimming pools, wading pools, spas, shooting facilities with firing positions, bowling, and court sports. These elements are not governed by “safe harbor.” [28 C.F.R. § 35.151(b)(4)(ii)(c)]

For example, one of the regulated areas where “safe harbor” makes an impact is in a single occupant restroom. The 2010 ADA Standards for Accessible Design require a clear floor space next to the water closet, while the 1991 ADAAG allows the lavatory to overlap the clear space. The intent of the new provisions is to allow space for a side transfer to the water closet. The 2010 ADA Standards allow the door to swing into the bathroom as long as there is a clear floor space past the swing of the door, so that a person can enter the room, shut the door, and then maneuver. The 1991 ADAAG does not allow the door swing and the clear floor space to overlap for any of the fixtures. While the 2010 standards do not allow clear space overlap in multi-stall bathrooms, overlap is allowed in single occupant bathrooms.

## Undue Burden

A public entity must operate each service, program, or activity so that when viewed in its entirety, the service, program, or activity is readily accessible to and usable by individuals with disabilities. This does not necessarily require the public entity to make each of its facilities accessible to and usable by individuals with disabilities. Additionally, a public entity is not required to take any action that would threaten or destroy the historical significance of an historic property.

If the state or local government agency can demonstrate that an action would result in a fundamental alteration in the nature of a service, program, or activity or in undue financial and administrative burdens, then the decision must be made in a written statement describing the reason for the conclusion, and the decision must be made by the head of the government agency, or his or her designee after considering all resources available for use in the funding and operation of the service, program, or activity. The public entity has the burden of proof that compliance with 28 CFR § 35.151 would result in such alterations or burdens.

If an action would result in a fundamental alteration of the service, program, or activity or in undue financial and administrative burdens, the Title II entity shall take any other action to ensure that individuals with disabilities receive the benefits or services provided by the state or local government agency.

## Self-Evaluation Requirements

A Self-Evaluation is a Title II entity’s evaluation of its current services, policies, and practices to ensure that people with disabilities have equal access to all benefits provided by the public entity. A government entity is required to conduct a Self-Evaluation within one year of the effective date of 28 CFR § 35.105, the effective date being January 26, 1992. All governments were required to complete a Self-Evaluation of their services, policies, and practices by January 26, 1993. The evaluation required by January 26, 1993, shall apply only to programs not subject to section 504 or those policies and practices, such as those involving communications access, that have not already been included in a self-evaluation required under an existing regulation implementing section 504. Because most evaluations were done more than 5 years ago, the DOJ expects many public entities will be reexamining all of their policies and programs.

The Self-Evaluation identifies and corrects those policies and practices that are inconsistent with Title II's requirements. Self-Evaluations should consider all of a local government's programs, activities, and services, as well as the policies and practices that a governmental agency has put in place to implement its various programs and services. Remedial measures necessary to bring the programs, policies, and services into compliance with Title II should be specified -- including, but not limited to: (1) relocation of programs to accessible facilities; (2) offering programs in an alternative accessible manner; (3) structural changes to provide program access; (4) policy modifications to ensure nondiscrimination; and (5) auxiliary aids needed to provide effective communication. [28 CFR §§ 35.105, 35.150(d)] The Self-Evaluation process identifies those policies and practices that are inconsistent with the requirements of Title II of the ADA. As part of the Self-Evaluation, the governmental agency is required to:

- A. Identify all of its programs, activities, and services.
- B. Review all the policies and practices that govern the administration of the governmental agency's programs, activities, and services.
- C. Examine each program to determine whether any physical barriers to access exist, including whether individuals with mobility impairments are provided access to public meetings.
- D. Review its policies and practices to determine whether any have the effect of excluding or limiting the participation of individuals with disabilities in the governmental agency's programs, activities, or services. The Self-Evaluation should provide justification for any agency policy that creates a barrier for people with disabilities that will not be modified.
- E. Review its policies to assess whether communications with persons with disabilities are as effective as its communication with others.
- F. Review its policies for responding to requests for accommodations to ensure such requests are responded to expeditiously.
- G. Review its employment practices to assess whether they comply with other applicable nondiscrimination requirements, including Section 504 of the Rehabilitation Act and the ADA regulations issued by the Department of Justice.
- H. Review its building and construction policies to assess whether construction of each new facility or part of a facility, or alteration of existing facilities, conforms to the standards designated under the Title II regulations.
- I. Provide the opportunity to interested persons, including individuals with disabilities or organizations representing individuals with disabilities, to participate in the Self-Evaluation process by submitting comments.

In addition, a public entity that employs 50 or more persons shall for at least three years following completion of the Self-Evaluation maintain on file and make available for public inspection: (1) a list of the interested persons consulted; (2) a description of areas examined, and any problems identified, and (3) a description of any modification made.

### Transition Plan Requirements

If a state or local government that employs 50 or more persons decides to make structural changes to achieve program access, it must develop a transition plan that identifies those changes and sets a schedule for implementing barrier removal. Transition plans must be available to the public for inspection and allow an opportunity to interested persons, including individuals with disabilities or organizations representing individuals with disabilities, to participate in the development of the transition plan by submitting comments.



If a public entity has responsibility or authority over streets, roads, or walkways, its transition plan shall include a schedule for providing curb ramps or other sloped areas where pedestrian walks cross curbs, giving priority to walkways serving entities covered by the Act, including State and local government offices and facilities, transportation, places of public accommodation, and employers, followed by walkways serving other areas.

The plan shall, at a minimum:

- Identify physical obstacles in the public entity's facilities that limit the accessibility of its programs or activities to individuals with disabilities
- Describe in detail the methods that will be used to make the facilities accessible
- Specify the schedule for taking the steps necessary to achieve compliance with this section and, if the time period of the transition plan is longer than one year, identify steps that will be taken during each year of the transition period
- Indicate the official responsible for implementation of the plan.

If a public entity has already complied with the transition plan requirement of a Federal agency regulation implementing section 504 of the Rehabilitation Act of 1973, then the requirements of this paragraph (d) shall apply only to those policies and practices that were not included in the previous transition plan. [28 CFR §35.150(d)]

---

---

**APPENDIX B:  
CITY OF CHINO ADA PUBLIC NOTICE**

---

---



# City of Chino ADA Public Notice



In accordance with the requirements of Title II of the Americans with Disabilities Act of 1990 ("ADA"), the City of Chino will not discriminate against qualified individuals with disabilities on the basis of disability in its services, programs, or activities.

**Employment:** The City of Chino does not discriminate on the basis of disability in its hiring or employment practices and complies with all regulations promulgated by the U.S. Equal Employment Opportunity Commission under Title I of the ADA.

**Effective Communication:** The City of Chino will generally, upon request, provide appropriate aids and services leading to effective communication for qualified persons with disabilities so they can participate equally in our programs, services, and activities, including qualified sign language interpreters, documents in Braille, and other ways of making information and communications accessible to people who have speech, hearing, or vision disabilities.

**Modifications to Policies and Procedures:** The City of Chino will make all reasonable modifications to policies and programs to ensure that people with disabilities have an equal opportunity to enjoy all of our programs, services, and activities. For example, individuals with service animals are welcomed in Chino's offices and facilities, even where pets are generally prohibited.

Anyone who requires an auxiliary aid or service for effective communication, or a modification of policies or procedures to participate in programs, services, or activities of the City, should contact the City's ADA Coordinator as soon as possible but no later than 48 hours before the scheduled event.

The ADA does not require the City of Chino to take any action that would fundamentally alter the nature of its programs or services or impose an undue financial or administrative burden.

**Complaints that a program, service, or activity of the City is not accessible to persons with disabilities should be directed to the City's ADA Coordinator:**

**Lisa Almilli, ADA Coordinator**  
**13220 Central Avenue, Chino, CA 91710**  
**909-334-3524 or [lalmilli@cityofchino.org](mailto:lalmilli@cityofchino.org)**

The City of Chino will not place a surcharge on a particular individual with a disability or any group of individuals with disabilities to cover the cost of providing auxiliary aids/services or reasonable modifications of policy, such as retrieving items from locations that are open to the public but are not accessible to persons who use wheelchairs.

---

**APPENDIX C:  
CITY OF CHINO PUBLIC GRIEVANCE  
PROCEDURE**

---



# City of Chino

## ADA Grievance Procedure



This Grievance Procedure is established to meet the requirements of the Americans with Disabilities Act of 1990 (ADA). It may be used by anyone who wishes to file a complaint alleging discrimination on the basis of disability in the provision of services, activities, programs, or benefits by the City of Chino. The City's Personnel Policy governs employment-related complaints of disability discrimination.

The complaint should be in writing and contain information about the alleged discrimination such as name, address, phone number of complainant and location, date, and description of the problem. Alternative means of filing complaints, such as personal interviews or a tape recording of the complaint, will be made available for persons with disabilities upon request.

The complaint should be submitted by the grievant and/or his/her designee as soon as possible but no later than 60 calendar days after the alleged violation to the City's ADA Coordinator:

**Lisa Almilli, ADA Coordinator**  
**13220 Central Avenue, Chino, CA 91710**  
**909-334-3524 or [lalmilli@cityofchino.org](mailto:lalmilli@cityofchino.org)**

Within 15 calendar days after receipt of the complaint, the ADA Coordinator or his/her designee will meet with the complainant either by phone, virtual meeting, or in person, to discuss the complaint and the possible resolutions. Within 30 calendar days of the meeting, the ADA Coordinator or his/her designee will respond in writing, and where appropriate, in a format accessible to the complainant, such as large print, Braille, or audio tape. The response will explain the position of the City of Chino and offer options for substantive resolution of the complaint.

If the response by the ADA Coordinator or his/her designee does not satisfactorily resolve the issue, the complainant and/or his/her designee may appeal the decision within 10 calendar days after receipt of the response to the City Manager or his designee.

Within 15 calendar days after receipt of the appeal, the City Manager or his designee will meet with the complainant to discuss the complaint and possible resolutions. Within 30 calendar days after the meeting, the City Manager or his designee will respond in writing, and, where appropriate, in a format accessible to the complainant, with a final resolution of the complaint.

All written complaints received by the ADA Coordinator or his/her designee, appeals to the City Manager or his designee, and responses from these two offices will be retained by the City of Chino for at least three years.

---

**APPENDIX D:  
ACCESSIBILITY OF STATE AND LOCAL  
GOVERNMENTS WEBSITES TO PEOPLE WITH  
DISABILITIES**

---



## Accessibility of State and Local Government Websites to People with Disabilities

The Internet is dramatically changing the way that American government serves the public. Taking advantage of new technology, many State and local governments are using the web to offer citizens a host of services including:


- corresponding online with local officials;
- providing information about government services;
- renewing library books or driver's licenses;
- providing tax information and accepting tax returns; and
- applying for jobs or benefits.

These government websites are important because they:

- allow programs and services to be offered in a more dynamic, interactive way, increasing citizen participation;
- increase convenience and speed in obtaining information or services;
- reduce costs in providing programs and information about government services;
- reduce the amount of paperwork; and
- expand the possibilities of reaching new sectors of the community or offering new programs.

When government is constantly being asked to do more with less, the Internet is playing a vital role in allowing government to better serve all of its citizens.

The Americans with Disabilities Act (ADA) and, if the government entities receive Federal funding, the Rehabilitation Act of 1973, generally require that State and local governments provide qualified individuals with disabilities equal access to their programs, services, or activities, unless doing so would fundamentally alter the nature of their programs, services, or activities or would impose an undue burden. One way to help meet these requirements is to ensure that government websites have accessible features for people with disabilities, using the simple steps described in this document. An agency with an inaccessible website may also meet its legal obligations by providing an alternative accessible way for citizens to use the programs or services, such as a staffed telephone information line. These

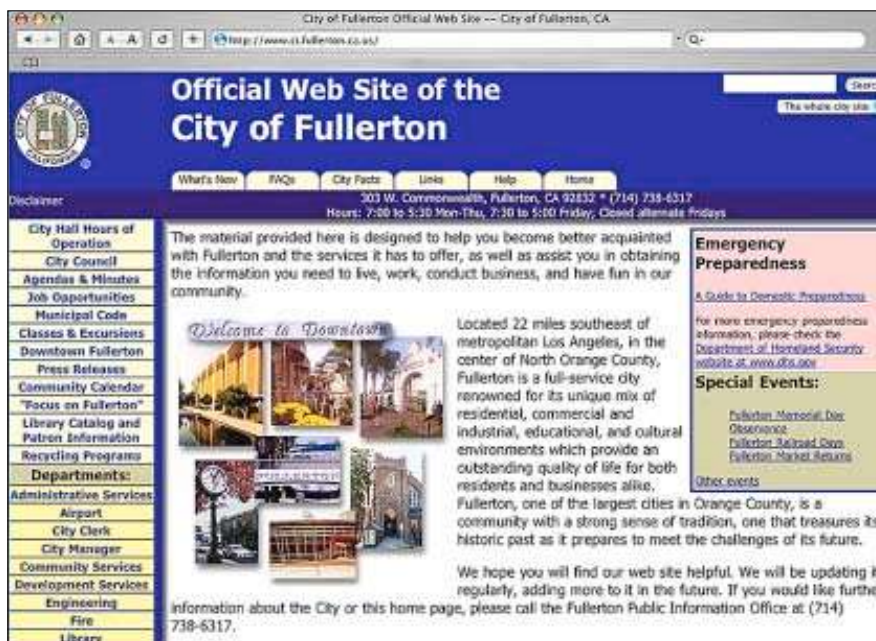

alternatives, however, are unlikely to provide an equal degree of access in terms of hours of operation and the range of options and programs available. For example, job announcements and application forms, if posted on an accessible website, would be available to people with disabilities 24 hours a day, 7 days a week.

## Online Barriers Faced By People with Disabilities

Many people with disabilities use “assistive technology” to enable them to use computers and access the Internet. Blind people who cannot see computer monitors may use screen readers – devices that speak the text that would normally appear on a monitor. People who have difficulty using a computer mouse can use voice recognition software to control their computers with verbal commands. People with other types of disabilities may use still other kinds of assistive technology. New and innovative assistive technologies are being introduced every day.

Poorly designed websites can create unnecessary barriers for people with disabilities, just as poorly designed buildings prevent some from entering. Designers may not realize how simple features built into a web page will assist someone who, for instance, cannot see a computer monitor or use a mouse.

One example of a barrier would be a photograph of a Mayor on a town website with no text identifying it. Because screen readers cannot interpret images unless there is text associated with it, a blind person would have no way of knowing whether the image is an unidentified photo or logo, artwork, a link to another page, or something else. Simply adding a line of simple hidden computer code to label the photograph “Photograph of Mayor Jane Smith” will allow the blind user to make sense of the image.

## Accessible Design Benefits Everyone

When accessible features are built into web pages, websites are more convenient and more available to everyone – including users with disabilities. Web designers can follow techniques developed by private and government organizations to make even complex web pages usable by everyone including people with disabilities. For most websites, implementing accessibility features is not difficult and will seldom change the layout or appearance of web pages. These techniques also make web pages more usable both by people using older computers and by people using the latest technologies (such as personal digital assistants, handheld computers, or web-enabled cellular phones).

With the rapid changes in the Internet and in assistive technologies used by people with disabilities to access computers, private and government organizations have worked to establish flexible guidelines for accessible web pages that permit innovation to continue.

## Resources for Web Developers

To make web pages accessible, the web developer needs to know about web page features that can make a web page less accessible or more accessible. Information about such features is easily available and many software developers are adding tools to web development software to make it easier to make web pages accessible.

Two important resources provide guidance for web developers designing accessible web pages. One is the **Section 508 Standards**, which Federal agencies must follow for their own new web pages. To learn more about the Section 508 Standards:

- The Access Board maintains information on its website at [www.access-board.gov](http://www.access-board.gov) and has a useful guide for web developers at [www.access-board.gov/sec508/guide/1194.22.htm](http://www.access-board.gov/sec508/guide/1194.22.htm);

- The Department of Justice has information about accessible web page design in an April 2000 report to the President. This report is available at [www.usdoj.gov/crt/508/report/content.htm](http://www.usdoj.gov/crt/508/report/content.htm), and
- The General Services Administration hosts an online course for web developers interested in accessible web design. This program was developed in conjunction with

the Access Board, the Department of Justice, and the Department of Education and provides an interactive demonstration of how to build accessible web pages. This course is available at [www.section508.gov](http://www.section508.gov), which also provides information about the Federal government's initiative to make its electronic and information technology accessible to people with disabilities.

## Voluntary Action Plan for Accessible Websites

- **Establish a policy that your web pages will be accessible** and create a process for implementation.
- **Ensure that all new and modified web pages and content are accessible:**
  - Check the HTML<sup>1</sup> of all new web pages. Make sure that accessible elements are used, including alt tags, long descriptions, and captions, as needed.
  - If images are used, including photos, graphics, scanned images, or image maps, make sure to include alt tags and/or long descriptions for each.
  - If you use online forms and tables, make those elements accessible.
  - When posting documents on the website, always provide them in HTML or a text-based format (even if you are also providing them in another format, such as Portable Document Format (PDF)).
- **Develop a plan for making your existing web content more accessible.** Describe your plan on an accessible web page. Encourage input on improvements, including which pages should be given high priority for change. Let citizens know about the standards or guidelines that are being used. Consider making the more popular web pages a priority.
- **Ensure that in-house staff and contractors responsible for web page and content development are properly trained.**
- **Provide a way for visitors to request accessible information or services by posting a telephone number or E-mail address on your home page.** Establish procedures to assure a quick response to users with disabilities who are trying to obtain information or services in this way.
- **Periodically enlist disability groups to test your pages for ease of use;** use this information to increase accessibility.

<sup>1</sup> Web pages are written using a language called HTML (or "hypertext markup language"). HTML is a "markup language" that tells a computer program (called a "browser") how information will appear or will be arranged on a computer screen. HTML tags are specific instructions understood by a web browser or screen reader.


# Examples of Accessible Features for Websites

All images and graphics need to have an alt tag or long description.

Use alt tags for image maps and for graphics associated with the image map so that a person using a screen reader will have access to the links and information.

When navigation links are used, people who use a screen reader must listen to all the links before proceeding. A skip navigation link provides a way to bypass the row of navigation links by jumping to the start of the web page content.

Some photos and images contain content that cannot be described with the limited text of an alt tag. Using a long description tag provides a way to have as much text as necessary to explain the image so it is accessible to a person using a screen reader but not visible on the web page.

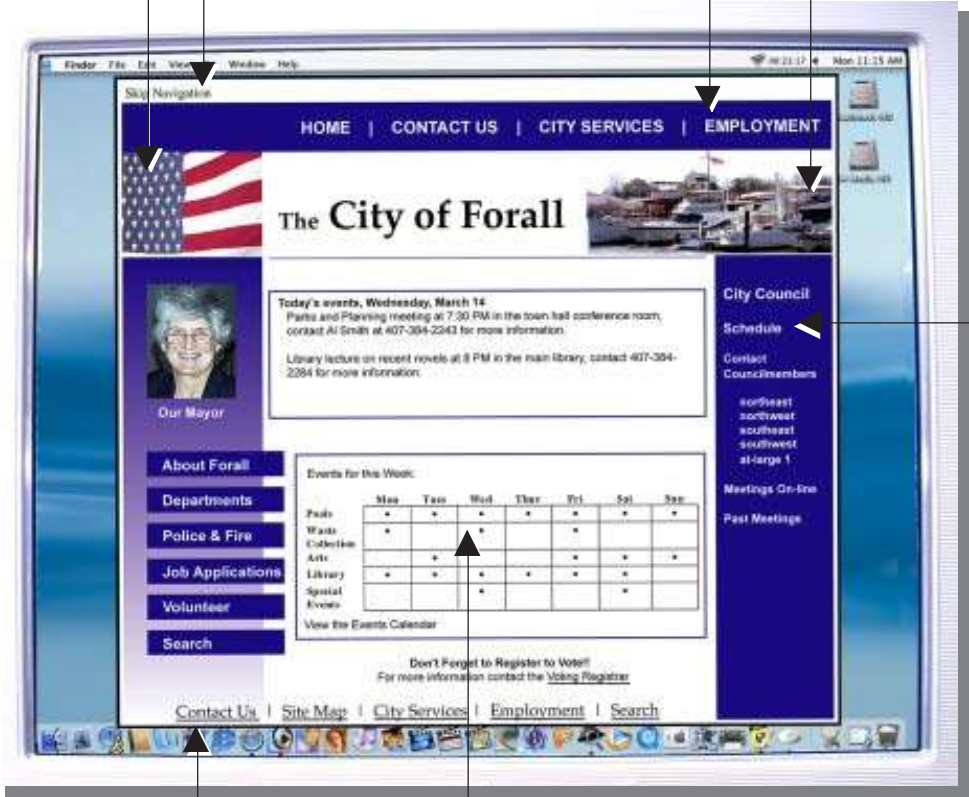

Text links do not require any additional information or description if the text clearly indicates what the link is supposed to do. Links such as "click here" may confuse a user.

When tables with header and row identifiers are used to display information or data, the header and row information should be associated with each data cell by using HTML so a person using a screen reader can understand the information.

A link with contact information provides a way for users to request accessible services or to make suggestions.

## Resources for Web Developers (continued)

A more comprehensive resource is the **Web Content Accessibility Guidelines** developed by the Web Accessibility Initiative. These guidelines help designers make web pages as accessible as possible to the widest range of users, including users with disabilities. The Web Accessibility Initiative is a subgroup of the World Wide Web Consortium — the same organization that standardizes the programming language followed by all web developers.

- Information for web developers interested in making their web pages as accessible as possible, including the current version of the **Web Content Accessibility Guidelines** (and associated checklists), can be found at [www.w3c.org/WAI/Resources](http://www.w3c.org/WAI/Resources), and
- Information about the Web Accessibility Initiative can be found at [www.w3c.org/WAI](http://www.w3c.org/WAI).

## For More Information

### Technical Information Regarding Web Accessibility

For technical assistance regarding Section 508 Standards and how to make web pages accessible to people with disabilities, please contact the Access Board:

**800-872-2253 (voice)**

**800-993-2822 (TTY)**

## Information about the ADA

The Department of Justice provides technical assistance to help State and local governments understand and comply with the ADA. An important source of ADA information is the Department's ADA Home Page on the World Wide Web. This extensive website provides access to ADA regulations; all Department ADA technical assistance materials, including newly-released publications; proposed changes in the ADA regulations; and access to Freedom of Information Act materials, including technical assistance letters. The website also provides links to other Federal agencies with ADA responsibilities.

**ADA Home Page -- [www.ada.gov](http://www.ada.gov)**

In addition, the Department of Justice operates a toll-free ADA Information Line that provides access to ADA specialists during business hours.

### ADA Information Line

**800-514-0301 (voice)**

**800-514-0383 (TTY)**

## Reproduction

Reproduction of this document is encouraged.

June 2003

The Attorney General has determined that publication of this periodical is necessary in the transaction of the public business required by law of the Department of Justice.

---

---

**APPENDIX E:  
CITY OF CHINO WEBSITE ACCESSIBILITY  
INSPECTION**

---

---

Barrier Test	Bug_Id	Severity	WCAG Guideline	Environment	Users Affected	Page Name/ URL	Summary	Steps to Reproduce	Actual Result	Expected Result	Instances/ Observation	User Impact	Screenshot	Dev Recommendation
AXE	CHI_101	Low	4.1.1 Parsing	Win 10/ Chrome	Visually Impaired	Home	Application contains multiple elements with the same id attribute value.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Run axe tool and verify	Application contains multiple elements with the same id attribute value.	Id attribute value must be unique for all the elements.	Observation: 1. IDs used in aria and label must be unique. Instances: Duplicate IDs may adversely affect assistive technologies such as screen readers. Any JavaScript, markup, or CSS style rules referring to the ID will fail	https://app.screencast.com/At0V400DeG14	Change an ID value if it is used more than once to be sure each is unique.	
Browser Zoom	CHI_102	High	1.4.10 Text Reflow	Win 10/ Chrome	Low Vision	Contact Us	Table content overlaps with each other at 400% browser zoom.	1. Launch the URL: <a href="https://www.cityofchino.org/directory.aspx">https://www.cityofchino.org/directory.aspx</a> 2. Apply 400% zoom and verify	Table content overlaps with each other at 400% browser zoom.	Table content should not overlap with each other at 400% browser zoom.		Low vision user will not be able to access the content.	https://app.screencast.com/diCTioAwM3Uf	Ensure that the container div enclosing the elements resides on 400% zoom, this can be achieved by using % or em units.
Keyboard	CHI_103	High	2.4.3 Focus Order	Win 10/ Chrome	Visually Impaired Motor Impaired	Home	Focus order does not match with the presentation order.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate on the page using tab key and verify	Focus order does not match with the presentation order of page. While navigating through tab key, first focus moves to link. 'View all events'	Focus order should match with the presentation order of the page ie. from left to right and from top to bottom. Focus should first move to link		If focus order will be incorrect then keyboard user will not be able to perceive the content in a logical manner.	https://app.screencast.com/NYf65a51j1j1	Provide proper tab indexing so that focus moves in a logical manner.
Keyboard	CHI_104	High	2.4.3 Focus Order	Win 10/ Chrome	Visually Impaired Motor Impaired	Contact Us	Focus order does not match with the presentation order.	1. Launch the URL: <a href="https://www.cityofchino.org/directory.aspx">https://www.cityofchino.org/directory.aspx</a> 2. Navigate on the page using tab key and verify	Focus order does not match with the presentation order of page. While navigating through tab key, first focus moves to table and after that	Focus order should match with the presentation order of the page ie. from left to right and from top to bottom. Focus should first move to	Instances: 1. CSC- Focus order does not match with the presentation order. 2. Bids> Focus order does not	If focus order will be incorrect then keyboard user will not be able to perceive the content in a logical manner.	https://app.screencast.com/urez0WtZwNyg	Provide proper tab indexing so that focus moves in a logical manner.
Color Contrast	CHI_105	High	1.4.11 Non-Text Contrast	Win 10/ Chrome	Low Vision	Home	The color contrast ratio of border line of edit field is less than the standard ratio 3:1.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Verify color contrast ratio of border line of edit field	The color contrast ratio of border line of edit field having grey foreground and white background is less than the standard ratio 3:1.	The color contrast ratio of border line of edit field having grey foreground and white background should be equal to or more than the standard		If Color contrast ratio falls for the text, then low vision user will not be able to access that particular text on the page.	https://app.screencast.com/F04PaG3MAAKN	Change the color of border line to black. Change the colour of the element with respect to
Color Contrast	CHI_106	High	1.4.3 Contrast (Minimum)	Win 10/ Chrome	Low Vision	Utilities	The color contrast ratio of text 'Other Utilities' is less than the standard ratio 4.5:1.	1. Launch the URL: <a href="https://www.cityofchino.org/379/Utilities">https://www.cityofchino.org/379/Utilities</a> 2. Verify color contrast ratio of text 'Other Utilities'	The color contrast ratio of text 'Other Utilities' having blue foreground and grey background is less than the standard ratio 4.5:1.	The color contrast ratio of text 'Other Utilities' having blue foreground and grey background should be equal to or more than the standard	Instances: 1. Business License 2. City Budget	If Color contrast ratio falls for the text, then low vision user will not be able to access that particular text on the page.	https://app.screencast.com/V1R1a1icEqov	Change the colour of the element with respect to background such that it is as per standard color contrast ratio i.e 4.5:1 (Foreground : )
Color Contrast	CHI_107	High	1.4.3 Contrast (Minimum)	Win 10/ Chrome	Low Vision	Community	The color contrast ratio of text 'RSS, Notify Me' etc are less than the standard ratio 4.5:1.	1. Launch the URL: <a href="https://www.cityofchino.org/CivicAlerts.aspx">https://www.cityofchino.org/CivicAlerts.aspx</a> 2. Verify color contrast ratio of text 'RSS, Notify Me' etc	The color contrast ratio of text 'RSS, Notify Me' etc having grey foreground and light grey background is less than the standard ratio 4.5:1.	The color contrast ratio of text 'RSS, Notify Me' etc having grey foreground and light grey background should be equal to or more than the standard		If Color contrast ratio falls for the text, then low vision user will not be able to access that particular text on the page.	https://app.screencast.com/H4qDeuQxAR8D	Change the colour of the element with respect to background such that it is as per standard color contrast ratio i.e 4.5:1 (Foreground : )
Screen Reader	CHI_108	High	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	[Global] Main landmark region is not defined for the web page.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Press 'R' on JAWS and verify landmark region	Main landmark region is not defined for the web page.	Main landmark region should be properly defined for the web page.		Without the landmark regions, screen reader users would not be able to understand the structure of the page.	https://app.screencast.com/O0ufqMvRvLXtg	Use both HTML5 and ARIA landmarks to ensure all content is contained within a navigational region. In HTML5, you should use
Screen Reader	CHI_109	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Incorrect role is defined to 'Create a website account, website sign in'.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'Create a website account, website sign in' using arrow keys and verify	Incorrect role is defined to 'Create a website account, website sign in'. Role is unnecessarily defined as button instead of link.	Role of 'Create a website account, website sign in' should be defined as link.		If incorrect role will be defined then screen reader user will not be able to understand the correct purpose and functionality of element.	https://app.screencast.com/ccE2VfBmYXGL	Provide proper link role to the element.
Screen Reader	CHI_110	High	1.1.1 Non Text Content	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Alt text is not provided for logo.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to logo using arrow keys and verify	Alt text is not provided for logo.	Proper alt text should be provided for logo.		Without proper alt text screen reader user will not be able to understand the purpose of the graphic. Resultant loss of information	https://app.screencast.com/MXf0yC5D3pMD	Provide proper alt text to the graphic. alt=""
Screen Reader	CHI_111	Medium	1.4.13 Content on Hover or Focus	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Tooltip is not provided for 'search, accessibility' icons.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'search, accessibility' icons and verify	Tooltip is not provided for 'search, accessibility' icons.	Tooltip should be provided for 'search, accessibility' icons.		If tooltip will not be provided then user will not be able to identify the icons.	https://app.screencast.com/wU6ssIN5t6BU4	1. Create a <div> element, give it a role="tooltip" and an id="IDREF". Then, give it a brief description of the action.
Screen Reader	CHI_112	High	4.1.3 Status Messages	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Screen reader does not automatically announce the typeahead search results.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to search edit field type something and verify	Screen reader does not automatically announce the typeahead search results.	Screen reader should automatically announce the typeahead search results.		If search results will not be announced automatically then screen reader user will not be able to identify the typeahead suggestions.	https://app.screencast.com/WuJDRXx2V0JE1	Provide aria-live="" assertive"" and role="" alert"" to the changes that are made after hitting enter on sort button
Screen Reader	CHI_113	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Expanded/ collapsed state of navigation links are not announced.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to navigation items using arrow keys and verify	Screen reader does not announce the expanded/ collapsed state of navigation links.	Screen reader should announce the expanded/ collapsed state of navigation links.		If expanded/ collapsed state of element will not be announced then screen reader user will not be able to identify the state of link.	https://app.screencast.com/L1WhZpfhkG6b	Visit this link for the code: <a href="https://www.w3.org/WAI/GL/wiki/Using_the_WAI-ARIA_aria-expanded_state_to_mark_e">https://www.w3.org/WAI/GL/wiki/Using_the_WAI-ARIA_aria-expanded_state_to_mark_e</a>
Screen Reader	CHI_114	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Incorrect role is defined for navigation items.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to navigation items using arrow keys and verify	Incorrect role is defined for navigation items. Role is unnecessarily defined as menu sub menu instead of button.	Role of navigation items should be defined as button.		If incorrect role will be defined then screen reader user will not be able to understand the correct purpose and functionality of element.	https://app.screencast.com/L1WhZpfhkG6b	Provide correct aria role to the element. aria role should be defined as button. <a href="https://developer.mozilla.org/en/">https://developer.mozilla.org/en/</a>
Screen Reader	CHI_115	High	2.4.3 Focus Order	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	After hitting enter on navigation items, focus unnecessarily moves to top of the page.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to navigation items hit enter and verify focus	After hitting enter on navigation items, focus unnecessarily moves to top of the page.	After hitting enter on navigation items, focus should not move to top of the page.		If focus will move to top of the page then user will have to manually navigate to it.	https://app.screencast.com/ZELqYU6KEBvh	Provide proper indexing to the element so that focus remain on the element.
Screen Reader	CHI_116	High	2.2.2 Pause, Stop, Hide	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Cognitive Impaired	Home	Pause, Stop and Hide mechanism is not provided for the carousel.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to carousel using arrow keys and verify	Pause, Stop and Hide mechanism is not provided for the carousel which is moving continuously for more than 5 seconds.	Pause, Stop and Hide mechanism should be provided for the moving carousel.		If Pause, Stop, Hide mechanism will not be provided then it will distract the cognitive impaired users during their interaction	https://app.screencast.com/HcROfYsuqU50n	Construct an accessible Play/Pause functionality. For more detail refer: <a href="https://www.w3.org/WAI/WCAG21/Understa">https://www.w3.org/WAI/WCAG21/Understa</a>
Screen Reader	CHI_117	High	1.1.1 Non Text Content	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Proper alt text not provided for carousel graphic.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to carousel graphic using arrow keys and verify	Proper alt text not provided for carousel graphic. Screen reader is reading it as "Welcome message" graphic.	Proper alt text should be provided for carousel graphic. Screen reader should read it as "Welcome to chino where everything grows" graphic.		Without proper alt text screen reader user will not be able to understand the purpose of the graphic. Resultant loss of information	https://app.screencast.com/hvjz6xvNno	Provide proper alt text for graphic. <alt="">
Screen Reader	CHI_118	High	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	[Global] Heading hierarchy of the page is incorrect.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Press 'H' on JAWS and verify heading hierarchy of the page	Heading hierarchy of the page is incorrect. Multiple h1 is present and heading jumps from h1 to h4.	Heading hierarchy of the page should be correct. First heading of the page should be tagged in heading level 1 and after that rest of the headings		If headings are provided in an incorrect hierarchy, it would confuse screen reader users & they would find it difficult to understand the structure of the	https://app.screencast.com/8YNV18AWeIPQ	Construct the text intended as heading using html heading tags for e.g. h1, h2 etc, also follow the correct heading hierarchy


Barrier Test	Bug_Id	Severity	WCAG Guideline	Environment	Users Affected	Page Name/ URL	Summary	Steps to Reproduce	Actual Result	Expected Result	Instances/ Observation	User Impact	Screenshot	Dev Recommendation
Screen Reader	CHI_119	Medium	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Agenda & Minutes, Employment' etc are not tagged in list.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'Agenda & Minutes, Employment' etc using arrow keys and verify	Agenda & Minutes, Employment' etc are not tagged in list.	Agenda & Minutes, Employment' etc should be tagged in list.		If content will not be tagged in list then screen reader user will get confuse and will find difficulty in perceiving the information.	<a href="https://app.screencast.com/05b9gF8jvw4D">https://app.screencast.com/05b9gF8jvw4D</a>	Tag the link in list. Visit this link for code: 1. <a href="https://www.w3.org/WAI/tutorials/page-structure/content/">https://www.w3.org/WAI/tutorials/page-structure/content/</a>
Screen Reader	CHI_120	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Role of 'Agenda & Minutes, Employment' etc are not defined.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'Agenda & Minutes, Employment' etc using arrow keys and verify	Role of 'Agenda & Minutes, Employment' etc are not defined.	Role of 'Agenda & Minutes, Employment' etc should be defined. Role should be defined as link.		Without proper role screen reader user will not be able to understand the purpose and functionality of element.	<a href="https://app.screencast.com/05b9gF8jvw4D">https://app.screencast.com/05b9gF8jvw4D</a>	Provide proper aria role as link.
Screen Reader	CHI_121	High	2.4.3 Focus Order	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Motor Impaired	Home	Screen reader focus unnecessarily moves to hidden carousel content.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate on page using arrow keys and verify	Screen reader focus unnecessarily moves to hidden carousel content.	Screen reader focus should not move to hidden carousel content. Tab focus should move only to first visible slide, after that focus should move forward on the page.		If focus will move to hidden content then users will have to put extra effort in navigating forward on the page.	<a href="https://app.screencast.com/w4B4J2FYKf">https://app.screencast.com/w4B4J2FYKf</a>	Provide proper tab indexing so that focus does not move to hidden carousel slides.
Screen Reader	CHI_122	Medium	1.1.1 Non Text Content	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Decorative carousel images are not hidden.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to carousel graphic using arrow keys and verify	Decorative carousel images are not hidden.	Decorative carousel images should be hidden for screen reader user. Alt text for these images should be unique.		If decorative image is not hidden for screen reader users, it would confuse & cause inconvenience to the user.	<a href="https://app.screencast.com/rdodIM1aX902">https://app.screencast.com/rdodIM1aX902</a>	For decorative images, add attribute alt="" or null to avoid unnecessary tab focus.
Screen Reader	CHI_123	High	2.4.4 Link Purpose	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Unique link text is not provided to 'Additional info, Read On' links.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'Additional info, Read On' links using arrow keys and verify	Unique link text is not provided to 'Additional info, Read On' links.	Sufficient and unique link text should be provided to 'Additional info, Read On' links.	Instances: 1. Community	Without proper link text screen reader user will not be able to understand the purpose of the link.	<a href="https://app.screencast.com/QJdJ5pDD5wky">https://app.screencast.com/QJdJ5pDD5wky</a>	Provide proper and sufficient link text to 'Additional info, Read On' links.
Screen Reader	CHI_124	Medium	1.4.13 Content on Hover or Focus	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Tooltip is not provided for 'next/ previous' icons.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to next/ previous icons and verify	Tooltip is not provided for 'next/ previous' icons.	Tooltip should be provided for 'next/ previous' icons.		If tooltip will not be provided then user will not be able to identify the icons.	<a href="https://app.screencast.com/Rl8Hx2g57w3Di">https://app.screencast.com/Rl8Hx2g57w3Di</a>	1. Create a <div> element, give it a role="tooltip" and an id="IDREF". Then, give it a brief description of the action.
Screen Reader	CHI_125	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Incorrect role is defined to carousel controls.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to carousel controls using arrow keys and verify	Incorrect role is defined to carousel controls. Role is unnecessarily defined as link instead of button.	Role of carousel controls should be defined as button.		If incorrect role will be defined then screen reader user will not be able to understand the correct purpose and functionality of element.	<a href="https://app.screencast.com/6q31m0eLpXj">https://app.screencast.com/6q31m0eLpXj</a>	Provide correct aria role to the element. aria role should be defined as button. <a href="https://developer.mozilla.org/en-">https://developer.mozilla.org/en-</a>
Screen Reader	CHI_126	High	2.5.3 Label in Name	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Visible label does not matches with link label.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'View All News' link using arrow keys and verify	Visible label does not matches with link label. Visible label of link is 'View All News' but screen reader is reading it as link 'News Flash View All'.	Visible label should match with link label.		If visible and button label will be different then speech user will not be able to trigger that element through speech recognition software.	<a href="https://app.screencast.com/oDthgs7efnoP">https://app.screencast.com/oDthgs7efnoP</a>	Visible label should match with link label.
Screen Reader	CHI_127	High	1.2.3 Audio Description or Media Alternative (Prerecorded)	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Cognitive Impaired	Home	Transcript is not provided for the video.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to youtube video and verify	Text transcription is not provided for the video.	Appropriate text transcription should be provided for the video.		If text transcript for the video is not provided, it will be impossible for deaf-blind users to easily access the video content using their refreshable	<a href="https://app.screencast.com/srAw2PW13Y5G5">https://app.screencast.com/srAw2PW13Y5G5</a>	Construct an accessible video with transcript functionality. For more detail refer: <a href="https://www.w3.org/TR/UNDERSTANDING-">https://www.w3.org/TR/UNDERSTANDING-</a>
Screen Reader	CHI_128	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Incorrect role is defined to 'Meetings, Events'.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'Meetings, Events' using arrow keys and verify	Incorrect role is defined to 'Meetings, Events'. Role is unnecessarily defined as link instead of tab.	Role of 'Meetings, Events' should be defined as tabs.	Instances: 1. Utilities- Same issue is reproducible for 'Discontinuation of residential water service policy, Other	If incorrect role will be defined then screen reader user will not be able to understand the correct purpose and functionality of element.	<a href="https://app.screencast.com/5M08TCWh1q58C">https://app.screencast.com/5M08TCWh1q58C</a>	Provide correct aria role to the element. aria role should be defined as tabs. <a href="https://developer.mozilla.org/en-">https://developer.mozilla.org/en-</a>
Screen Reader	CHI_129	Medium	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Next/ previous icons are unnecessarily tagged in heading.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to next/ previous icons using arrow keys and verify	Next/ previous icons are unnecessarily tagged in heading.	Next/ previous icons should not be tagged in heading.		If regular text will be tagged in heading then it will confuse the screen reader user.	<a href="https://app.screencast.com/5H4e4yrgaP5XR">https://app.screencast.com/5H4e4yrgaP5XR</a>	Remove these texts from heading tag. And place them in <p>
Screen Reader	CHI_130	Medium	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Name of '<', '>' icons are not defined.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to next/ previous icons using arrow keys and verify	Name of '<', '>' icons are not defined.	Name of '<', '>' icons should be properly defined.		If name will not be defined then screen reader user will not be able to understand the purpose of button.	<a href="https://app.screencast.com/5H4e4yrgaP5XR">https://app.screencast.com/5H4e4yrgaP5XR</a>	Provide proper aria label to the button. <a href="http://www.w3.org/TR/wai-aria-practices/examples/table/table.html">http://www.w3.org/TR/wai-aria-practices/examples/table/table.html</a>
Screen Reader	CHI_131	High	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Calendar is not tagged in table.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'calendar' using arrow keys and verify	Calendar is not tagged in table. Screen reader is reading it as plain text.	Calendar should be tagged in table.		If tabular content will not be tagged in table then screen reader user will not be able to perceive the content in a manner it is presented.	<a href="https://app.screencast.com/DaTewFVT1uin2">https://app.screencast.com/DaTewFVT1uin2</a>	Tag the calendar in table. <a href="https://www.w3.org/TR/wai-aria-practices/examples/table/table.html">https://www.w3.org/TR/wai-aria-practices/examples/table/table.html</a>
Screen Reader	CHI_132	Medium	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Plain text is unnecessarily tagged in link.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to text 'Household Hazardous Waste Collection, Chino Fireworks Spectacular' using arrow keys and verify	Plain text is unnecessarily tagged in link.	Plain text should not be tagged in link.		If plain text will be tagged in link, then it will confuse the screen reader users.	<a href="https://app.screencast.com/ByzJlU07LdCs">https://app.screencast.com/ByzJlU07LdCs</a>	Remove link tag from the plain text.
Screen Reader	CHI_133	High	2.4.4 Link Purpose	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Link text provided to 'Read On' link is incorrect.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'Read On' link using arrow keys and verify	Link text provided to 'Read On' link is incorrect. Screen reader is reading it as link 'Household Hazardous Waste Collection, Chino Fireworks Spectacular'.	Sufficient, proper, correct and unique link text should be provided to 'Read On' link.		If incorrect link text will be provided then it will confuse the screen reader users.	<a href="https://app.screencast.com/oYntudrVeZL6">https://app.screencast.com/oYntudrVeZL6</a>	Provide unique link text to 'Read On' link.
Screen Reader	CHI_134	Medium	1.4.13 Content on Hover or Focus	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Tooltip is not provided for 'social media' icons.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'social media' icons and verify	Tooltip is not provided for 'social media' icons.	Tooltip should be provided for 'social media' icons.		If tooltip will not be provided then user will not be able to identify the icons.	<a href="https://app.screencast.com/zcF8Ybvofr1Q">https://app.screencast.com/zcF8Ybvofr1Q</a>	1. Create a <div> element, give it a role="tooltip" and an id="IDREF". Then, give it a brief description of the action.
Screen Reader	CHI_135	Medium	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Social media links are not tagged in list.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'social media' icons and verify	Social media links are not tagged in list.	Social media links should be tagged in list.		If content will not be tagged in list then screen reader user will get confuse and will find difficulty in perceiving the information.	<a href="https://app.screencast.com/2Xlynd6YR2KH2">https://app.screencast.com/2Xlynd6YR2KH2</a>	Tag the link in list. Visit this link for code: 1. <a href="https://www.w3.org/WAI/tutorials/page-structure/content/">https://www.w3.org/WAI/tutorials/page-structure/content/</a>
Screen Reader	CHI_136	High	2.4.4 Link Purpose	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Home	Sufficient link text is not provided to social media links.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'social media' icons and verify	Sufficient link text is not provided to social media links.	Sufficient link text should be provided to social media links. Screen reader should read it as link Chino on facebook, link Chino on twitter etc.		Without proper link text screen reader user will not be able to understand the purpose of the link.	<a href="https://app.screencast.com/2Xlynd6YR2KH2">https://app.screencast.com/2Xlynd6YR2KH2</a>	Provide proper and sufficient link text to social media links.

Barrier Test	Bug_Id	Severity	WCAG Guideline	Environment	Users Affected	Page Name/ URL	Summary	Steps to Reproduce	Actual Result	Expected Result	Instances/ Observation	User Impact	Screenshot	Dev Recommendation
Screen Reader	CHI_137	Medium	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Contact Us	[Global] 'Home' Staff Directory' is not tagged in breadcrumb menu.	1. Launch the URL: <a href="https://www.cityofchino.org/directory.aspx">https://www.cityofchino.org/directory.aspx</a> 2. Navigate to 'Home' Staff Directory' using arrow keys and verify	'Home' Staff Directory' is not tagged in breadcrumb menu.	'Home' Staff Directory' should be tagged in breadcrumb menu.		If breadcrumb will not be announced then screen reader user will not be able to identify it as breadcrumb menu.	<a href="https://app.screencast.com/k9EB1vKwtz1C">https://app.screencast.com/k9EB1vKwtz1C</a>	Provides a label that describes the type of navigation provided in the new element. <code>aria-label="breadcrumb"</code> .
Screen Reader	CHI_138	Low	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Contact Us	Screen reader is unnecessarily reading '>>' greater greater with link 'Search'.	1. Launch the URL: <a href="https://www.cityofchino.org/directory.aspx">https://www.cityofchino.org/directory.aspx</a> 2. Navigate to 'Search' using arrow keys and verify	Screen reader is unnecessarily reading '>>' greater greater with link 'Search'.	Screen reader should not read '>>' greater greater with link 'Search'.	Instances: 1. Community- Screen reader is unnecessarily reading arrow icons.	If screen reader will read '>>' with link Read more then it will confuse the screen reader users.	<a href="https://app.screencast.com/6zFyL4M4YQ1W">https://app.screencast.com/6zFyL4M4YQ1W</a>	Use aria hidden = true for the element.
Screen Reader	CHI_139	High	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Contact Us	Tabular content is not tagged in table.	1. Launch the URL: <a href="https://www.cityofchino.org/directory.aspx">https://www.cityofchino.org/directory.aspx</a> 2. Navigate to Tabular content using arrow keys and verify	Tabular content is not tagged in table. Screen reader is reading it as plain text.	Tabular content should be tagged in table.		If tabular content will not be tagged in table then screen reader user will not be able to perceive the content in a manner it is presented.	<a href="https://app.screencast.com/b1VnKo5sOUC">https://app.screencast.com/b1VnKo5sOUC</a>	Tag the tabular content in table. <a href="https://www.w3.org/TR/wai-aria-practices/examples/table/ta">https://www.w3.org/TR/wai-aria-practices/examples/table/ta</a>
Screen Reader	CHI_140	Medium	1.1.1 Non Text Content	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	CSC	Decorative images are not hidden.	1. Launch the URL: <a href="https://www.cityofchino.org/382/Community-Services-Commission">https://www.cityofchino.org/382/Community-Services-Commission</a> 2. Navigate to decorative graphic using arrow keys and verify	Decorative graphics are not hidden for screen reader users.	Decorative images should be hidden for screen reader user. Alt text for these images should be null.	Instances: 1. Community- Decorative images are not hidden.	If decorative image is not hidden for screen reader users, it would confuse & cause inconvenience to the user.	<a href="https://app.screencast.com/3bZmXetg4Cwq">https://app.screencast.com/3bZmXetg4Cwq</a>	For decorative images, add attribute alt="" or null to avoid unnecessary tab focus.
Screen Reader	CHI_141	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	CSC	Incorrect role is defined to 'Community Services Commission, Mobile Home Park Rent Stabilization Commission' etc elements.	1. Launch the URL: <a href="https://www.cityofchino.org/382/Community-Services-Commission">https://www.cityofchino.org/382/Community-Services-Commission</a> 2. Navigate to 'Community Services Commission, Mobile Home Park Rent Stabilization Commission' etc elements.	Incorrect role is defined to 'Community Services Commission, Mobile Home Park Rent Stabilization Commission' etc elements.	Role of 'Community Services Commission, Mobile Home Park Rent Stabilization Commission' etc elements should be defined as link.	Instances: 1. Bids 2. Report Graffiti 3. Business Resources	If incorrect role will be defined then screen reader user will not be able to understand the correct purpose and functionality of element.	<a href="https://app.screencast.com/esbjy2KGycQk">https://app.screencast.com/esbjy2KGycQk</a>	Provide proper link role to the element.
Screen Reader	CHI_142	Low	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	CSC	Screen reader is unnecessarily reading '+, -' icons with accordian.	1. Launch the URL: <a href="https://www.cityofchino.org/382/Community-Services-Commission">https://www.cityofchino.org/382/Community-Services-Commission</a> 2. Navigate to accordian using arrow keys and verify	Screen reader is unnecessarily reading '+, -' icons with accordian.	Screen reader should not read '+, -' icons with accordian.	Instances: 1. Community	If screen reader will read '+, -' icons with accordian then it will confuse the screen reader users.	<a href="https://app.screencast.com/dCBtFE2ppmW3m">https://app.screencast.com/dCBtFE2ppmW3m</a>	Use aria hidden = true for the element.
Screen Reader	CHI_143	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	CSC	Role of accordian is incorrectly defined as menu sub menu.	1. Launch the URL: <a href="https://www.cityofchino.org/382/Community-Services-Commission">https://www.cityofchino.org/382/Community-Services-Commission</a> 2. Navigate to accordian using arrow keys and verify	Role of accordian is incorrectly defined as menu sub menu. Screen reader reads it as plain text.	Role of accordian should be defined as button or tab.	Instances: 1. Community	Without proper role screen reader user will not be able to understand the purpose and functionality of element.	<a href="https://app.screencast.com/dCBtFE2ppmW3m">https://app.screencast.com/dCBtFE2ppmW3m</a>	Provide proper aria role to the accordian. Visit this link for code: <a href="https://www.w3.org/TR/wai-aria-practices-">https://www.w3.org/TR/wai-aria-practices-</a>
Screen Reader	CHI_144	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	CSC	Expanded/ collapsed state of accordian is not announced.	1. Launch the URL: <a href="https://www.cityofchino.org/382/Community-Services-Commission">https://www.cityofchino.org/382/Community-Services-Commission</a> 2. Navigate to accordian using arrow keys and verify	Expanded/ collapsed state of accordian is not announced.	Expanded/ collapsed state of accordian should be defined.	Instances: 1. Community	If expanded/ collapsed state of element will not be announced then screen reader user will not be able to identify the state of link.	<a href="https://app.screencast.com/dCBtFE2ppmW3m">https://app.screencast.com/dCBtFE2ppmW3m</a>	Visit this link for the code: <a href="https://www.w3.org/WAI/GL/wik/Using_the_WAI-ARIA_aria-expanded_state_to_mark_e">https://www.w3.org/WAI/GL/wik/Using_the_WAI-ARIA_aria-expanded_state_to_mark_e</a>
Screen Reader	CHI_145	Medium	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	CSC	Left navigation links are not tagged in list.	1. Launch the URL: <a href="https://www.cityofchino.org/382/Community-Services-Commission">https://www.cityofchino.org/382/Community-Services-Commission</a> 2. Navigate to left navigation links using arrow keys and verify	Left navigation links are not tagged in list.	Left navigation links should be tagged in list.	Instances: 1. Bids 2. Report Graffiti 3. Business Resources 4. Utilities	If content will not be tagged in list then screen reader user will get confuse and will find difficulty in perceiving the information.	<a href="https://app.screencast.com/NfRNSd5YshMp2">https://app.screencast.com/NfRNSd5YshMp2</a>	Tag links in list tag. Visit this link for code: 1. <a href="https://www.w3.org/WAI/tutorials/page-structure/content/">https://www.w3.org/WAI/tutorials/page-structure/content/</a>
Screen Reader	CHI_146	High	4.1.3 Status Messages	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Report Graffiti	Screen reader does not automatically announce the success message.	1. Launch the URL: <a href="https://www.cityofchino.org/507/Report-Graffiti">https://www.cityofchino.org/507/Report-Graffiti</a> 2. Submit the form with valid details and verify	Screen reader does not automatically announce the success message.	Screen reader should automatically announce the success message.		If success message will not be announced automatically then screen reader user will not be able to identify whether form has been successfully submitted	<a href="https://app.screencast.com/X6OY7P5zbe58o">https://app.screencast.com/X6OY7P5zbe58o</a>	Provide aria-live="" assertive="" and role="alert"" to the changes that are made after hitting enter on sort button
Screen Reader	CHI_147	Medium	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Report Graffiti	Form fields are unnecessarily tagged in list.	1. Launch the URL: <a href="https://www.cityofchino.org/507/Report-Graffiti">https://www.cityofchino.org/507/Report-Graffiti</a> 2. Navigate to form using arrow keys and verify	Form fields are unnecessarily tagged in list.	Form fields should not be tagged in list.		If forms will be tagged in list then it will confuse the screen reader users.	<a href="https://app.screencast.com/bUMTcE1A1bsR0">https://app.screencast.com/bUMTcE1A1bsR0</a>	Remove the forms from the list tag.
Screen Reader	CHI_148	Medium	1.3.1 Info and Relationships	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Business Resources	Incorrect list tag is implemented for list items.	1. Launch the URL: <a href="https://www.cityofchino.org/459/Business-Resources">https://www.cityofchino.org/459/Business-Resources</a> 2. Navigate to list items present under 'City of Chino' section using arrow keys and verify	Incorrect list tag is implemented for list items. All 3 items are unnecessarily tagged in separate list tag.	Correct list tag should be implemented for list items. All 3 items should be tagged in list of 3 items.		If incorrect list tag will be implemented then it will confuse the screen reader users.	<a href="https://app.screencast.com/OdzHFDnp1eNcT">https://app.screencast.com/OdzHFDnp1eNcT</a>	Tag list items in list of 3 items.
Screen Reader	CHI_149	High	4.1.2 Name, Role, Value	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	Utilities	Role of accordian is incorrectly defined as link.	1. Launch the URL: <a href="https://www.cityofchino.org/379/Utilities">https://www.cityofchino.org/379/Utilities</a> 2. Navigate to accordian using arrow keys and verify	Role of accordian is incorrectly defined as link. Screen reader reads it as plain text.	Role of accordian should be defined as button or tab.	Instances: 1. Business License 2. Community	Without proper role screen reader user will not be able to understand the purpose and functionality of element.	<a href="https://app.screencast.com/TrQ3pawwZola">https://app.screencast.com/TrQ3pawwZola</a>	Provide proper aria role to the accordian. Visit this link for code: <a href="https://www.w3.org/TR/wai-aria-practices-">https://www.w3.org/TR/wai-aria-practices-</a>
Screen Reader	CHI_150	Medium	1.1.1 Non Text Content	Win 10/ Chrome/ JAWS Win 10/ Edge/ JAWS iOS/ Safari/ VoiceOver Mac/ Safari/ VoiceOver	Visually Impaired	City Budget	Decorative image is not hidden.	1. Launch the URL: <a href="https://www.cityofchino.org/220/Budget">https://www.cityofchino.org/220/Budget</a> 2. Navigate to decorative graphic using arrow keys and verify	Decorative image is not hidden for screen reader users.	Decorative images should be hidden for screen reader user. Alt text for these images should be null.		If decorative image is not hidden for screen reader users, it would confuse & cause inconvenience to the user.	<a href="https://app.screencast.com/XbPpI2wzlOH">https://app.screencast.com/XbPpI2wzlOH</a>	For decorative images, add attribute alt="" or null to avoid unnecessary tab focus.
Screen Reader	CHI_151	High	4.1.2 Name, Role, Value	iOS/ Safari/ VoiceOver	Visually Impaired	Home	Role of 'hamburger menu' is not defined.	1. Launch the URL: <a href="https://www.cityofchino.org/">https://www.cityofchino.org/</a> 2. Navigate to 'hamburger menu' using arrow keys and verify	Role of 'hamburger menu' is not defined.	Role of 'hamburger menu' should be defined. Role should be defined as button.		Without proper role screen reader user will not be able to understand the purpose and functionality of element.	<a href="https://app.screencast.com/1STympvF82Pr">https://app.screencast.com/1STympvF82Pr</a>	Provide proper aria role as button.

---

**APPENDIX F:  
PUBLIC RIGHT-OF-WAY SIDEWALK AND CURB  
RAMP EVALUATION MAPS**


---

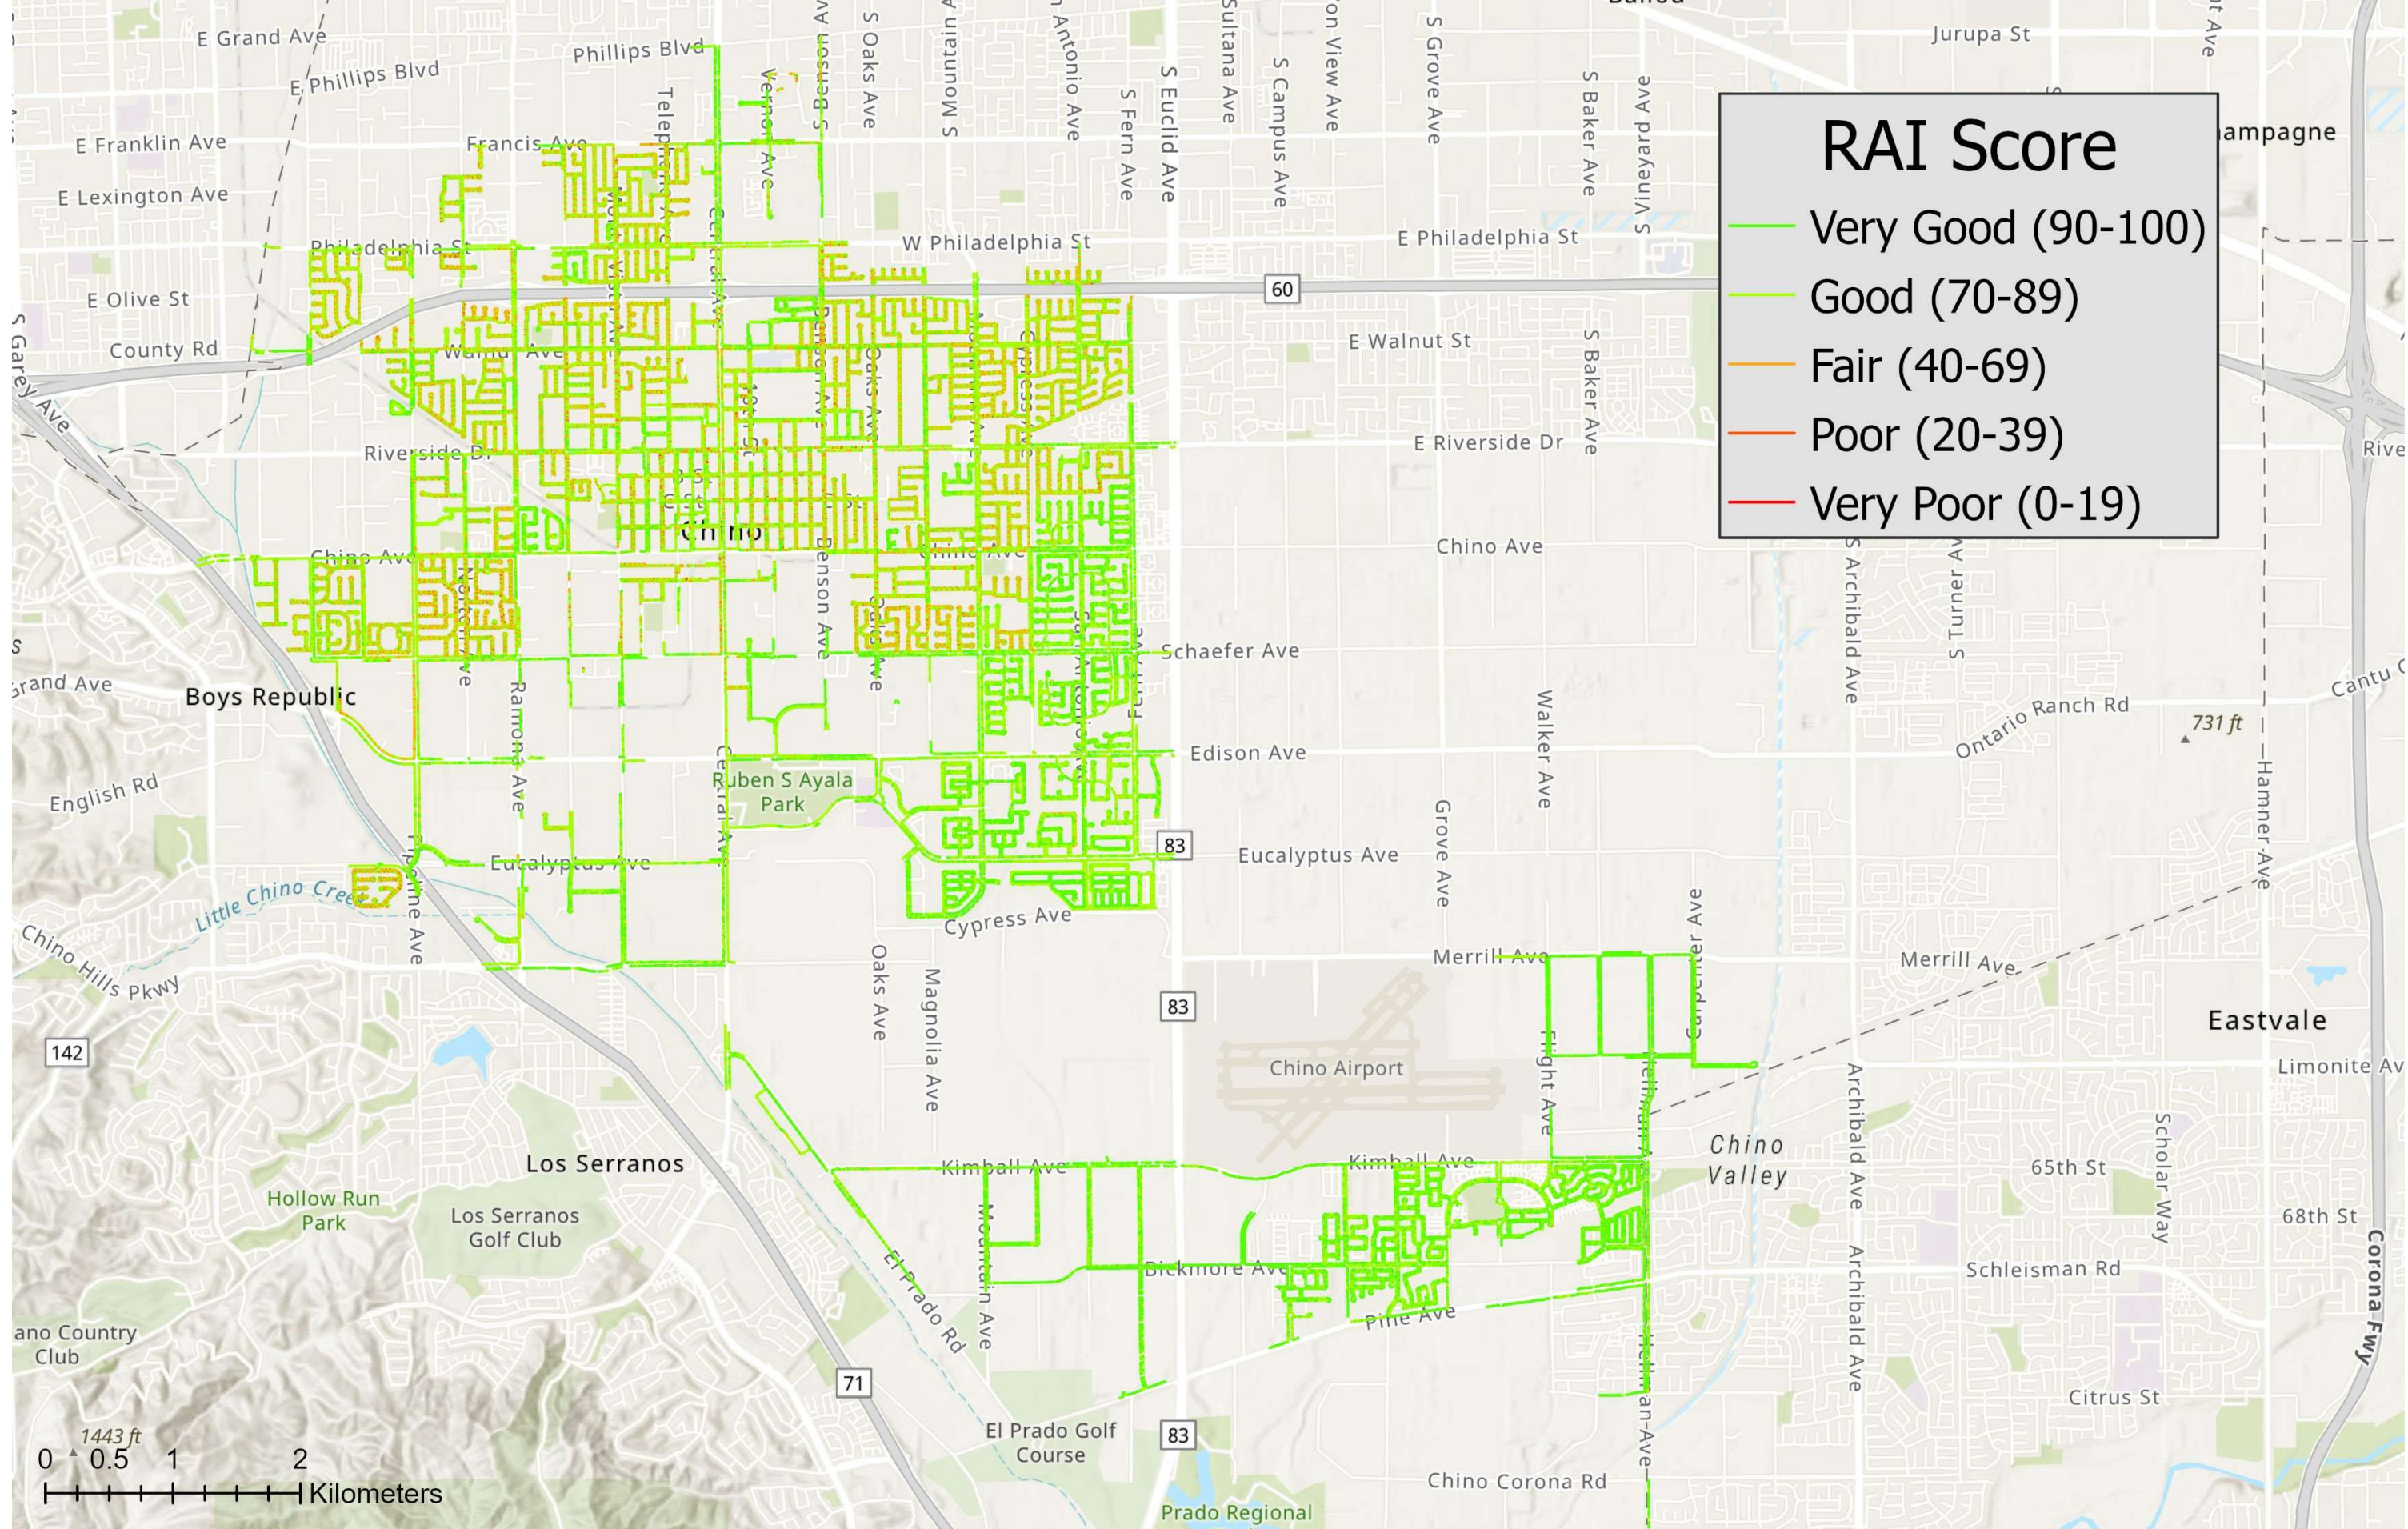


### RAI Score

- Very Good (90-100)
- Good (70-89)
- Fair (40-69)
- Poor (20-39)
- Very Poor (0-19)


# Chino, CA Sidewalk Evaluation

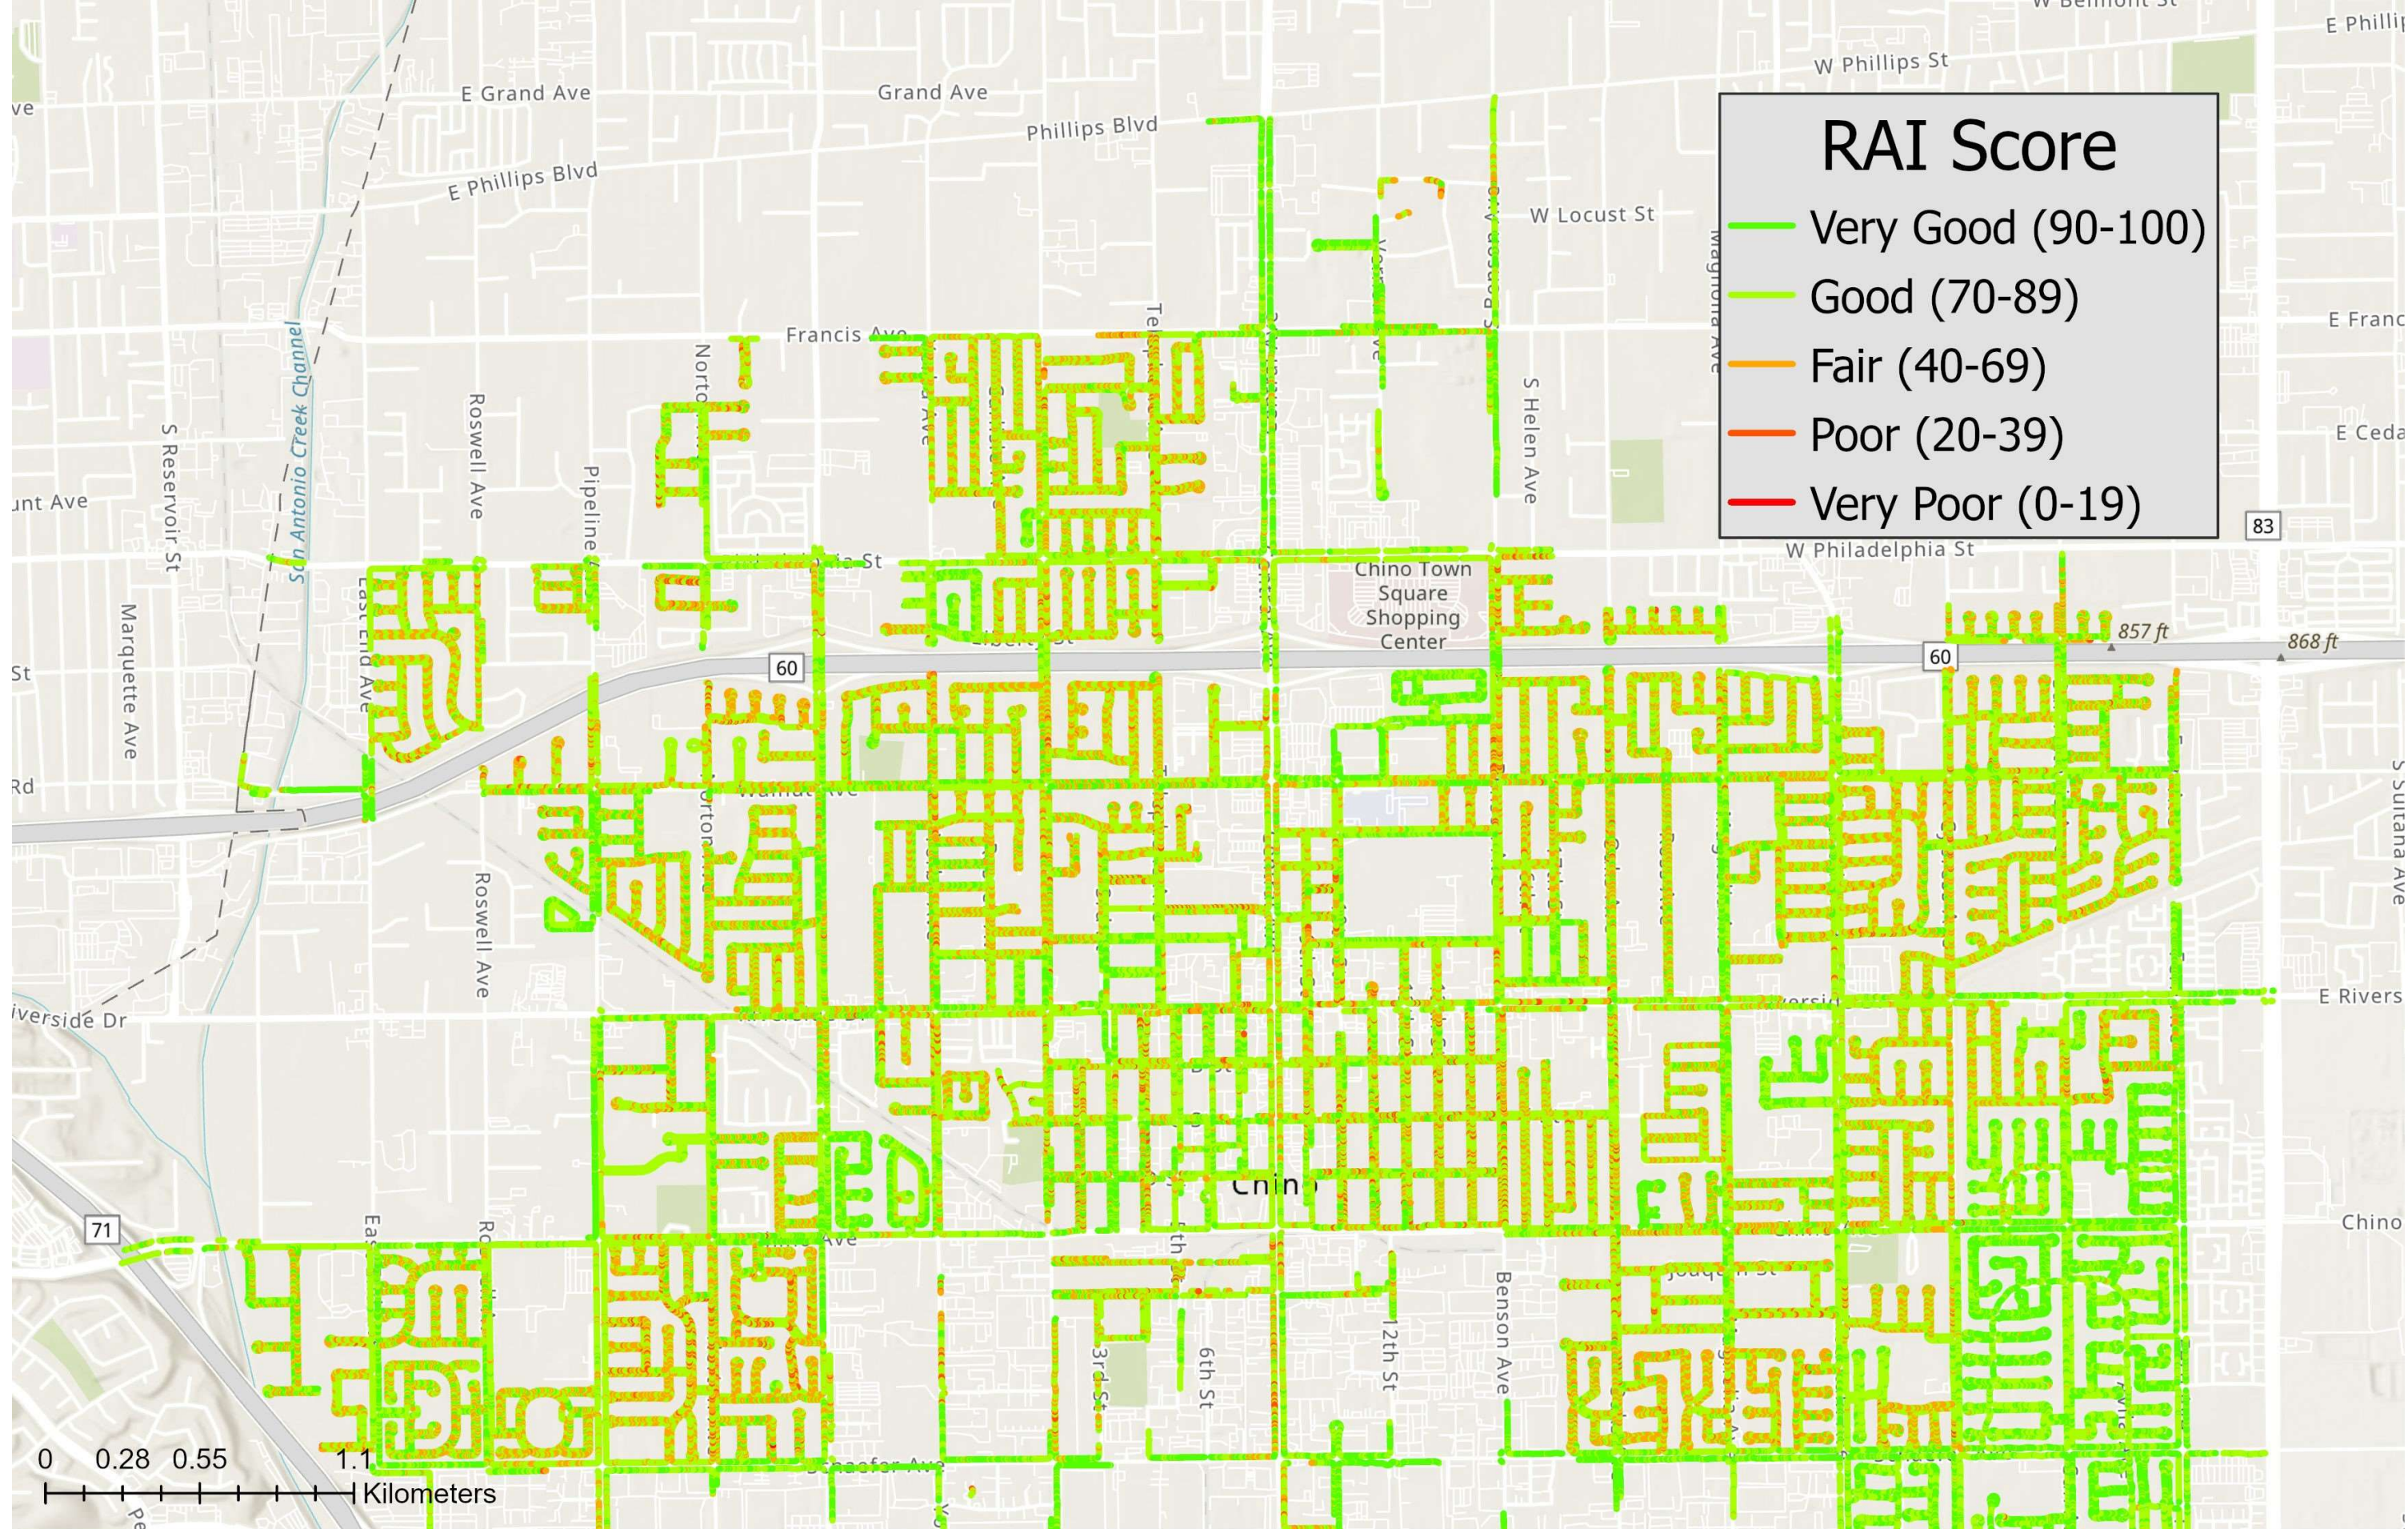


# Chino, CA Sidewalk Evaluation-North

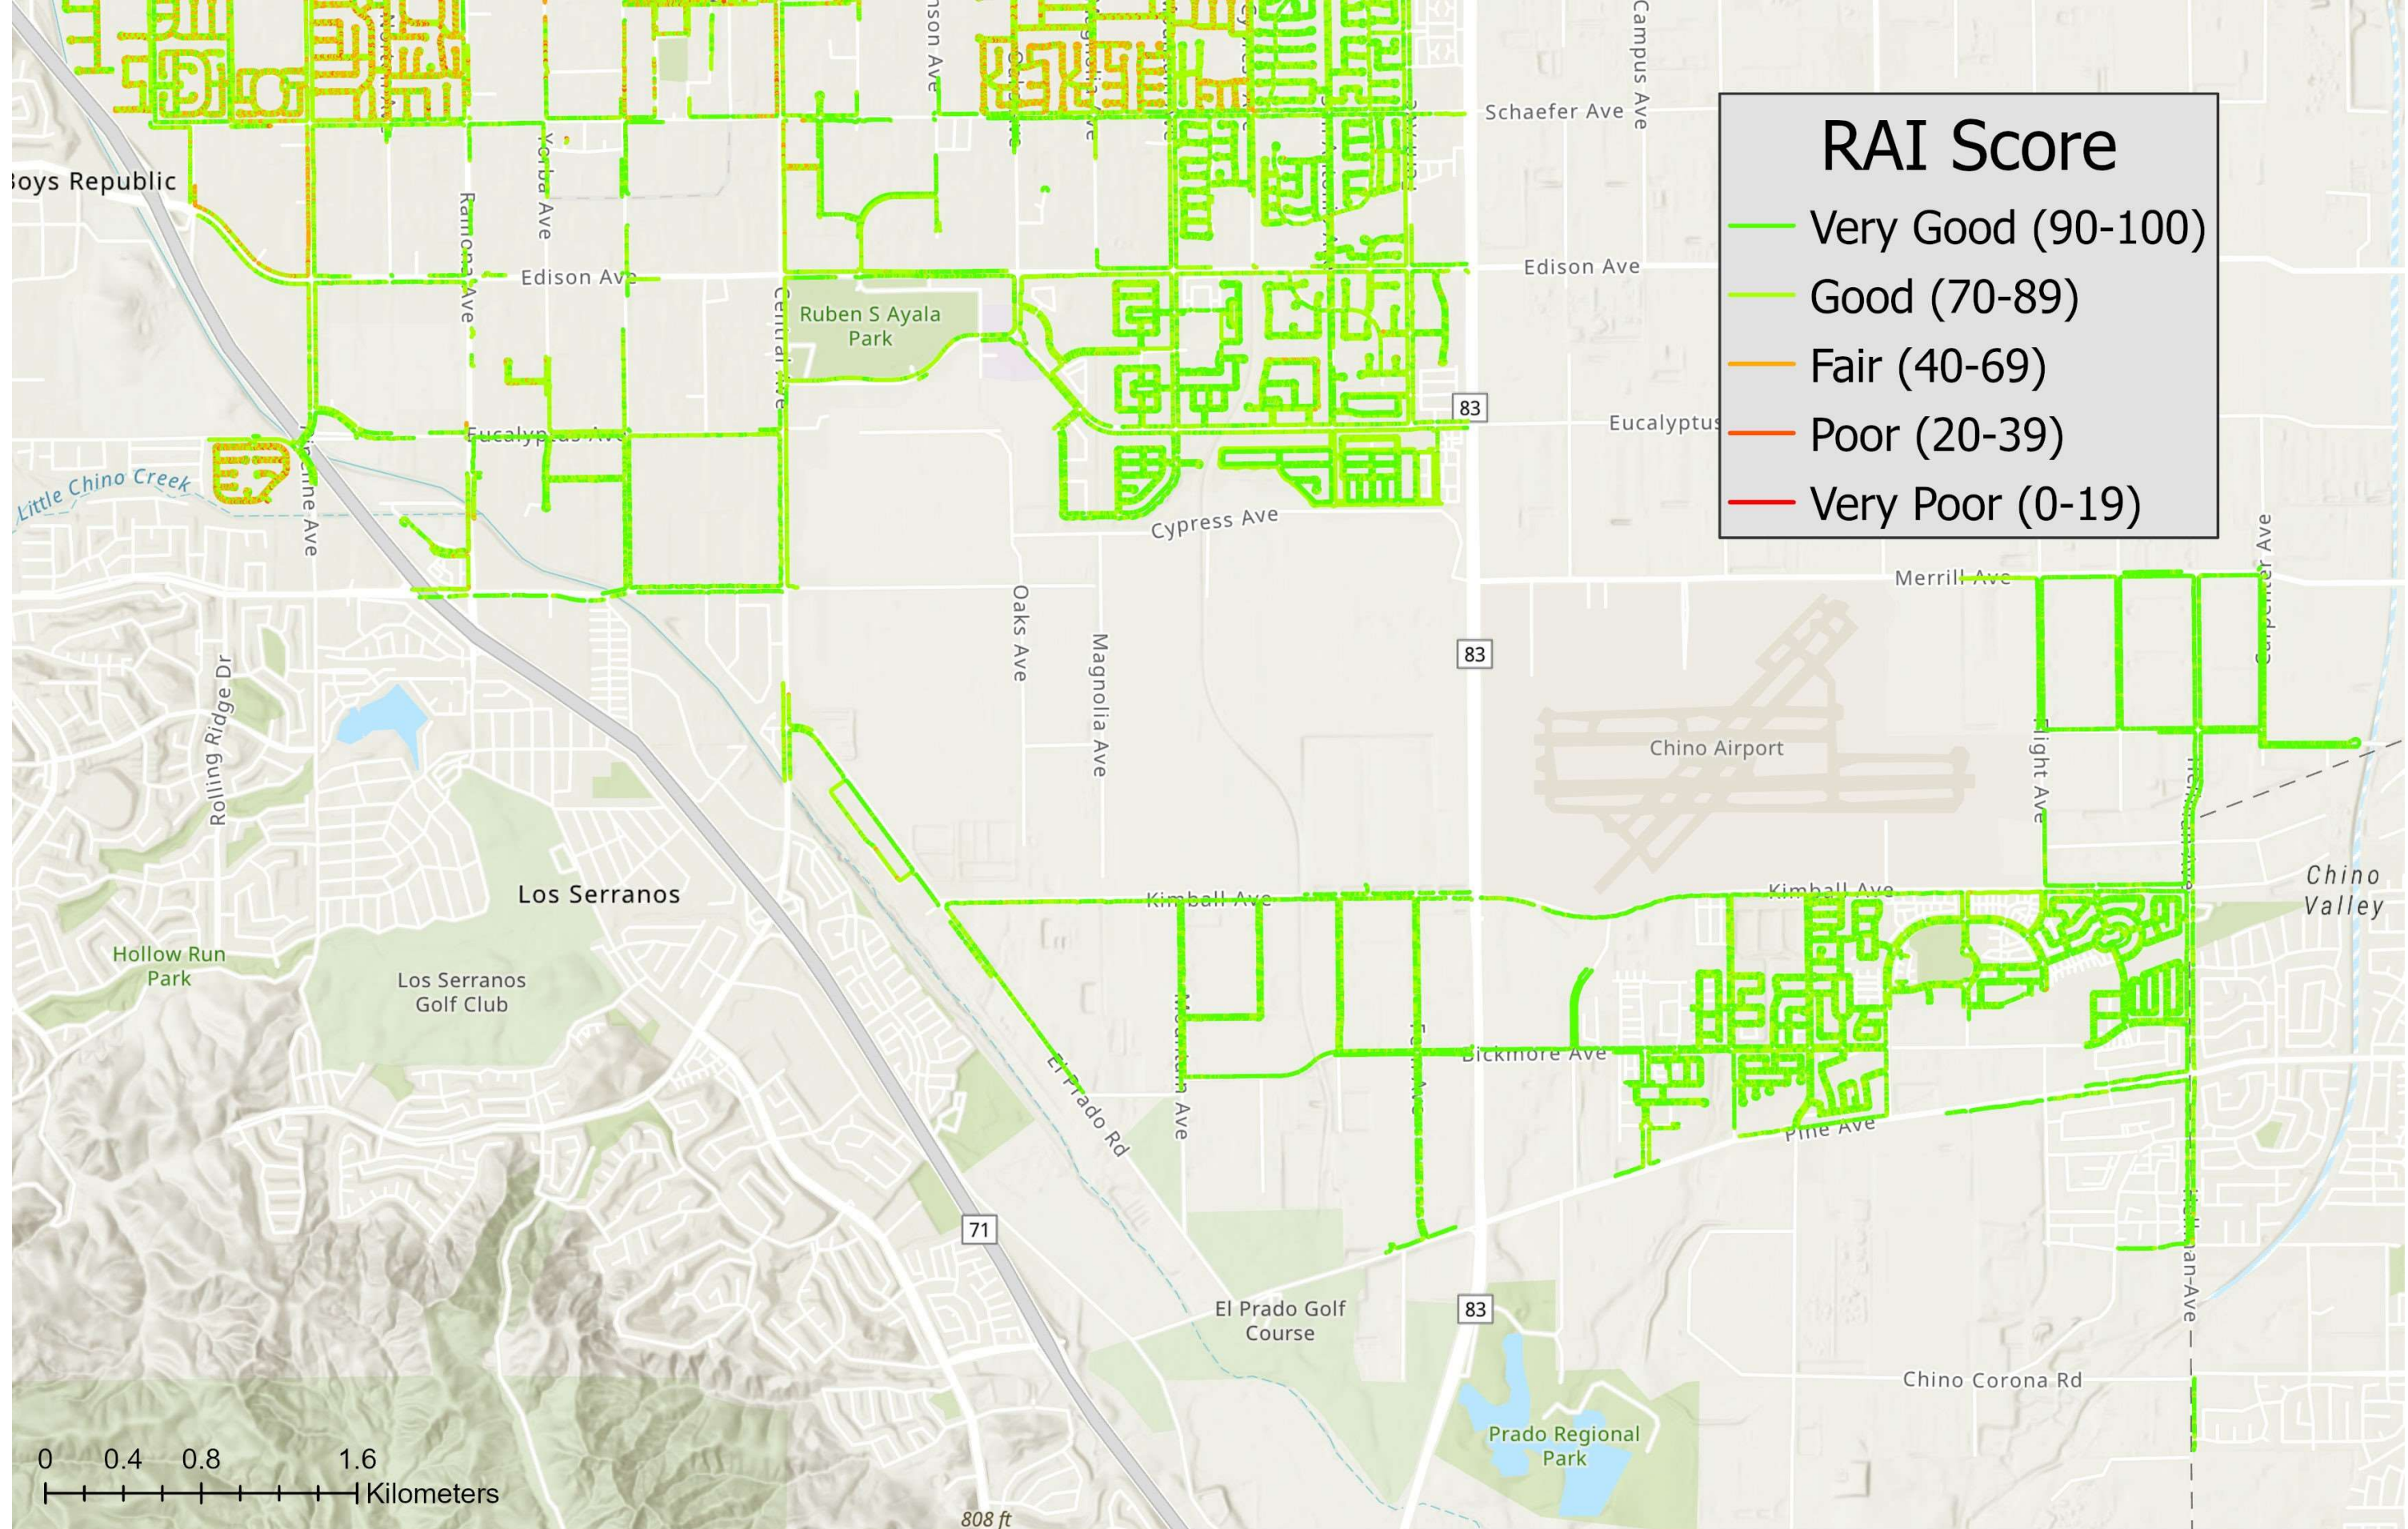


# Chino, CA Sidewalk Evaluation-South

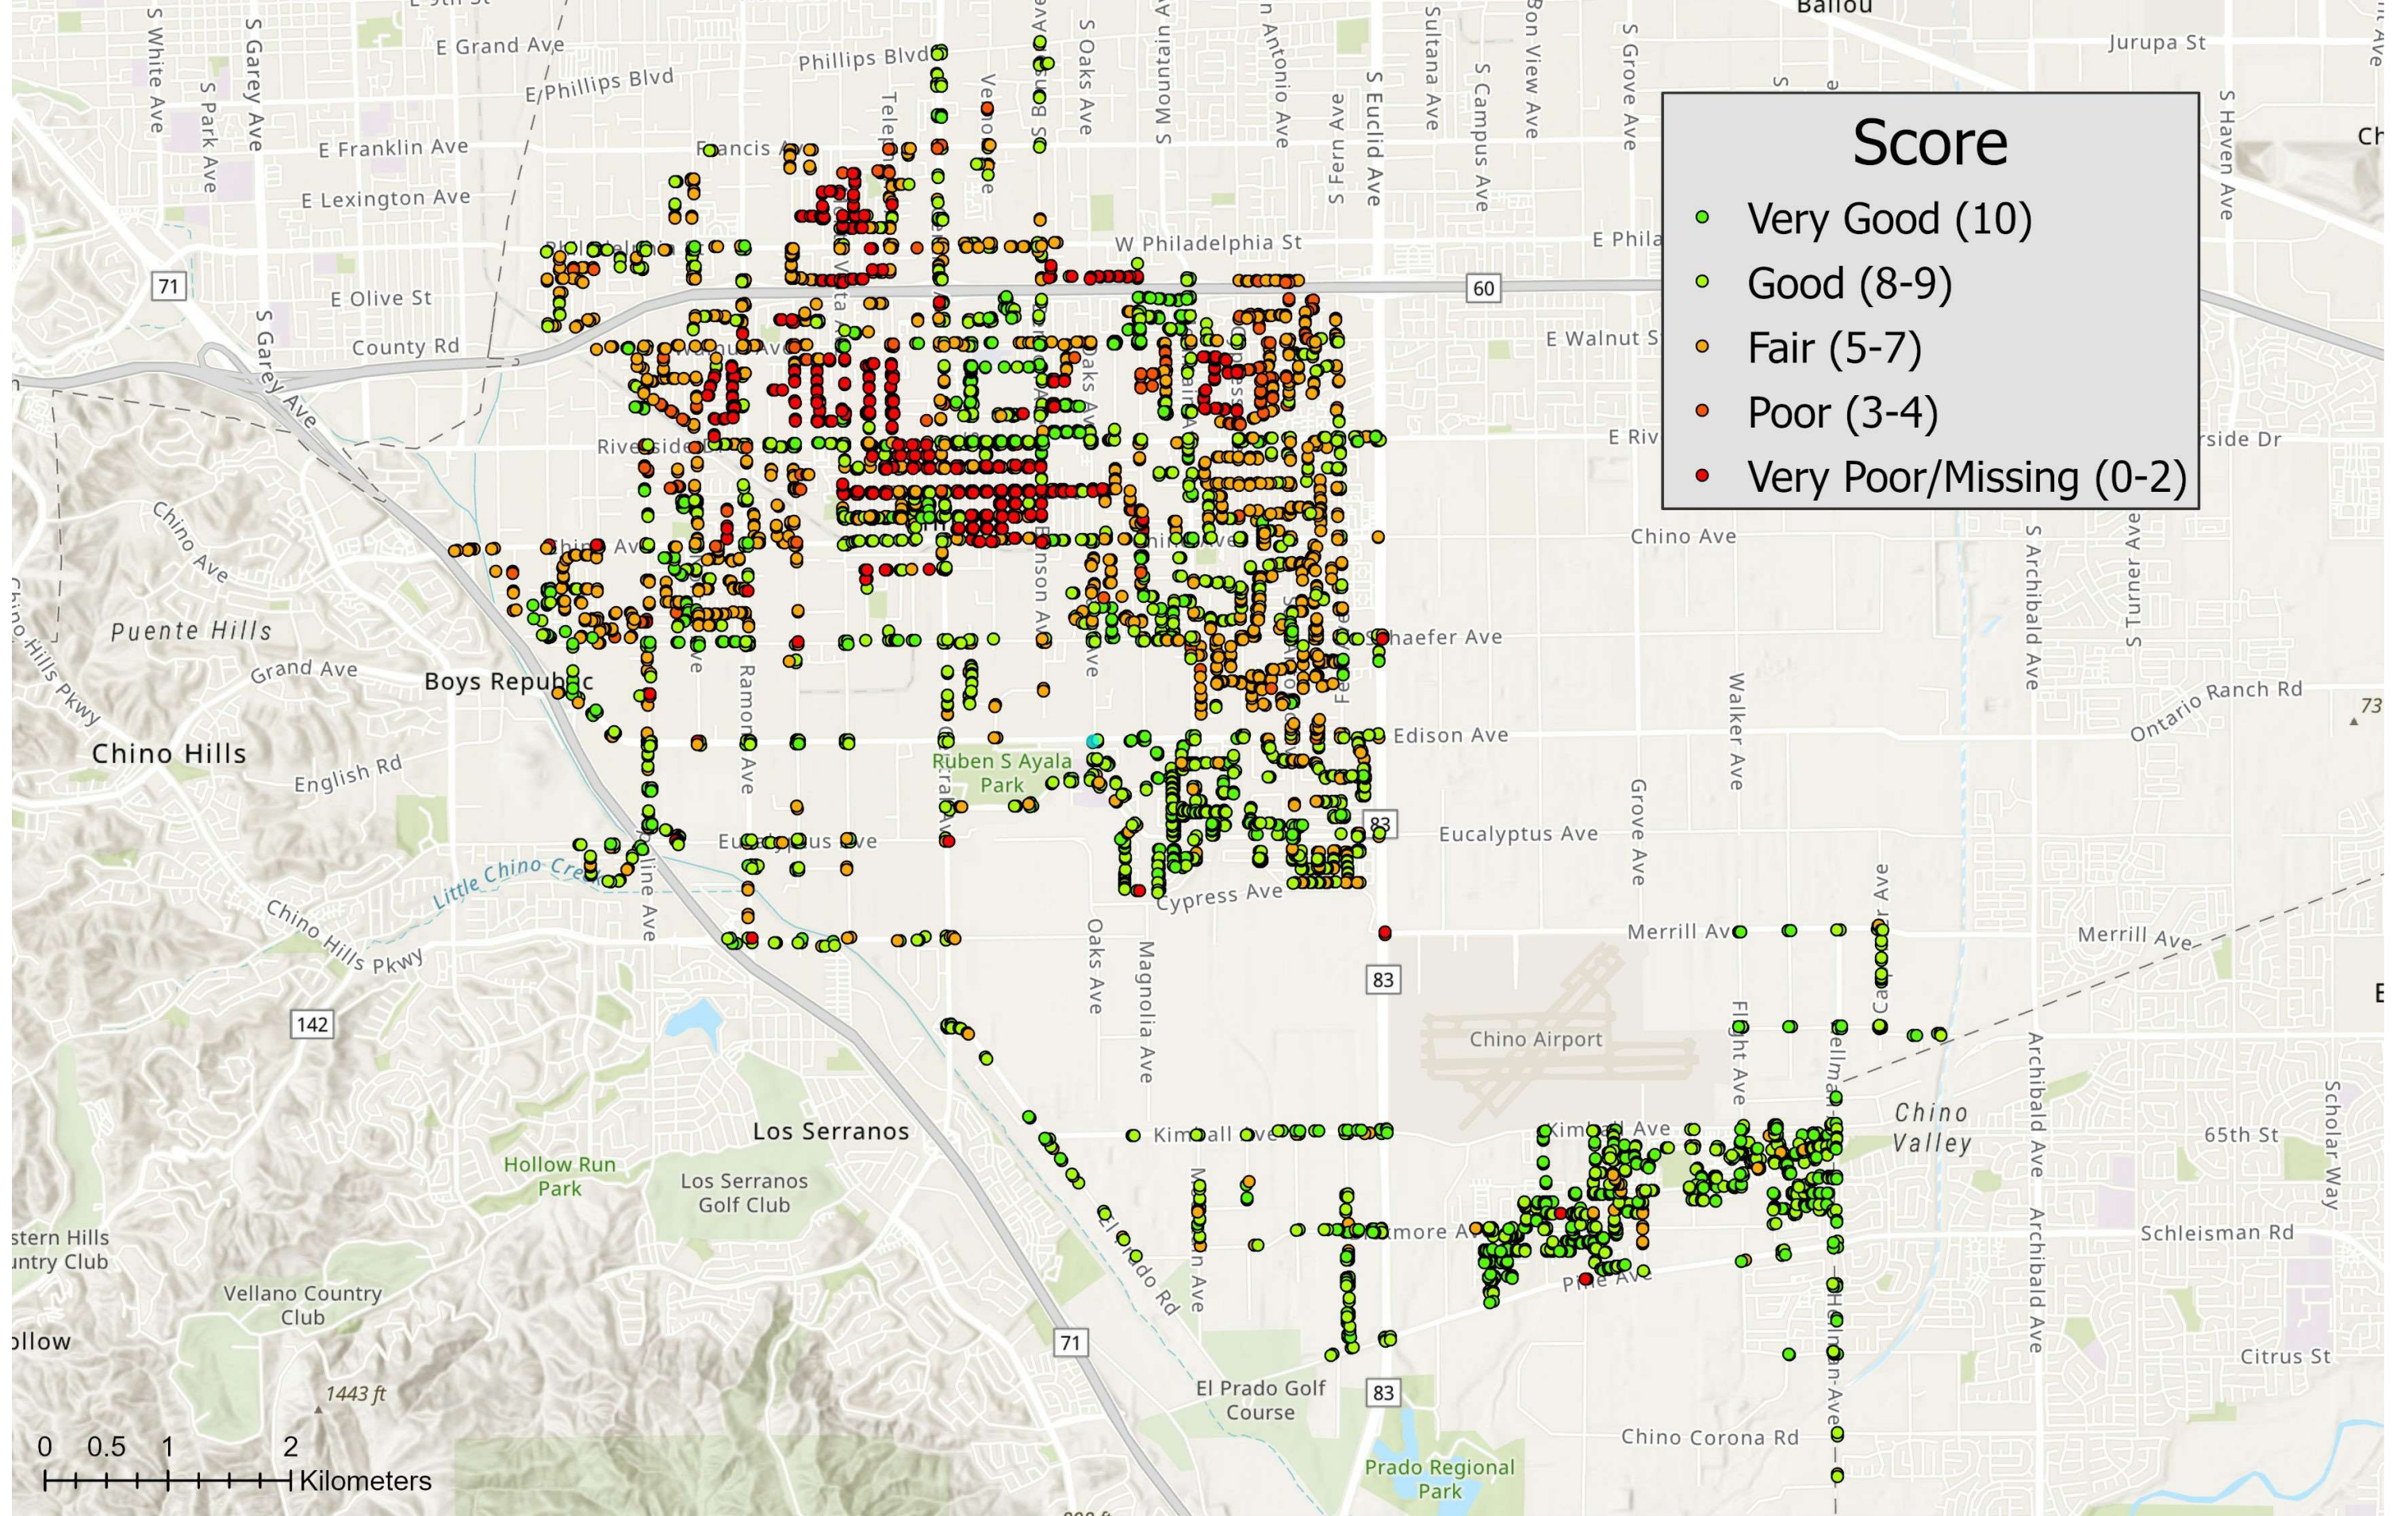

# Chino, CA Curb Ramp Evaluation

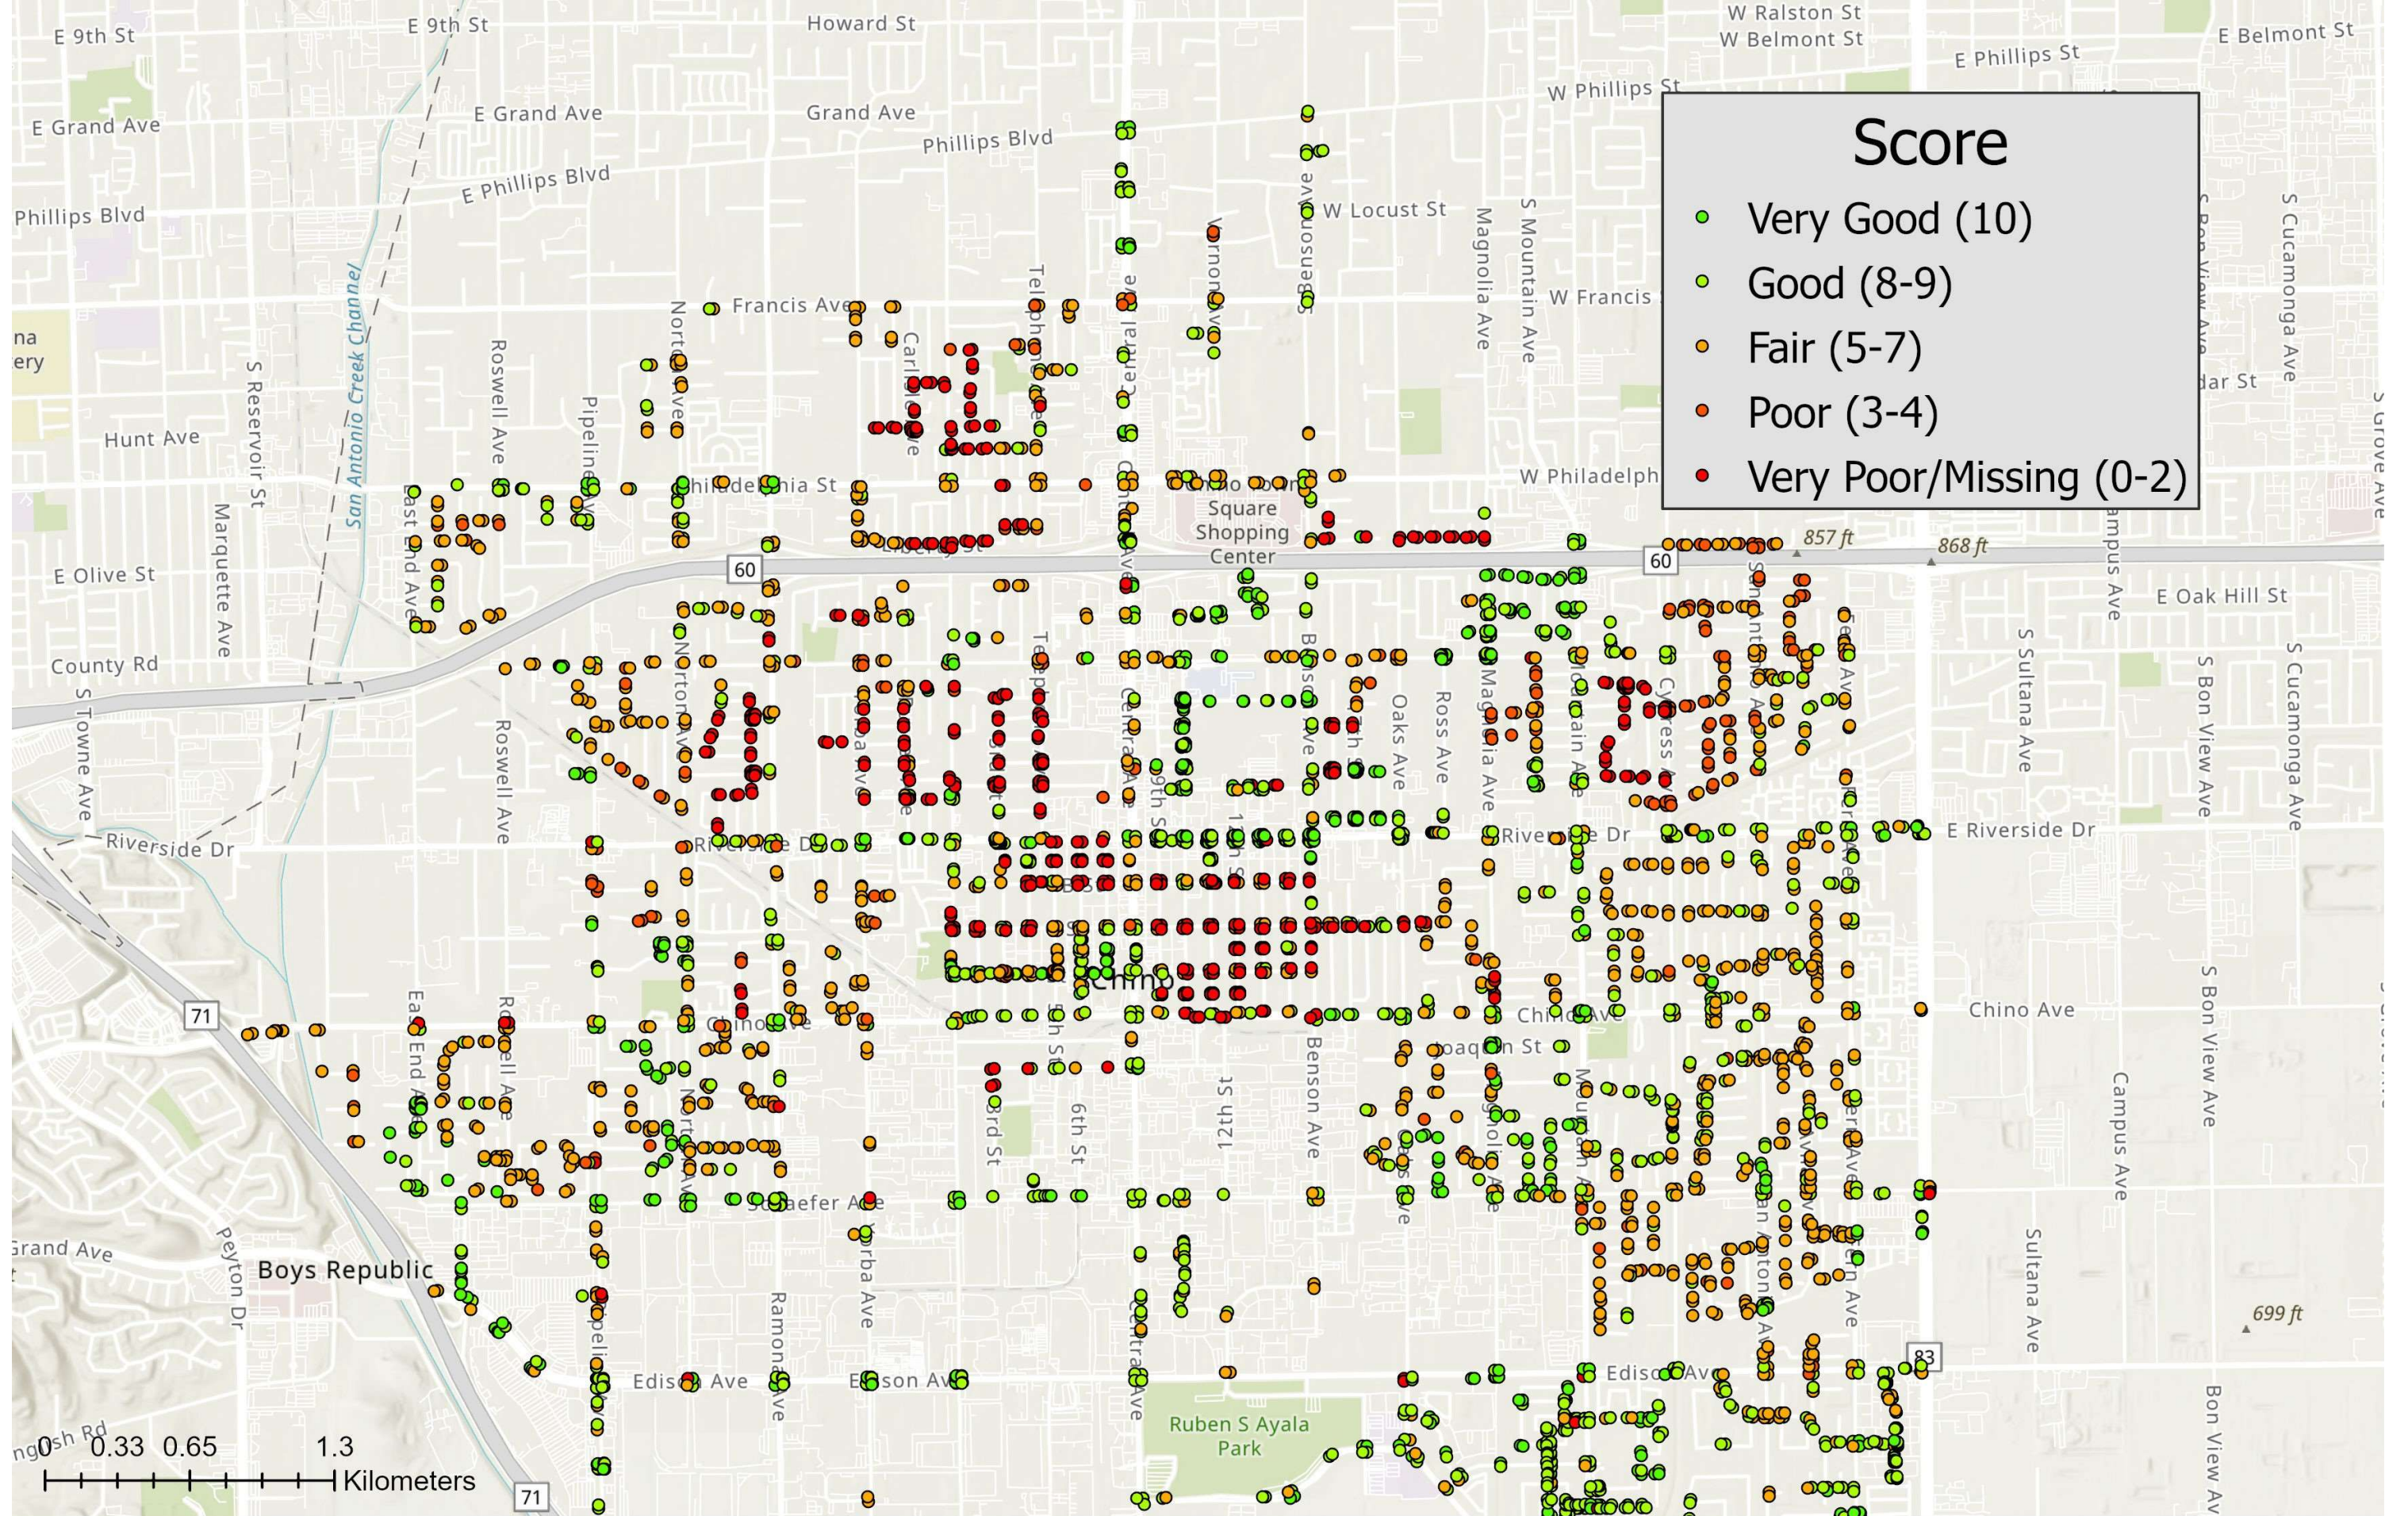

# Chino, CA Curb Ramp Evaluation-North

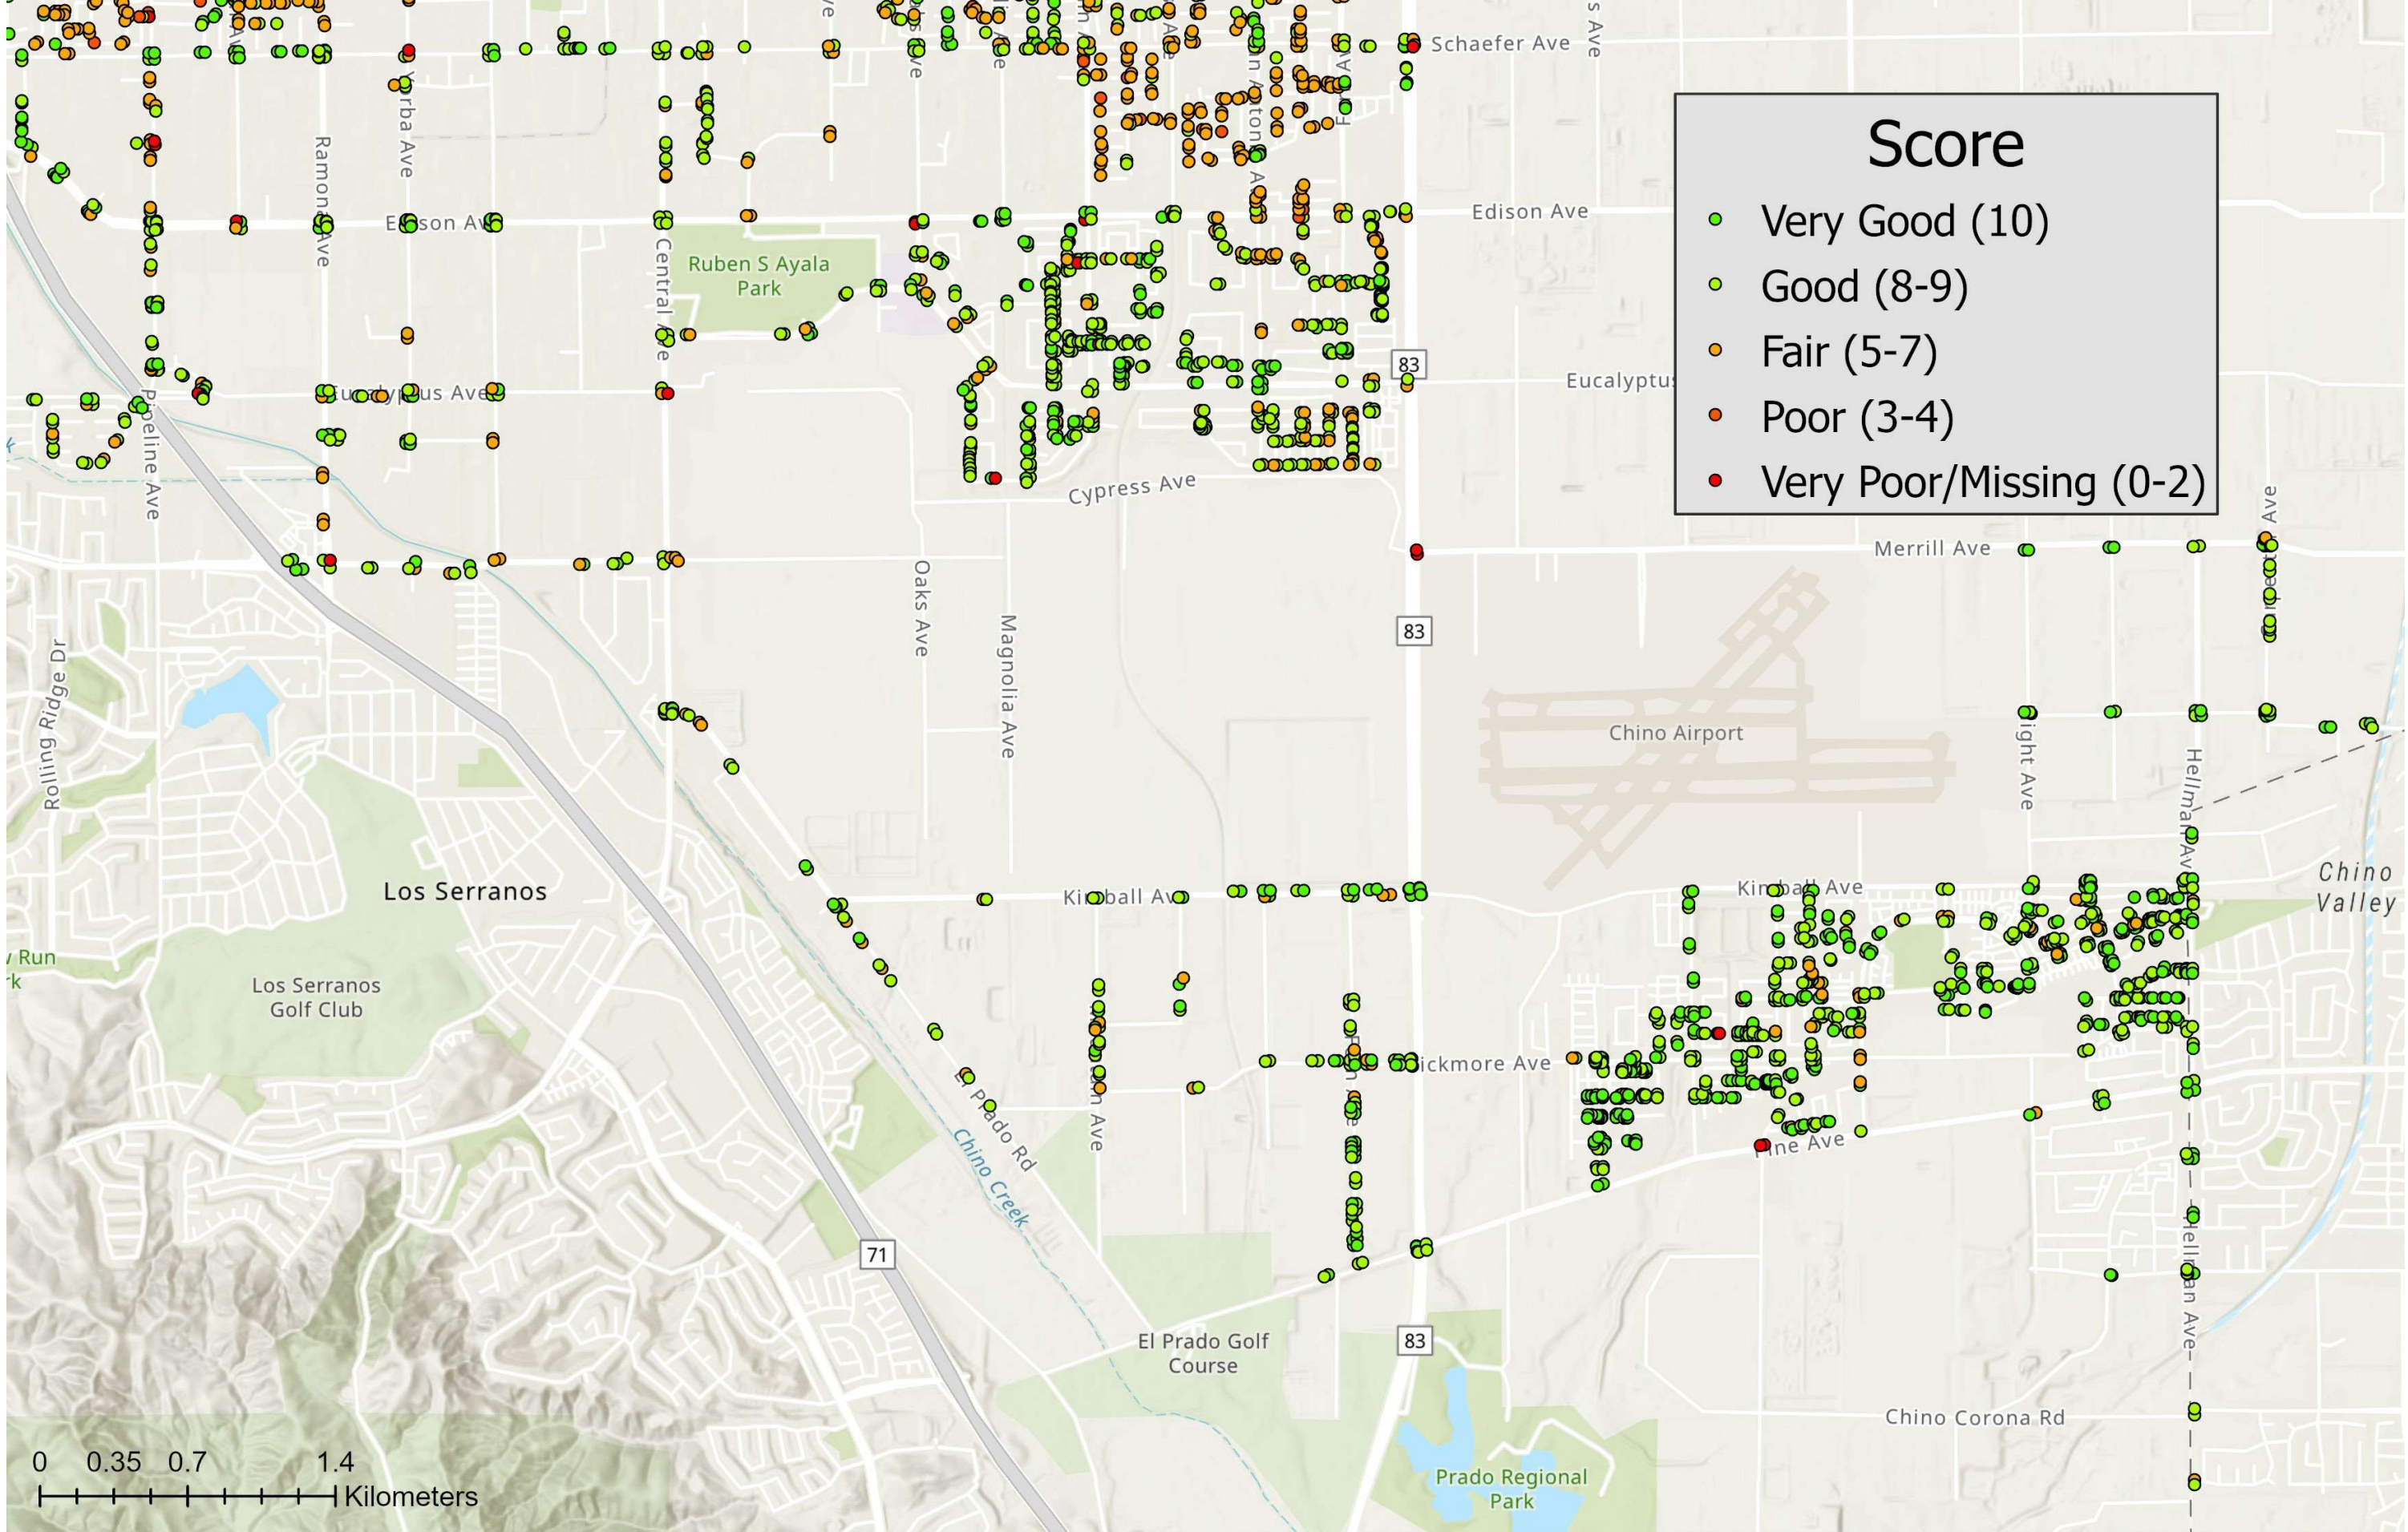

0 0.35 0.7 1.4  
Kilometers

# 076 Chino, CA Curb Ramp Evaluation-South

---

**APPENDIX G:  
CITY OF CHINO ACCESSIBILITY SURVEY**

---

## City of Chino - Accessibility Survey

### Question Title

1. Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

- Yes
- No

If yes, please describe

### Question Title

2. Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

- Yes
- No

### Question Title

3. Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

- Yes
- No

If yes, please describe the experience

### Question Title

4. Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

- Yes
- No

### Question Title

5. Which City buildings do you visit most often?

- 7th Street Theater
- Carolyn Owens Community Center
- Chaffey Business Office
- Chaffey College/Chino Center
- Chino Branch Library

- City Hall
- Community Building
- Family Services Center
- Fire Station #5 (Ramona Ave.)
- Fire Station #63 (Kimball Ave.)
- Fire Station #7 (Riverside Dr.)
- Fire Station No. 1 & Training Center Facility (Schaefer Ave.)
- Gray Building/Chamber of Commerce
- IT Center - Chaffey College
- Liberty Park Recreation Center
- Monte Vista Park Recreation Center/Teen Center
- Neighborhood Activity Center (NAC) Includes: Boxing Gym
- Old Schoolhouse Museum
- Owen's Bistro
- Police Station
- Preserve Community Center
- Public Works Services Center
- Senior Center
- Youth Museum

**Question Title**

6. Which City parks do you visit most often?

- 7th Street Park
- Aguiar Square
- Ayala Park
- Carolyn Owens Centennial Square
- Central Park
- Chino Community Building Park
- Chino Community Garden
- Classics Park
- Community Garden
- Constellation Park
- Cypress Trails Park
- Discovery Park
- Energy Park

- Evergreen Park
- Forest Park
- Founders Park
- Gallery Park
- Garden Park
- Golden Tree Park
- Harvest Park
- Heritage Park
- Hidden Hollow
- Inspiration Park
- Liberty Park
- Lotus Park
- McLeod Park
- Meridian Park - North
- Meridian Park - South
- Monte Vista Park
- Mountain View Park
- Mulberry Park
- Nature Retreat Park
- Olympic Park
- Oak Tree Square Park
- Sebring Park
- Secret Garden Park
- Senior Center
- Shady Grove Park
- Symphony Park
- Villa Park
- Walnut Park

**Question Title**

7. Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

1. Restrooms  
Move up Restrooms Move down Restrooms
2. Parking  
Move up Parking Move down Parking

- 3. Pathway / Sidewalk  
Move up Pathway / SidewalkMove down Pathway / Sidewalk
- 4. Building Entrance  
Move up Building EntranceMove down Building Entrance
- 5. Meeting Rooms  
Move up Meeting RoomsMove down Meeting Rooms

**Question Title**

8. Is the City of Chino's website and phone system accessible to you?

- Yes
- No

If no, what functions are not accessible to you?

**Question Title**

9. Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

- Yes
- No

**Question Title**

10. Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

- Yes
- No

If yes, please describe

**Question Title**

11. Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

- Yes
- No

If yes, please describe

**Question Title**

12. Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

- Yes
- No

**Question Title**

13. Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

- Yes
- No


**Question Title**

14. What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?



# Q1 Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?


Answered: 12 Skipped: 1

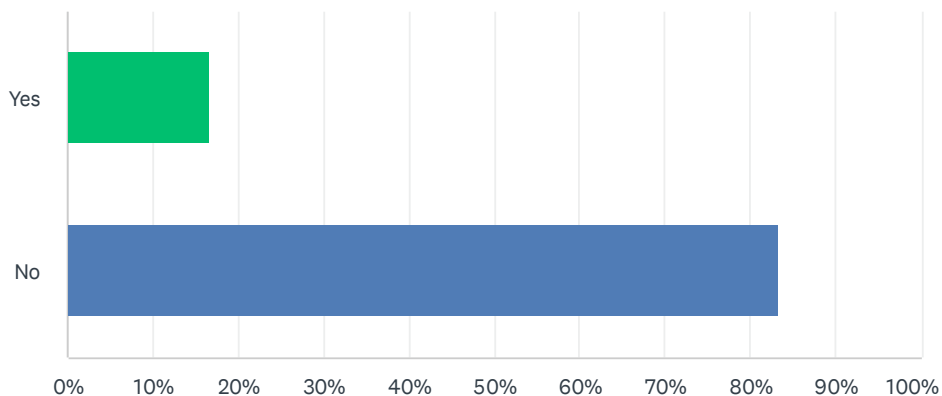

ANSWER CHOICES	RESPONSES	
Yes	16.67%	2
No	83.33%	10
TOTAL		12

## Q2 Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?


Answered: 12 Skipped: 1

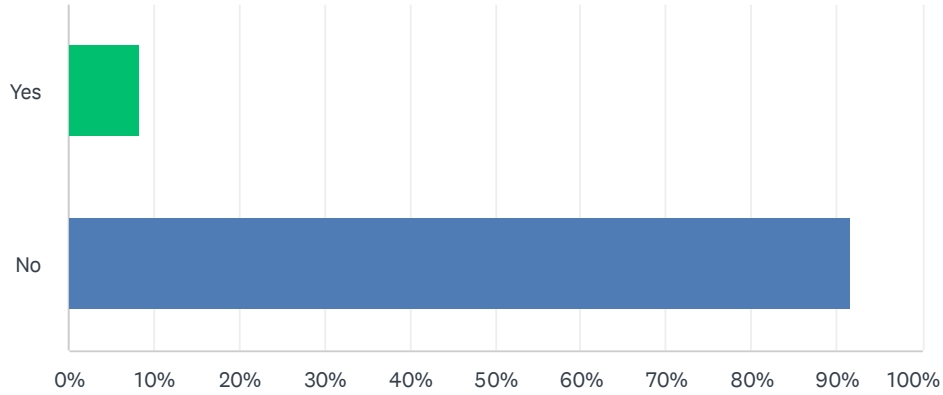

ANSWER CHOICES	RESPONSES
Yes	8.33% 1
No	91.67% 11
TOTAL	12

### Q3 Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?


Answered: 12 Skipped: 1

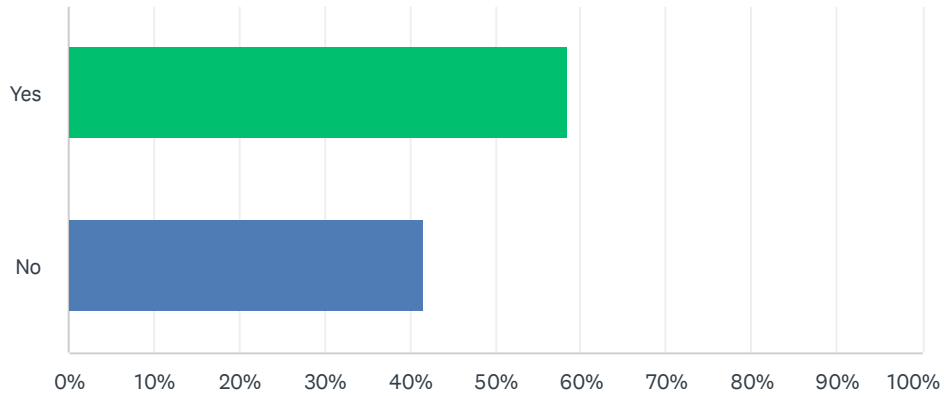

ANSWER CHOICES	RESPONSES	
Yes	58.33%	7
No	41.67%	5
TOTAL		12

### Q4 Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?


Answered: 12 Skipped: 1

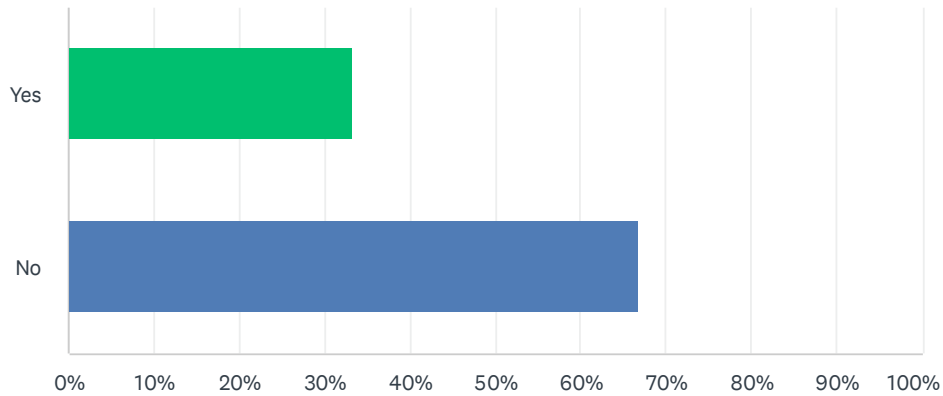


ANSWER CHOICES	RESPONSES	
Yes	33.33%	4
No	66.67%	8
TOTAL		12

## Q5 Which City buildings do you visit most often?

Answered: 9 Skipped: 4

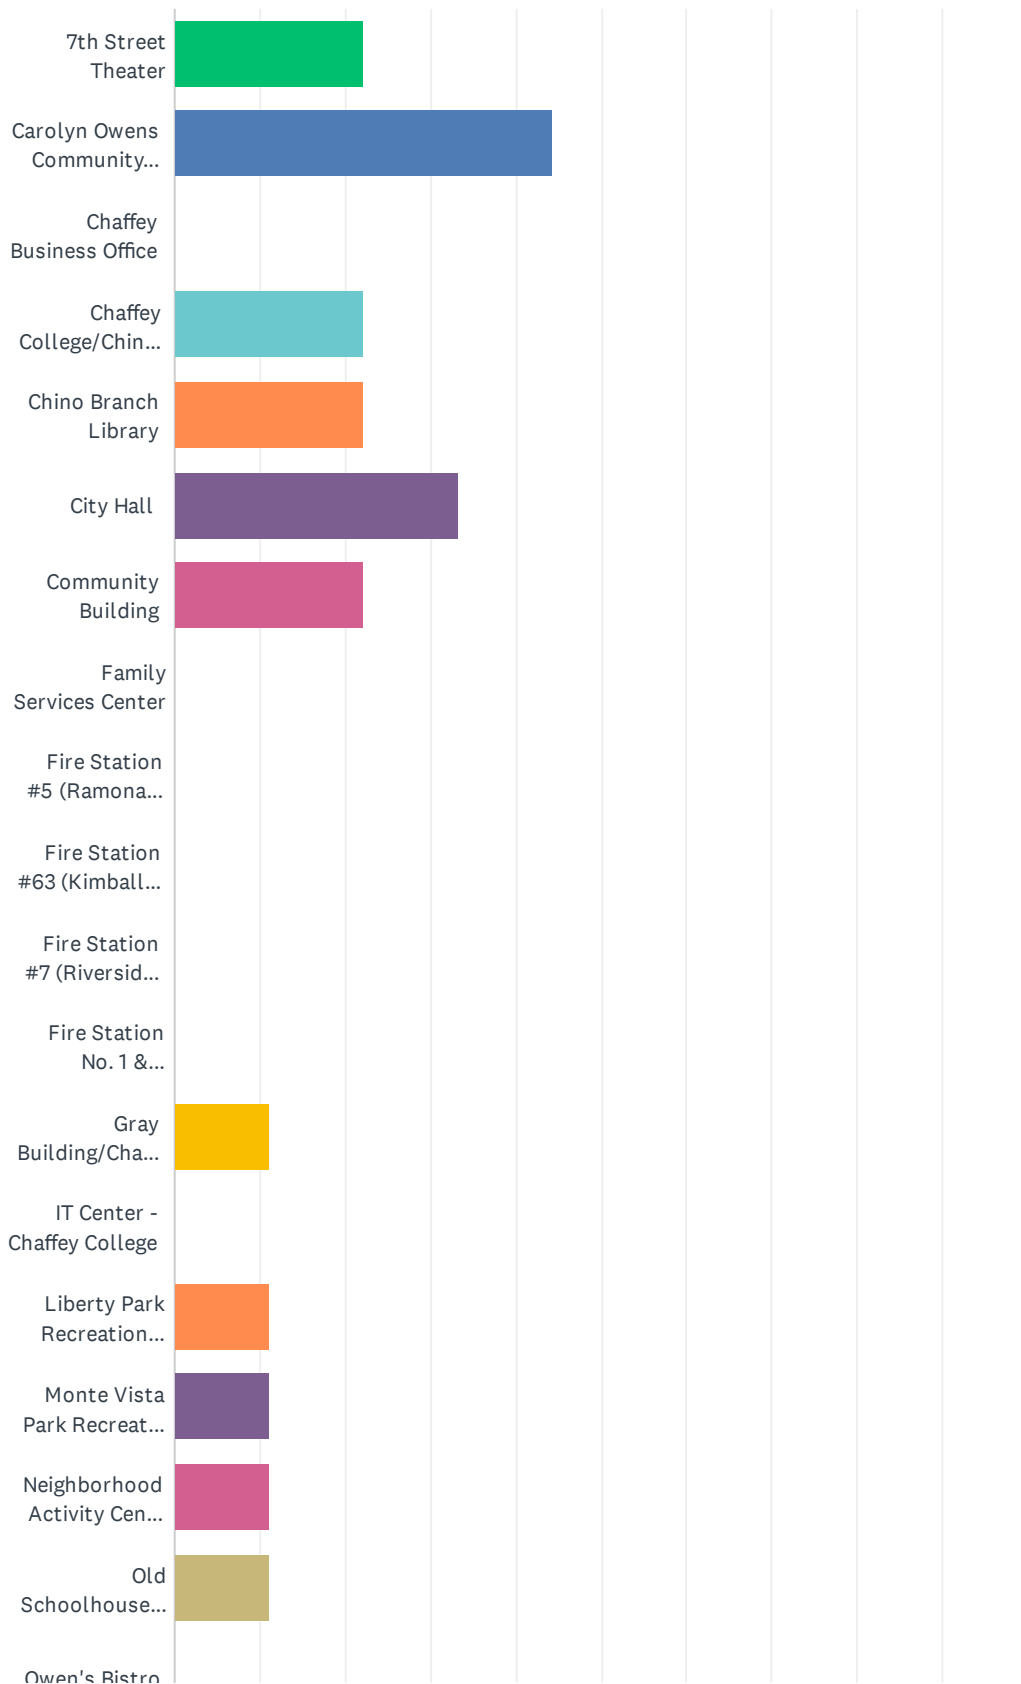

# City of Chino - Accessibility Survey

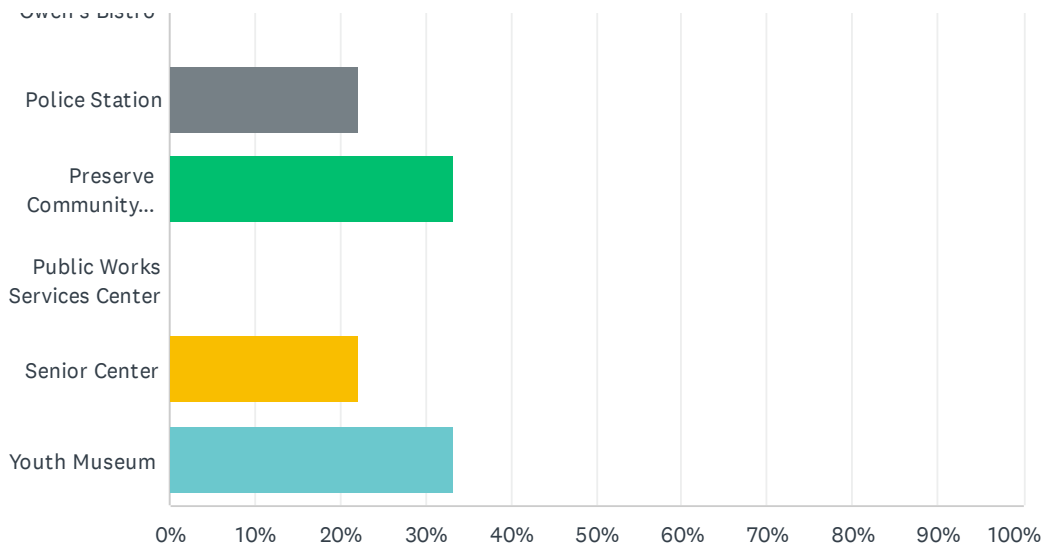


City of Chino - Accessibility Survey


ANSWER CHOICES	RESPONSES	
7th Street Theater	22.22%	2
Carolyn Owens Community Center	44.44%	4
Chaffey Business Office	0.00%	0
Chaffey College/Chino Center	22.22%	2
Chino Branch Library	22.22%	2
City Hall	33.33%	3
Community Building	22.22%	2
Family Services Center	0.00%	0
Fire Station #5 (Ramona Ave.)	0.00%	0
Fire Station #63 (Kimball Ave.)	0.00%	0
Fire Station #7 (Riverside Dr.)	0.00%	0
Fire Station No. 1 & Training Center Facility (Schaefer Ave.)	0.00%	0
Gray Building/Chamber of Commerce	11.11%	1
IT Center - Chaffey College	0.00%	0
Liberty Park Recreation Center	11.11%	1
Monte Vista Park Recreation Center/Teen Center	11.11%	1
Neighborhood Activity Center (NAC) Includes: Boxing Gym	11.11%	1
Old Schoolhouse Museum	11.11%	1
Owen's Bistro	0.00%	0
Police Station	22.22%	2
Preserve Community Center	33.33%	3
Public Works Services Center	0.00%	0
Senior Center	22.22%	2
Youth Museum	33.33%	3
Total Respondents: 9		

## Q6 Which City parks do you visit most often?


Answered: 11 Skipped: 2

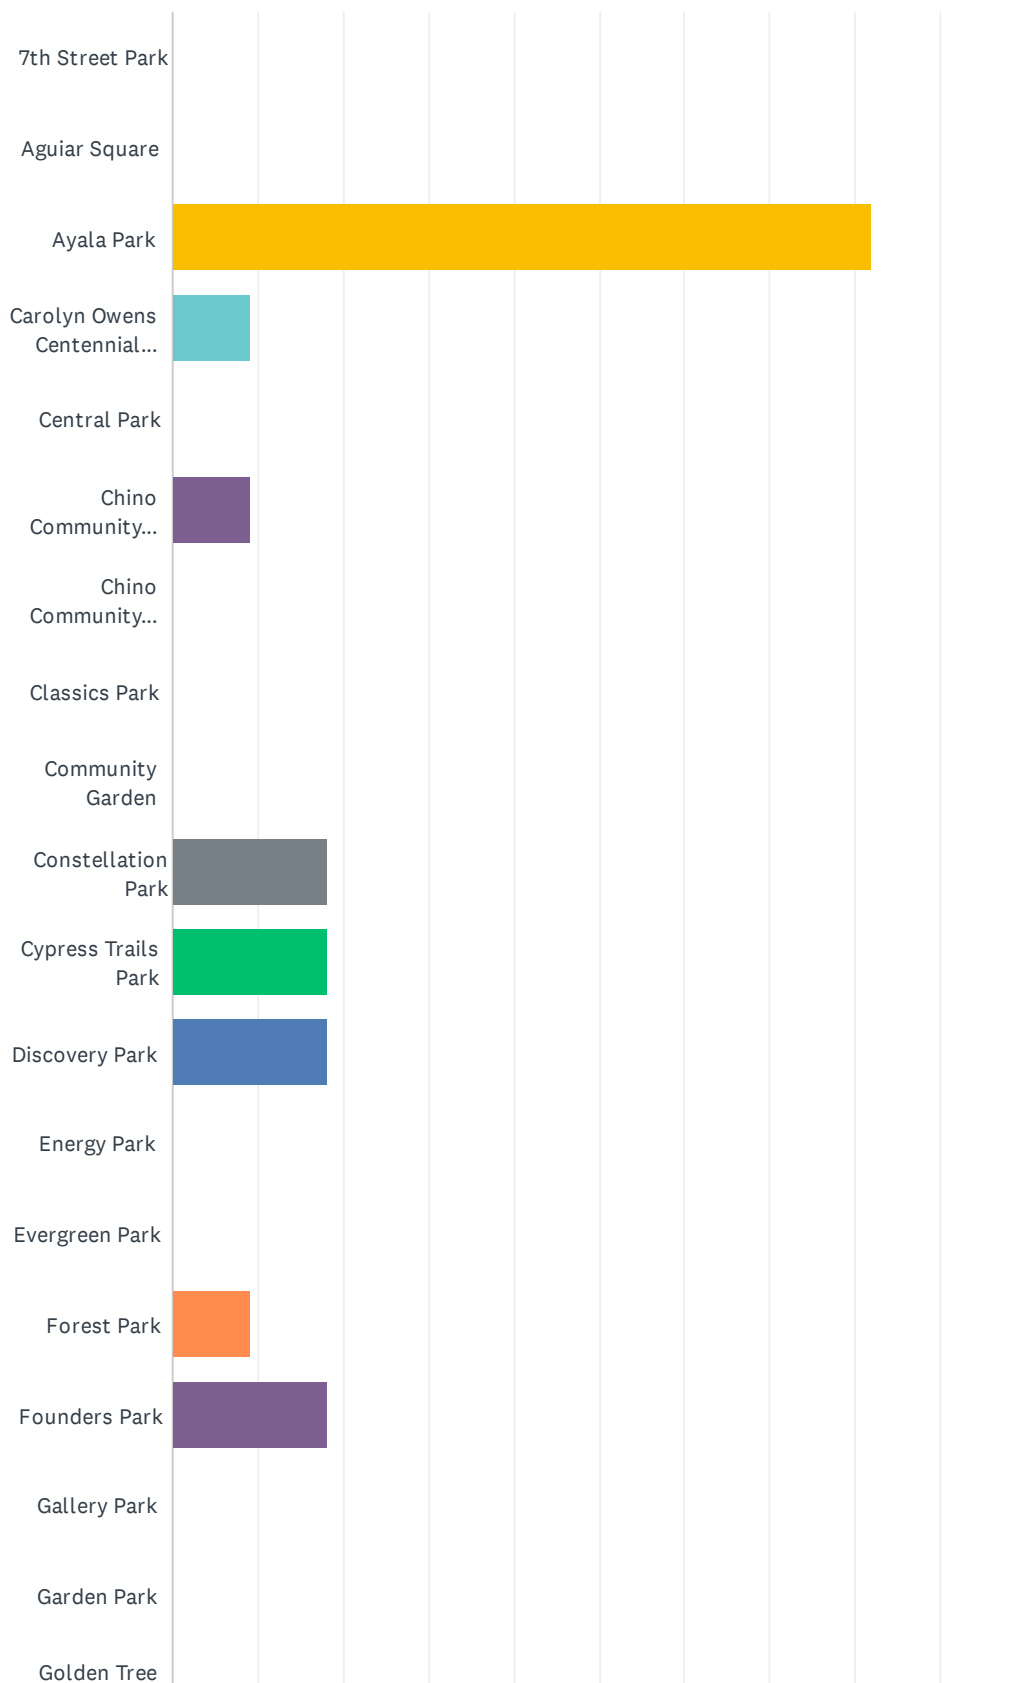

# City of Chino - Accessibility Survey

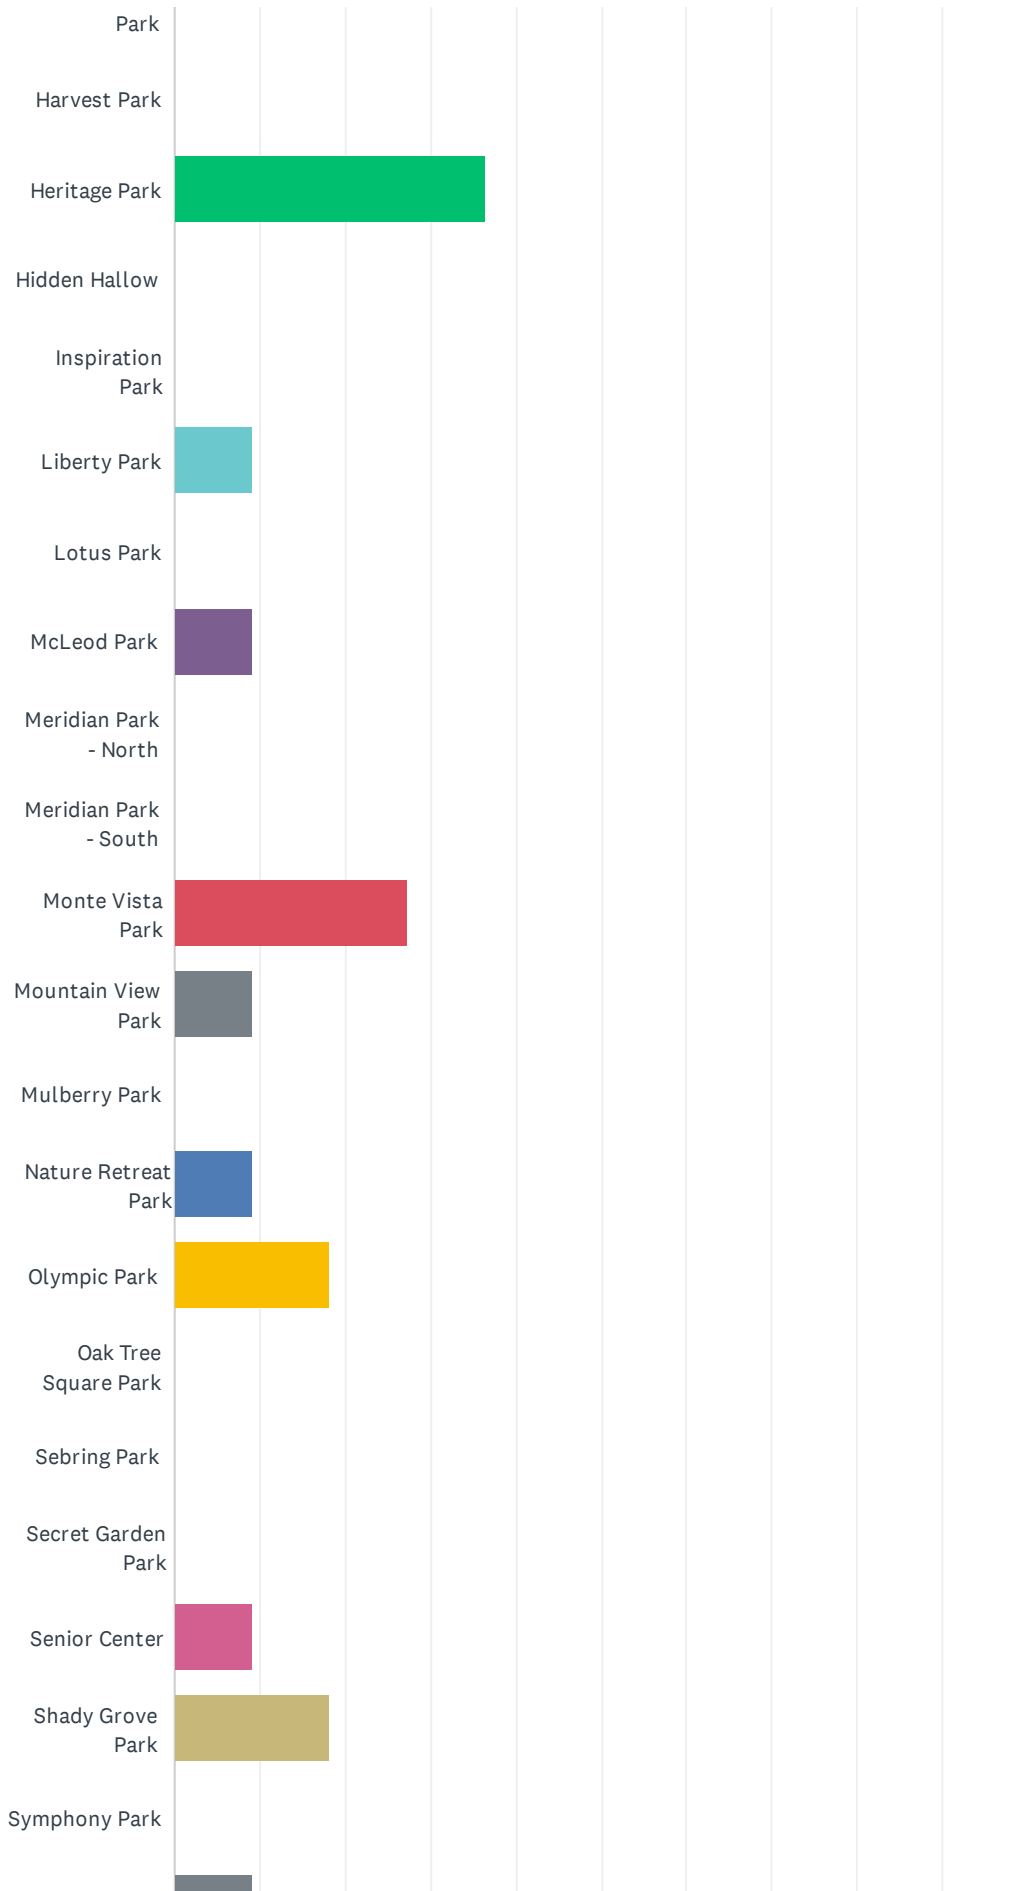

# City of Chino - Accessibility Survey

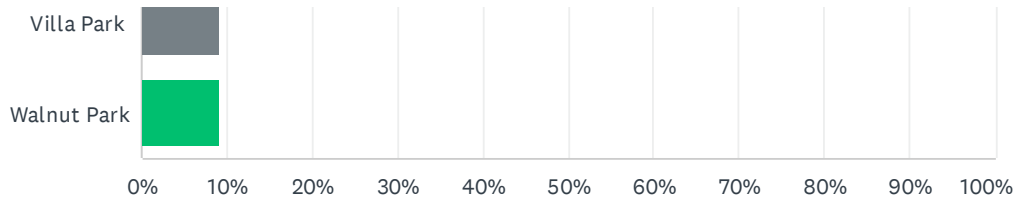

City of Chino - Accessibility Survey


ANSWER CHOICES	RESPONSES	
7th Street Park	0.00%	0
Aguiar Square	0.00%	0
Ayala Park	81.82%	9
Carolyn Owens Centennial Square	9.09%	1
Central Park	0.00%	0
Chino Community Building Park	9.09%	1
Chino Community Garden	0.00%	0
Classics Park	0.00%	0
Community Garden	0.00%	0
Constellation Park	18.18%	2
Cypress Trails Park	18.18%	2
Discovery Park	18.18%	2
Energy Park	0.00%	0
Evergreen Park	0.00%	0
Forest Park	9.09%	1
Founders Park	18.18%	2
Gallery Park	0.00%	0
Garden Park	0.00%	0
Golden Tree Park	0.00%	0
Harvest Park	0.00%	0
Heritage Park	36.36%	4
Hidden Hallow	0.00%	0
Inspiration Park	0.00%	0
Liberty Park	9.09%	1
Lotus Park	0.00%	0
McLeod Park	9.09%	1
Meridian Park - North	0.00%	0
Meridian Park - South	0.00%	0
Monte Vista Park	27.27%	3
Mountain View Park	9.09%	1
Mulberry Park	0.00%	0
Nature Retreat Park	9.09%	1

## City of Chino - Accessibility Survey

Olympic Park	18.18%	2
Oak Tree Square Park	0.00%	0
Sebring Park	0.00%	0
Secret Garden Park	0.00%	0
Senior Center	9.09%	1
Shady Grove Park	18.18%	2
Symphony Park	0.00%	0
Villa Park	9.09%	1
Walnut Park	9.09%	1
Total Respondents: 11		

### Q7 Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:


Answered: 13 Skipped: 0

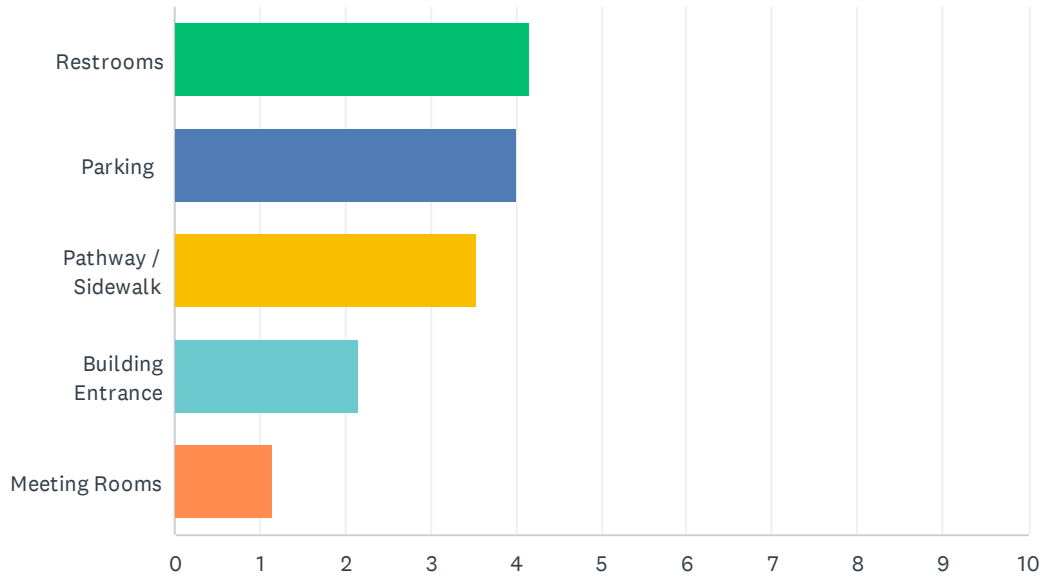

	1	2	3	4	5	TOTAL	SCORE
Restrooms	53.85% 7	23.08% 3	7.69% 1	15.38% 2	0.00% 0	13	4.15
Parking	15.38% 2	69.23% 9	15.38% 2	0.00% 0	0.00% 0	13	4.00
Pathway / Sidewalk	30.77% 4	7.69% 1	46.15% 6	15.38% 2	0.00% 0	13	3.54
Building Entrance	0.00% 0	0.00% 0	23.08% 3	69.23% 9	7.69% 1	13	2.15
Meeting Rooms	0.00% 0	0.00% 0	7.69% 1	0.00% 0	92.31% 12	13	1.15

## Q8 Is the City of Chino’s website and phone system accessible to you?


Answered: 12 Skipped: 1

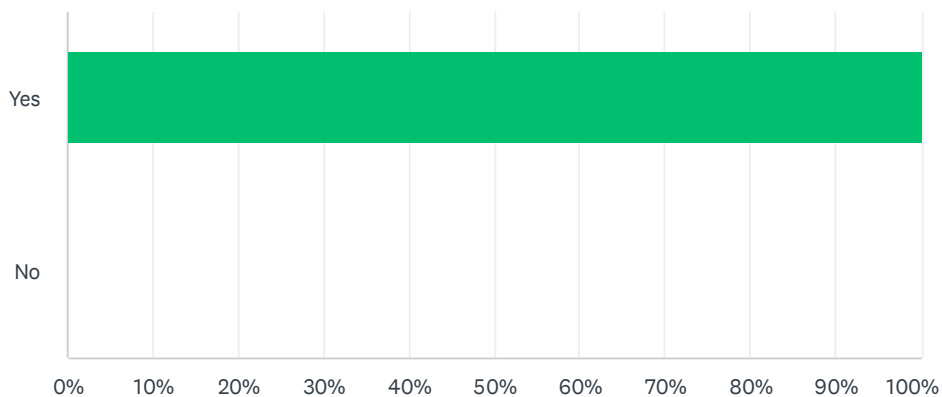

ANSWER CHOICES	RESPONSES	
Yes	100.00%	12
No	0.00%	0
<b>TOTAL</b>		<b>12</b>

### Q9 Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?


Answered: 12 Skipped: 1

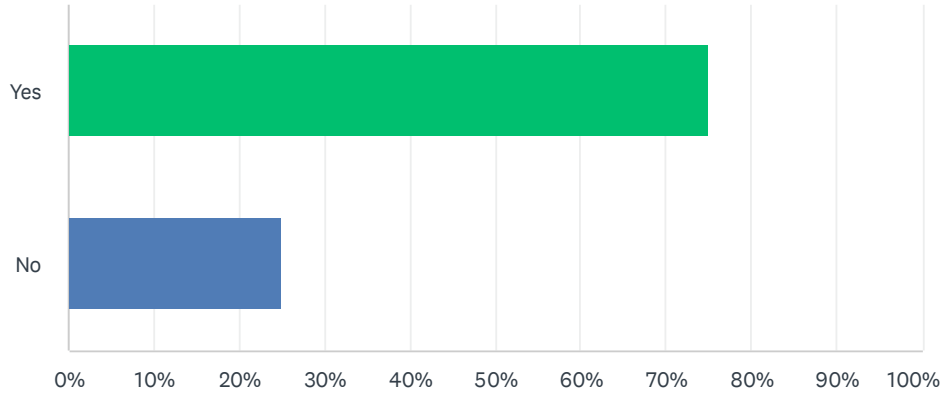

ANSWER CHOICES	RESPONSES	
Yes	75.00%	9
No	25.00%	3
TOTAL		12

### Q10 Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?


Answered: 13 Skipped: 0

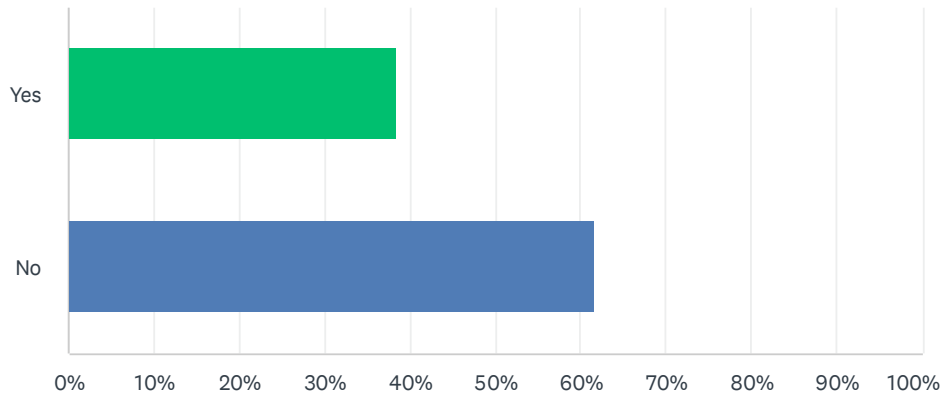

ANSWER CHOICES	RESPONSES	
Yes	38.46%	5
No	61.54%	8
<b>TOTAL</b>		<b>13</b>

### Q11 Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?


Answered: 12 Skipped: 1

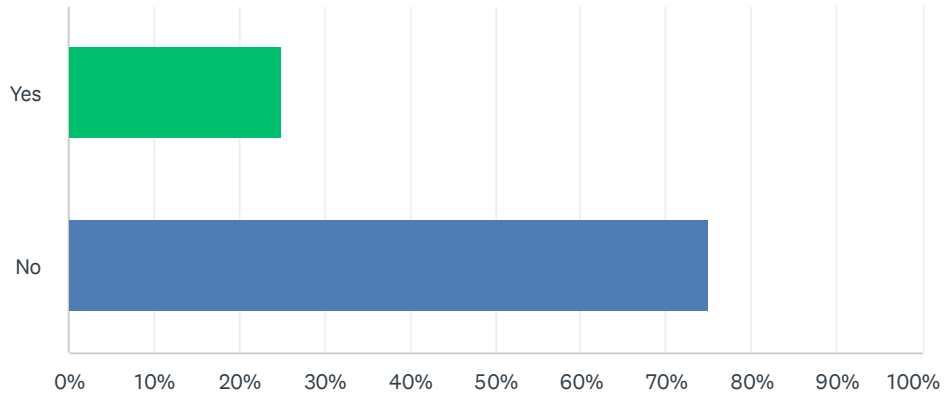

ANSWER CHOICES	RESPONSES	
Yes	25.00%	3
No	75.00%	9
TOTAL		12

## Q12 Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?


Answered: 12 Skipped: 1

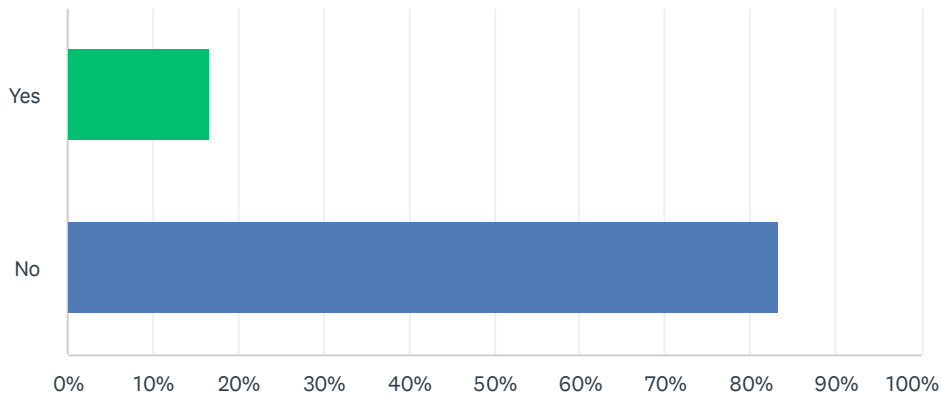

ANSWER CHOICES	RESPONSES	
Yes	16.67%	2
No	83.33%	10
<b>TOTAL</b>		<b>12</b>

### Q13 Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

Answered: 12 Skipped: 1

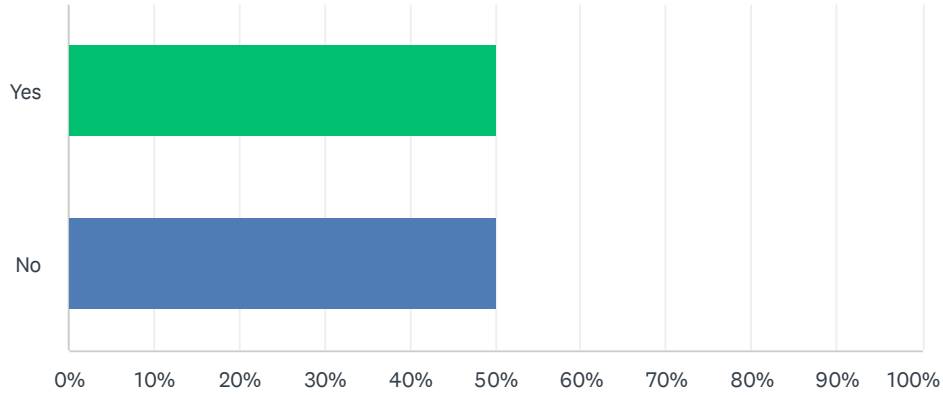

ANSWER CHOICES	RESPONSES	
Yes	50.00%	6
No	50.00%	6
<b>TOTAL</b>		<b>12</b>

**Q14 What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?**

Answered: 6 Skipped: 7

# #1

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Thursday, June 08, 2023 2:24:22 PM  
**Last Modified:** Thursday, June 08, 2023 2:26:42 PM  
**Time Spent:** 00:02:19

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

**Q2** **No**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

**Q3** **Yes,**  
If yes, please describe the experience:  
summer concert nights

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

**Q4** **No**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

**Q5** **Preserve Community Center,  
Youth Museum**

Which City buildings do you visit most often?

**Q6** **Discovery Park,  
Forest Park,  
Founders Park,  
Nature Retreat Park,  
Olympic Park,  
Shady Grove Park**

Which City parks do you visit most often?

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	1
Parking	2
Pathway / Sidewalk	3
Building Entrance	4
Meeting Rooms	5

---

**Q8** **Yes**

Is the City of Chino's website and phone system accessible to you?

---

**Q9** **Yes**

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10** **No**

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

---

**Q11** **No**

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12** **No**

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13** **No**

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

**Respondent skipped this question**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

---

## #2

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Thursday, June 08, 2023 4:06:15 PM  
**Last Modified:** Thursday, June 08, 2023 4:12:01 PM  
**Time Spent:** 00:05:45

---

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

---

**Q2** **Yes**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

---

**Q3** **Yes**

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

---

**Q4** **Yes**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

---

**Q5** **Chaffey College/Chino Center**

Which City buildings do you visit most often?

---

**Q6** **Ayala Park,  
Heritage Park**

Which City parks do you visit most often?

---

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	2
Parking	3
Pathway / Sidewalk	1
Building Entrance	4
Meeting Rooms	5

---

**Q8** Yes

Is the City of Chino's website and phone system accessible to you?

---

**Q9** No

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10** No

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

---

**Q11** No

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12** Yes

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13** Yes

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

We need more handicap spaces to park, it is also very important that all sideways are excusable for everyone, being in a wheelchair myself I find some walkways too small for my wheelchair. Bathrooms also need to be more accessible, toilet paper needs to be reachable for everyone. It is important that everyone is comfortable and considered when it comes to all programs, services & facilities.

---

# #3

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Saturday, June 10, 2023 12:12:59 PM  
**Last Modified:** Saturday, June 10, 2023 12:27:42 PM  
**Time Spent:** 00:14:42

---

Page 1

## Q1

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

**Yes,**

If yes, please describe:  
We have little for special needs children, and For things like concerts, car shows, and parades there are not enough handicap parking spots and restrooms so trying to bring someone in a wheelchair with oxygen is an overwhelming task for an aging caregiver.

---

## Q2

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

**No**

---

## Q3

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

**Yes,**

If yes, please describe the experience:  
Concerts in the park and parades.

---

## Q4

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

---

**Yes**

**Q5**

Which City buildings do you visit most often?

7th Street Theater,  
 Carolyn Owens Community Center,  
 Chaffey College/Chino Center,  
 Chino Branch Library,  
 City Hall,  
 Community Building,  
 Gray Building/Chamber of Commerce,  
 Liberty Park Recreation Center,  
 Police Station,  
 Senior Center,  
 Youth Museum

**Q6**

Which City parks do you visit most often?

Ayala Park,  
 Carolyn Owens Centennial Square,  
 Chino Community Building Park,  
 Constellation Park,  
 Cypress Trails Park,  
 Founders Park,  
 Heritage Park,  
 Liberty Park,  
 Monte Vista Park,  
 Mountain View Park,  
 Senior Center,  
 Shady Grove Park

**Q7**

Rate the following features of the City of Chino’s facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	2
Parking	1
Pathway / Sidewalk	4
Building Entrance	3
Meeting Rooms	5

**Q8** **Yes**

Is the City of Chino's website and phone system accessible to you?

---

**Q9** **Yes**

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10** **No**

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

---

**Q11** **No**

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12** **No**

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13** **No**

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

More handicap parking, and a playground or miniature golf course designed for children and adults with physical and mental disabilities,

---

# #4

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Wednesday, June 21, 2023 11:27:24 PM  
**Last Modified:** Wednesday, June 21, 2023 11:42:57 PM  
**Time Spent:** 00:15:32

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

**Q2** **No**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

**Q3** **Yes,**  
If yes, please describe the experience:  
baseball

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

**Q4** **Yes**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

**Q5** **Preserve Community Center**

Which City buildings do you visit most often?

**Q6** **Ayala Park,**  
**Constellation Park**

Which City parks do you visit most often?

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	<b>3</b>
Parking	<b>2</b>
Pathway / Sidewalk	<b>1</b>
Building Entrance	<b>4</b>
Meeting Rooms	<b>5</b>

---

**Q8** **Yes**

Is the City of Chino's website and phone system accessible to you?

---

**Q9** **No**

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10** **Yes,**  
If yes, please describe:  
eucalyptus ave and purdue

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

---

**Q11** **Yes,**  
If yes, please describe:  
some sidewalks are in disrepair or don't have a ramp. also, there isn't disability parking in some city neighborhoods.

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12** **Yes**

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13** **Yes**

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

n/a

---

# #5

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Saturday, July 08, 2023 11:30:41 PM  
**Last Modified:** Saturday, July 08, 2023 11:33:33 PM  
**Time Spent:** 00:02:51

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

**Q2** **No**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

**Q3** **Yes**

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

**Q4** **No**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

**Q5** **Carolyn Owens Community Center,**  
 Which City buildings do you visit most often? **City Hall,**  
**Community Building,**  
**Neighborhood Activity Center (NAC) Includes: Boxing**  
**Gym**  
**,**  
**Old Schoolhouse Museum,**  
**Police Station,**  
**Preserve Community Center,**  
**Senior Center,**  
**Youth Museum**

**Q6**

Which City parks do you visit most often?

**Ayala Park,**  
**Discovery Park,**  
**Heritage Park,**  
**Monte Vista Park,**  
**Olympic Park**

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	<b>1</b>
Parking	<b>2</b>
Pathway / Sidewalk	<b>3</b>
Building Entrance	<b>4</b>
Meeting Rooms	<b>5</b>

**Q8**

Is the City of Chino's website and phone system accessible to you?

**Yes**

**Q9**

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

**Yes**

**Q10**

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

**Yes**

**Q11**

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

**No**

**Q12**

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

**No**

**Q13**

**Yes**

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

**Respondent skipped this question**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

---

# #6

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Wednesday, July 12, 2023 8:36:15 PM  
**Last Modified:** Wednesday, July 12, 2023 8:47:45 PM  
**Time Spent:** 00:11:29

Page 1

**Q1** **No**  
 Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

**Q2** **No**  
 Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

**Q3** **Yes,**  
 If yes, please describe the experience:  
 Concerts in the park, need more ADA seating access  
 Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

**Q4** **No**  
 Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

**Q5** **Carolyn Owens Community Center,  
 Monte Vista Park Recreation Center/Teen Center**  
 Which City buildings do you visit most often?

**Q6** **Ayala Park,  
 Heritage Park,  
 Monte Vista Park,  
 Villa Park**  
 Which City parks do you visit most often?

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	2
Parking	1
Pathway / Sidewalk	3
Building Entrance	4
Meeting Rooms	5

---

**Q8**

**Yes**

Is the City of Chino's website and phone system accessible to you?

---

**Q9**

**Yes**

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10**

**Yes,**

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

If yes, please describe:

Corner of 3rd and Bst, across from adult school. There is no ADA curbi ramps on any corner.

---

**Q11**

**Yes,**

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

If yes, please describe:

Adult school

---

**Q12**

**No**

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13**

**Yes**

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

Just ADA curbing and ramps where needed, not on corners where there are no sidewalks Schaffer, Edison, Ramona south of Chino Ave.

---

# #7

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Wednesday, July 12, 2023 9:02:48 PM  
**Last Modified:** Wednesday, July 12, 2023 9:05:39 PM  
**Time Spent:** 00:02:51

---

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

---

**Q2** **No**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

---

**Q3** **No**

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

---

**Q4** **No**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

---

**Q5** **City Hall**

Which City buildings do you visit most often?

---

**Q6** **Walnut Park**

Which City parks do you visit most often?

---

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	1
Parking	2
Pathway / Sidewalk	3
Building Entrance	4
Meeting Rooms	5

---

**Q8** Yes

Is the City of Chino's website and phone system accessible to you?

---

**Q9** Yes

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10** No

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

---

**Q11** No

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12** No

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13** No

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

**Respondent skipped this question**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

---

# #8

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Wednesday, July 12, 2023 10:00:53 PM  
**Last Modified:** Wednesday, July 12, 2023 10:10:22 PM  
**Time Spent:** 00:09:28

---

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

---

**Q2** **No**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

---

**Q3** **No**

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

---

**Q4** **No**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

---

**Q5** **7th Street Theater**

Which City buildings do you visit most often?

---

**Q6** **Ayala Park**

Which City parks do you visit most often?

---

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	1
Parking	2
Pathway / Sidewalk	4
Building Entrance	5
Meeting Rooms	3

---

**Q8** Yes

Is the City of Chino's website and phone system accessible to you?

---

**Q9** Yes

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10** No

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

---

**Q11** No

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12** No

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13** No

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

None

---

# #9

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Thursday, July 13, 2023 3:16:59 PM  
**Last Modified:** Thursday, July 13, 2023 3:19:44 PM  
**Time Spent:** 00:02:44

---

Page 1

**Q1** **Respondent skipped this question**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

---

**Q2** **Respondent skipped this question**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

---

**Q3** **Respondent skipped this question**

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

---

**Q4** **Respondent skipped this question**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

---

**Q5** **Respondent skipped this question**

Which City buildings do you visit most often?

---

**Q6** **Respondent skipped this question**

Which City parks do you visit most often?

---

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	1
Parking	2
Pathway / Sidewalk	3
Building Entrance	4
Meeting Rooms	5

---

**Q8**

Respondent skipped this question

Is the City of Chino's website and phone system accessible to you?

---

**Q9**

Respondent skipped this question

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10**

Yes,

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

If yes, please describe:

There is no disability sidewalk access on the corner of Sherman and Cypress

---

**Q11**

Respondent skipped this question

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12**

Respondent skipped this question

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13**

Respondent skipped this question

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

**Respondent skipped this question**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

---

# #10

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Thursday, July 13, 2023 4:47:37 PM  
**Last Modified:** Thursday, July 13, 2023 4:51:15 PM  
**Time Spent:** 00:03:38

---

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

---

**Q2** **No**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

---

**Q3** **No**

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

---

**Q4** **No**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

---

**Q5** **Respondent skipped this question**

Which City buildings do you visit most often?

---

**Q6** **Ayala Park**

Which City parks do you visit most often?

---

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	1
Parking	2
Pathway / Sidewalk	3
Building Entrance	4
Meeting Rooms	5

---

**Q8** Yes

Is the City of Chino's website and phone system accessible to you?

---

**Q9** No

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10** No

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

---

**Q11** No

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12** No

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13** No

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

**Respondent skipped this question**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

---

# #11

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Friday, July 14, 2023 5:57:24 PM  
**Last Modified:** Friday, July 14, 2023 6:00:46 PM  
**Time Spent:** 00:03:21

---

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

---

**Q2** **No**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

---

**Q3** **Yes,**  
If yes, please describe the experience:  
Ayala park

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

---

**Q4** **No**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

---

**Q5** **Respondent skipped this question**

Which City buildings do you visit most often?

---

**Q6** **Ayala Park**

Which City parks do you visit most often?

---

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	<b>4</b>
Parking	<b>2</b>
Pathway / Sidewalk	<b>1</b>
Building Entrance	<b>3</b>
Meeting Rooms	<b>5</b>

---

**Q8** **Yes**

Is the City of Chino's website and phone system accessible to you?

---

**Q9** **Yes**

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10** **No**

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

---

**Q11** **No**

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12** **No**

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13** **No**

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

**Respondent skipped this question**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

---

# #12

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Saturday, July 15, 2023 5:32:52 PM  
**Last Modified:** Saturday, July 15, 2023 5:36:38 PM  
**Time Spent:** 00:03:46

Page 1

**Q1** **Yes,**  
 Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability? **If yes, please describe:**  
 Local parks make it difficult for my son to enjoy the playground

**Q2** **No**  
 Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

**Q3** **No**  
 Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

**Q4** **Yes**  
 Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

**Q5** **Carolyn Owens Community Center,**  
 Which City buildings do you visit most often? **Chino Branch Library**

**Q6** **Ayala Park,**  
 Which City parks do you visit most often? **Cypress Trails Park,**  
**McLeod Park**

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	4
Parking	2
Pathway / Sidewalk	1
Building Entrance	3
Meeting Rooms	5

**Q8** Yes

Is the City of Chino's website and phone system accessible to you?

**Q9** Yes

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

**Q10** No

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

**Q11** Yes

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

**Q12** No

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

**Q13** Yes

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

**Q14**

**Respondent skipped this question**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

---

# #13

**COMPLETE**

**Collector:** Web Link 1 (Web Link)  
**Started:** Friday, July 28, 2023 3:08:14 AM  
**Last Modified:** Friday, July 28, 2023 3:17:27 AM  
**Time Spent:** 00:09:13

Page 1

**Q1** **No**

Are there programs or activities sponsored by the City of Chino, or facilities owned by the City of Chino, that you or someone you know cannot participate in or enjoy because of a disability?

**Q2** **No**

Have you encountered any communication barriers within a City of Chino facility or park which prevented you from utilizing or participating in a program, service, or activity?

**Q3** **No**

Have you participated in a program, activity or visited a City of Chino facility or park that you particularly enjoyed?

**Q4** **No**

Do you or someone you know require visual interpretive services or assisted listening systems at the City of Chino's programs or public meetings?

**Q5** **Respondent skipped this question**

Which City buildings do you visit most often?

**Q6** **Respondent skipped this question**

Which City parks do you visit most often?

**Q7**

Rate the following features of the City of Chino's facilities in order of importance to you from 1 to 5, with the most important as 1:

Restrooms	<b>1</b>
Parking	<b>3</b>
Pathway / Sidewalk	<b>2</b>
Building Entrance	<b>4</b>
Meeting Rooms	<b>5</b>

---

**Q8**

**Yes**

Is the City of Chino's website and phone system accessible to you?

---

**Q9**

**Yes**

Do you feel that the City of Chino provides adequate emergency response services to assist citizens with disabilities?

---

**Q10**

**Yes,**

Have you encountered street or intersection crossings near a city building or park where missing or inoperable pedestrian crossing push buttons affect your ability to cross the street?

If yes, please describe:

Crosswalks by the overpass by central exit are not safe enough or ada accessible

---

**Q11**

**No**

Do you have difficulty accessing city parks, buildings, or schools due to inaccessibility of public sidewalks or curb ramps?

---

**Q12**

**No**

Have you encountered inaccessible conditions at public transit stops, including adjacent sidewalks?

---

**Q13**

**Yes**

Have you experienced physical barriers to accessibility on a public pedestrian circulation path, such as broken / damaged concrete, missing curb ramp(s)?

---

**Q14**

What program, activity or facility improvements would promote accessibility to the City of Chino's programs, services, and facilities?

Swimming lessons for special needs

Local transportation for young adults with special needs. Job opportunities and programs. Housing assistance.

---

---

**APPENDIX H:  
CITY OF CHINO PROGRAMS AND SERVICES**

---

Ayala Park Operations Center, 5575 Edison Avenue

Hours: Monday-Friday 4:00-9:30 p.m. / Saturday-Sunday, 11:00 a.m.-9:30 p.m. (Varies: Open during rental hours.)

Activity	Description	Age
Co-Ed Soccer League	Each season consists of 8-10 games. Rosters are limited to 7 with no maximum players. There must be a minimum of 2 female players on the field at all times.	All
Women's Soccer League	The league consists of two divisions, Division A (18 & over) and Division B (30 & over). Each season consists of 8-10 games. Rosters are limited to 11 with no maximum players.	18+
Batting Cages	9 cages, varying in speeds for softball, baseball, and slow-pitch softball. Individual tokens, blocks of 15, 30, or 60 minutes, can be purchased.	All
Field Rentals	Athletic fields: Softball/baseball fields #1-6, multi-purpose fields #10-15, and one artificial turfed football stadium. (Recognized youth sports organizations, residents, nonresidents, businesses, nonprofits, sports groups, and City of Chino internal rentals)	All

Carolyn Owens Community Center, 13201 Central Avenue

Hours: Monday-Friday 7:30 a.m.-8:00 p.m. / Saturday-Sunday (Varies: Open during rental hours.)

Activity	Description	Age
Step by Step Painting	Children will learn how to paint their very own beautiful landscape in this one-day workshop. This class focuses on using the famous Bob Ross wet-on-wet oil painting technique and is instructed with younger participants in mind.	7+
Young Rembrandts Elementary and Cartoon Drawing	Students will improve drawing skills, understanding concepts, increase art vocabulary, as well as create silly characters and story sequences that tell jokes	6-12
Yoga	This class is structured for beginners to intermediate and begins with breathing techniques, stretching poses, slight meditation, and ends with relaxation.	12+
Adult Karate	YSRK's systematic program is designed to enhance your fighting skills and condition your body. The drills are selected to specifically prepare your body for high performance delivery, build up your endurance, enhance your overall fitness, and increase your speed and power. All this will help you maintain a degree of readiness to defend yourself and develop a strong mental attitude.	14+
Karate for Youth	Learn the fundamentals of the martial arts in a fun, but effective atmosphere. Participants will develop motor skills, coordination, self-esteem, and discipline. All levels of instruction are offered	5-13
Kinder Karate Champs	The goal is to develop listening skills, gross and fine motor skills, respect for parents and teachers, self-control, stranger awareness, and the ability to work with other children.	2-5
Tiny Tots	In the Tiny Tots program children learn to share, make choices, and follow directions through creative play in a recreational setting. All children must be potty trained.	3-4
Tiny Tots	In the Tiny Tots program children learn to share, make choices, and follow directions through creative play in a recreational setting. All children must be potty trained.	4-5
Basic CPR & AED	You can save a life! Learn the basic skills that can sustain life, while professional emergency help is on the way. Certifications are issued to passing students only and are valid for two years after the issue date.	13+
CPR/AED/First Aid	Learn to save a life and become certified in CPR, AED, and First Aid. This course teaches participants the critical skills needed to respond and manage an emergency in the first few minutes until EMS takes over.	13+
Facility Rentals	Rooms are rented out for meetings and private activities.	
Homework Assistance Program	Students are provided homework assistance in all subjects.	5-18 y/olds
Little Learners	Children get a jump start in life with rhymes, knee bounces, and rhyme building activities designed to develop their language and motor skills.	1 month-5 y/old
Learning is Fun	Engaging songs, lots of movement, fun rhymes, motor skills, and hand-eye coordination activities.	1 month-5 y/old
AA Meetings	Room rental and meeting conducted by AA.	18+
Hawaiian Dance	Foundation of hula fundamentals focuses on dance discipline, proper body posture, movements, strengthening and conditioning.	4+
Pilates	Increased muscle strengthening and toning.	14+

Chaffey College Chino Community Center, 5890 College Park Avenue, Room 208

Hours: Open when programs are in session.

Activity	Description	Age
Facility Rental	Rent room for private meetings and functions.	

Chaffey College Downtown Center, Room #103

Hours: Open when programs are in session.

Activity	Description	Age
Engineering FUNdamentals with LEGO®	Let your imagination run wild with tens of thousands of LEGO®! Build engineer-designed projects such as boats, bridges, mazes and motorized cars, and use special pieces to create your own unique design! Explore the endless creative possibilities of the LEGO® building system with the guidance of an experienced Play-Well instructor.	5-12
Mine, Craft, Build: Adventure Game using LEGO®	Bring Minecraft to life using LEGO®! Resourcefulness, creativity, and cooperation come together in this unique adventure game; roll the dice to mine for resources, craft tools, and watch out for Creepers! This ultimate LEGO® Minecraft experience is an original game designed by Play-Well instructors, using gameplay elements and characters inspired by the popular Minecraft video game. Students will have a blast, even without any prior experience with Minecraft or LEGO®.	5-12
Meeting Room	Staff meetings and trainings	
Private Rentals	Rent room for private meetings and functions	

Chino Youth Museum, 13191 6<sup>th</sup> Street, Chino, CA 91710

Hours: Wednesday-Saturday, 10:00 a.m.-4:00 p.m. / Summer Hours: Tuesday-Saturday, 10:00 a.m.-4:00 p.m./ Sunday for Private Parties / Closed Monday-Tuesday, except in Summer

Activity	Description	Age
First Friday 3-5 p.m.	First Friday events at the Chino Youth Museum are filled STEAM CYM Lab activities, exhibit time, and snacks. This FREE event is the perfect opportunity to spend an adventurous afternoon of learning and exploring our Museum exhibits. Not July or December.	All
Kid's Night Out 6-9 p.m.	Participants can enjoy a fun Saturday evening at the Museum, while parents enjoy a nice evening out. The night's activities are themed around a book or novelty theme and include art projects and games. Participants make their own dinner, under the supervision of our caring staff. 3 <sup>rd</sup> Saturday of the Month.	4-10
Photos with the Bunny 10:30 a.m.-1:00 p.m.	Join the Easter Bunny for Easter crafts, games, and a private 15-minute photo session for children and family. Children also get to explore the Museum exhibits. The Thursday before Easter.	3+
Letter Learners 10:30 a.m.	Children explore the alphabet through staff-led storytime and an alphabet craft. Weekly on Wednesdays; except Summer.	2+
Tunes & Tales 1:00 p.m.	Themed staff-led storytime and dancing. Weekly on Wednesdays.	5+
Beat the Heat 1:00 p.m.	Children will make new friends as they enjoy summer games, art projects, and "cool" activities. Activities vary each week and may involve light water play. Summer program Tuesdays.	3-12
Dr. Moo's Silly Science 1:00 p.m.	Explore, discover, experiment, & more! Participants have fun learning about the world around them through hands-on experiments! Summer program Thursdays: additional fee required: \$3 members, \$5 public.	3-12
Play Partners On Hold (Might resume in Fall) 5-7:00 p.m.	This special program provides an opportunity for children, parents, siblings, and caretakers touched by Autism to have fun in a safe and welcoming environment. The Autism Society Inland Empire provides one staff on site, handles their own preregistration, and provides snacks. Museum specialist provides activity and staff support. Last Friday of the month.	All
Santa's Village 9:00 a.m.-1:00 p.m.	The Museum turns into a themed Christmas wonderland. Children and families explore interactive winter exhibits, make Christmas cookies, play reindeer games, and take pictures with Santa. Some fees apply. 2 <sup>nd</sup> Saturday of December.	All
DairyAire 5K & Fun Run 8:00-11:00 a.m.	Museum Fundraiser. First Saturday in March.	All
Spring & Fall Bingo Bash	Museum Fundraisers. 2 <sup>nd</sup> Monday in May/2 <sup>nd</sup> Monday in November.	All
Facility Rental	Rent room for private meeting and functions.	All
Museum Birthday Parties	Parties include full access to Museum exhibits and private use of the Town Hall for food and cake. The Museum is a popular birthday spot, so please book your party early! Reservations can be made up to two months in advance. Members receive a discount and may reserve up to three months in advance.	All

University Hall – Carolyn Owens Community Center, Second Floor, 13201 Central Avenue

Monday-Friday: 8:00 a.m.-8:00 p.m. / Weekends: Varies

Activity	Description	Age
Choices Batterers' Treatment	The Batterers' Treatment courses are designed to meet the needs of individuals who have realized their anger has caused problems in their relationships.	18+
AA Meetings	Room rental and meetings conducted by AA.	18+
Community Meetings		
Staff Meetings		
University Programs	College courses for undergraduate and graduate degree programs conducted by various Universities.	
Rentals		
Group Counseling Supervision	Clinical Supervision for Master level students in the Human Services counseling program.	
SWAG	Social Work Action Group office meeting space.	
Art Classes	Art classes for children ages 6-12 years.	6-12 y/old
Computer Adventures	Develop proper typing skills and learn Microsoft for editing documents.	8+
Intro to Typing	Develop child's basic typing skills.	8+
Intro to Microsoft	Learn to use word and excel.	8+
Boy and Girl Scouts Troop meetings	Scouts troop meetings	5-12 y/old

Community Building, 5443 B Street

Hours: Open when programs are in session.

Activity	Description	Age
Line Dancing	Come and learn the basics of line dancing. Lots of fun and great exercise too! Intermediate level also offered.	50+
Facility Rental	Rooms are rented for meetings and private events.	
AA Meetings	Room rental and meeting conducted by AA.	18+
Social Dance	Non-stop music and dance. Participants get to dance to different music	50+
Door Décor and More	Craft class where participants create festive door hangers for the holiday seasons.	50+
Youth Cheerleading	Students learn arm motions, hand, leg, and feet formations and voice projections.	4-15 y/olds
Special Events	Veteran's Day event, Memorial Day event, Chino Neighborhood House Christmas gift give away, and Pioneer Picnic.	All ages
San Bernardino County Registrar of Voters Polling Locations	Voter's polling location for elections	18+

Liberty Park Center, 11860 Telephone Avenue

Hours: Only open when programs are in session

Activity	Description	Age
Summer Camp	Day camp for kids.	6-13
Summer Lunch Program	Lunch program for children.	0-18 y/old
Facility Rental	Rent room for private meetings and functions.	
AA Meetings	Room rental and meeting conducted by AA	18+
San Bernardino County Registrar of Voters Polling Locations	Voting location for elections.	18+

Neighborhood Activity Center, 5201 D Street

Hours: Monday-Friday 9:00 a.m.-8:00 p.m. / Saturday 9:00 a.m.-1:00 p.m. (Varies: Open during rental hours.)

Activity	Description	Age
Case Management	A variety of community based social services are available throughout the City of Chino and the San Bernardino County to help residents who are low-income, near homeless or homeless. A friendly bilingual Case Manager familiar with resources is available to connect families with social services, including but not limited to: assistance with health care insurance, public benefits, and housing.	All
Creative Kids	Children will create artwork by using a variety of mixed media art supplies and exploring their creativity while learning how to use different techniques such as painting, stamping, and sculpting. Price includes all supplies and materials.	6-12
Science Spies	Children will learn how science is a part of their everyday life. The class will encourage students to ask why and test how things work through hand-on science experiments about the earth, animals, technology, biology, water, and chemistry. Price includes all supplies and materials.	6-12
Young Chefs	Children will learn how to make a variety of healthy snacks and enjoy eating their own creations. Each young chef will also make a recipe book to share with family and friends.	6-12
Women's Basketball	This basketball league is designed for female Chino residents who want to have fun and play the sport while interacting with other women in the community. This season consists of 9 games, 1 playoff and 1 final game for bragging rights!	18+
Community Mobile Stops	Look for the Community Outreach booth, meet our Community Service Outreach staff to receive the latest information about upcoming events/programs, and receive a FREE promotional item while supplies last.	All
Senior Legends	Basketball shoot competition: Senior Legends participants compete to see who can make the most basketball shots from designated spots on the floor. (Host the competition)	50+
Open Gym	Drop-in activity for pick-up basketball games for youth and adults.	All
Men's Basketball League	The Men's Adult Basketball League offers competition for all skill levels. Three divisions are available: Sunday Lower (Recreation), Sunday Upper (Intermediate), and Sunday (Advanced). Ten game season, plus playoffs.	18+
Pee Wee Sports	Introductory sports program teaches fundamental basketball skills to participants. (Basketball, baseball, track & field, soccer, and boot camp.	3-6
Youth Basketball League	Recreational youth practices and games divided by age divisions. Teams are formed and compete against each other. (Summer and winter leagues)	7-14
Boxing Club	The Chino Boxing Club gives participants the opportunity to learn the art of amateur boxing, while developing character, conditioned bodies, and sportsmanship. All boxers are under the guidance of highly trained boxing instructors. The Chino Youth Boxing Foundation hosts several USA Amateur Boxing Federation sanctioned shows every year. Parents must sign a waiver. All new participants must attend an orientation held on the 2nd and 4th Tuesday of the month from 6:30-7:30 pm.	8+
Corporate Challenge Basketball	Basketball tournament between teams participating in Corporate Challenge event. (Host this tournament)	18+
Corporate Challenge Volleyball	Volleyball tournament between teams participating in Corporate Challenge event. (Host this tournament)	18+
Volleyball Open Gym	Drop-in activity for pick-up volleyball games for adults.	16+
Nutrition Class	Parents and adults are invited to learn how to be physically active, plan healthier meals, try new recipes, and stretch the food budget. This FREE class is made possible through the continued collaboration with the University of California Cooperative Extension, Expanded Food & Nutrition Education Program.	18+

Back-to-School giveaway	This event is FREE to the first 250 youth, who live in Chino. Participants must register to receive free school supplies to prepare them for the new school year!	5-17
Internet Safety Workshop	A FREE workshop designed for parents/guardians to learn how to discuss important internet safety issues with children of every age, as well as being aware of their youth's activity online. Class will be offered in English/Spanish. This workshop is made possible in collaboration with Project Sister Family Services.	18+
Water Safety Workshop	Join us for a FREE informative workshop that will teach parents/caregivers how to keep children safe around water during the summer, whether enjoying a day at the pool, beach, or lake. This workshop is made possible in collaboration with Loma Linda University Children's Hospital.	18+
Holiday Basket and Christmas Gift Giveaway	In collaboration with local sponsors, the City of Chino will provide a limited number of holiday food/dinner baskets and Christmas gifts for families and children/youth. Register your family to receive a FREE holiday basket for Thanksgiving or Christmas and holiday gifts for children/youth. Registration for this annual event is FREE to children/youth who live in Chino and whose parents/families meet registration requirements.	All
Current Drug Trends Workshop	This FREE workshop will cover the evolving look of current drug trends, and a behind-the-scenes look at where these products are sold. Parents will learn about new drug logos, terms, and identifiers. Parents will get an inside look at these trends, while learning ways to help prevent the use and abuse of each drug.	18+
Facility Rentals	Multi-purpose rooms 1 and 2, and basketball gym. (Residents, nonresidents, businesses, nonprofits, sports groups, and City of Chino internal rentals)	
Workshops	Parent/guardian workshops based on a variety of topics throughout the year.	18+

Old School House Museum, 5493 B Street

Hours: Wed & Thurs, 10 a.m.-3 p.m., Second Saturday of the month, 11 a.m.-4 p.m.

Activity	Description	Age
Hall of Fame	Host recipient family reception at the museum	All ages
Facility Rental	Rent room for private meetings and functions.	
October Festival	City special event in-doors and out-doors.	All ages
Museum Exhibits	Participants enjoy the different exhibits	All ages

Preserve Community Center, 15800 Main Street

Hours: Monday, Tuesday, Wednesday, and Friday 3:00-8:00 p.m. / Thursday, 1:00-8:00 p.m. / Saturday 9:00 a.m.-1:00 p.m. (Varies: Open during rental hours.)

Activity	Description	Age
Sunrise Before School	Sunrise Kids is a recreation-based, before school program for students in Kindergarten (am classes only) through 8th grade attending Cal Aero Preserve. Trained staff provides a caring environment. Participants enjoy quiet time, participate in group games, crafts, and wake-up exercise. A light breakfast is provided. Staff walks participants to the school campus before the morning bell. The program is offered only on student days per the CVUSD school calendar.	Kinder – 8 <sup>th</sup> grade
Preserve High Five	Participants can enjoy a safe place after school while getting homework assistance, participating in enrichment and recreational activities, and experiencing cultural arts. This program is for students entering Kinder-8th grades, and is offered Monday-Friday from dismissal time until 6:00 pm. Snack provided.	Kinder – 8 <sup>th</sup> grade
Creative Kids	Children will create artwork by using a variety of mixed media art supplies and exploring their creativity while learning how to use different techniques such as painting, stamping, and sculpting. Price includes all supplies and materials.	6-12
Science Spies	Children will learn how science is a part of their everyday life. The class will encourage students to ask why and test how things work through hand-on science experiments about the earth, animals, technology, biology, water, and chemistry. Price includes all supplies and materials.	6-12
Wilderness Survival Camp	Survive and Thrive! Participants will learn the fundamentals of wilderness survival. Learn how to recognize animal tracks, construct tarp tents, make a backpack out of jeans, construct a sun clock, and write with berry ink! The last day of class participants will put their skills to test with a scavenger hunt.	6-12
Young Builders	Children will learn to construct a variety of wood projects using real tools. The class will focus on proper tool handling techniques and safety while allowing hands-on opportunities to build. Price includes all supplies and materials.	6-12
Open Gym	Drop-in activity for pick-up basketball games for youth and adults.	All
Youth Basketball League	Recreational youth practices and games divided by age divisions. Teams are formed and compete against each other. (Summer and winter leagues)	7-14
Corporate Challenge Basketball	Basketball tournament between teams participating in Corporate Challenge event. (Host this tournament)	18+
Corporate Challenge Volleyball	Volleyball tournament between teams participating in Corporate Challenge event. (Host this tournament)	18+
Facility Rentals	Youth Activity Room, Physical Activity Room, YAR & PAR, and Kitchen. (Residents, nonresidents, businesses, nonprofits, sports groups, and City of Chino internal rentals)	

Senior Center, 13170 Central Avenue

Hours: Monday-Saturday 8:00 a.m.-8:00 p.m. / Sundays: 10:00 a.m.-6:00 p.m.

Activity	Description	Age
Case Management	Provides assessment and coordination of existing resources to address individual needs.	50+
Lunch Program	Hot, nutritious lunches are served M-F at 11:30 am.	50+
Driver Safety Class-AARP	A course that will enable drivers to refresh their driving skills and understand how to adjust to age-related challenges. Driver will receive a certificate upon completion of course that will grant a discount for their car insurance policy. Classes are instructed by a trained AARP volunteer.	50+
Health Insurance and Advocacy Program (HICAP)	Help you with Medicare and other health insurance questions or issues.	50+
Prescription Assistance Through Community Help	Qualified Chino seniors, 60+, can receive help with the purchase of life sustaining medications.	50+
Aid Equipment Program	The Senior Center will loan equipment to Chino residents in need. Equipment includes walkers, canes, crutches, and wheelchairs.	50+
Transportation	Transportation is available for Chino senior residents to participate/visit the Center, shopping/errands, and limited doctor appointments within the Chino city limits.	50+
Department of Aging & Adult Services	A representative from the County provides seniors assistance with social services referrals, bus passes, and public benefit applications, when available, on the second Wednesday of the month.	50+
Fitness Room	Featuring state of the art equipment including treadmills, lifecycles, an elliptical trainer, and easy-to-use weight machines.	50+
Arthritis Foundation Exercise Program	A.F.E.P. is a low-impact, chair-based exercise program specifically designed for those with arthritis. Certified instructor, Linda Hilton, creates an enjoyable atmosphere. Currently working on starting this back up.	50+
Aerobic and Strengthening Exercise	Keep your heart healthy, your body limber, and your energy level high as you participate in this exercise class designed for seniors 50+.	50+
Line Dancing	Come and learn the basics of line dancing. Lots of fun and great exercise too!	50+
Tai Chi	Tai Chi is a traditional Chinese martial art that combines Kung Fu movements with Qi (energy) circulation and breathing techniques. The training includes the integration of body, energy, and mind. Tai Chi Chuan was initially created as a form of martial arts; but today is being practiced all over the world to improve health.	50+
Zumba	Zumba combines Latin and international music with dance movements to create a fun and exciting workout.	50+
Yoga	Reduce stress and improve strength, flexibility, balance, coordination, and peace of mind.	50+
California Phone	Classes to teach seniors how to use their smart phone, and how to navigate the internet. Beginning to advanced classes.	50+
Chinese-Style Ballroom Dancing	Ballroom dance instruction.	50+
Quilting/Sewing	Bring in your quilting projects and receive instruction on all levels.	50+
Facility Rentals	Multi-purpose room rented out for private events.	50+
Recreation games	Bingo, Bunco, Hand & Foot, Pinochle, Tripoly, Poker, Shuffleboard, various board games	50+
Billiards	Open play and tournaments	50+

Summer Luau and Lunch	Lunch and a Polynesian show.	50+
Sock Hop Dance	Dancing	50+
Spooky Senior Dance	Dancing	50+
Craft Corner	Participants work on crafts, knitting, crochet, and needlework projects.	50+
Thanksgiving Luncheon	Lunch and raffle event hosted in Senior Center auditorium.	
Christmas Luncheon	Lunch and raffle event hosted in Senior Center auditorium.	50+
BINGO	BINGO games hosted by Senior Club on Tuesday and Fridays.	50+
BINGO Events	New Years and All American BINGO events	21+
Overflow meeting space for Council and Planning Commission Meetings	Auditorium reservation for meetings.	All ages

Teen Center (Monte Vista Park), 13196 Monte Vista Avenue

Hours: Monday-Friday, 3:00-8:00 p.m. (Varies: depending on school minimum days)

Activity	Description	Age
Shuttle Services	The Chino Experience Teen Center is a safe place for teens in the 7th-12th grades to have fun and engage with other teens in the community. Shuttle service: \$30/month for before school drop off and \$30/month for after school pick-up for students enrolled at the Chino H.S., Don Lugo H.S., Magnolia Jr. High, Ramona Jr. High, or Briggs 7th and 8th grade students.	13-18
Art of Expression	Enjoy an evening with your friends at the Chino Experience Teen Center while creating your own masterpiece! You will be provided step-by-step instruction and best of all, you get to take your artwork home! No paint experience needed. Snacks will be provided.	13-18
Iron Chef	Teens learn to prepare meals and enjoy delicious creations during these hands-on cooking workshops.	13-18
Career Workshops	Case Managers provide monthly teen workshops on college and career readiness.	13-18
Teen Opportunity Program	TOP is for teens in grades 7 through 12 (13 to 18 years of age) who are friendly, enthusiastic, and eager to help in their community. Participants will develop interpersonal skills and learn through hands-on assignments. Chino Community Services staff will train and assign TOP Volunteers within the City's programs and special events throughout the year.	13-18
Great American Smokeout	The Great American Smokeout event is held on the third Thursday in November. Start your journey toward a smoke-free life. You'll be joining thousands of people who smoke across the country in taking an important step toward a healthier life and reducing your cancer risk. Plus, the American Cancer Society can help you access the resources and support you need to quit.	13-18
Splash Pad	The Splash Pad provides a place for children to stay "cool" by having fun with water during the summer. Hours of operation, May TBD-September TBD, daily from 11:00 a.m.-7:00 p.m. September TBD-October TBD, Monday-Friday 4:00-6:00 p.m. and Saturday/Sunday from 10:00 a.m.-6:00 p.m.	All
Summer Lunch	Youth 18 years of age and younger can enjoy a free lunch while visiting the park!	18 and younger
Seasonal Camps	The Community Services Department offers seasonal day camps during Chino Valley Unified School District breaks. Camp provides a safe place for participants in grades 1st through 8th to enjoy arts and crafts, games, recreational activities, and much more.	5-13

Chino Police Department, 5450 Guardian Way

Hours: Varies

Activity	Description	Age
Community Academy	Training on various aspects of law enforcement through presentations, demonstrations, and hands-on activities on topics such as patrol operations, SWAT, K9, and Crisis Negotiations. (offered 2 English, 1 Spanish, 1 youth and 1 junior)	18+/varies
Community Open House	Tour and open house of the Chino Police Station open to all community members.	All
Community Emergency Response Team (CERT)	Educates volunteers about disaster preparedness for hazards that may impact their area and trains on basic disaster response skills.	18+
LISTOS	Disaster preparedness program (offered in Spanish and English)	All

Chino Valley Fire Department Training Center, 5092 Schaefer Avenue

Hours: Varies

Activity	Description	Age
Community Emergency Response Team (CERT)	Educates volunteers about disaster preparedness for hazards that may impact their area and trains on basic disaster response skills.	18+

Public Works Services Yard, 5050 Schaefer Avenue

Hours: 2<sup>nd</sup> and 4<sup>th</sup> Saturday from 8-1 excluding the 4<sup>th</sup> Saturday in December

Activity	Description	Ages
Household Hazardous Waste Collection	Monthly hazardous waste disposal event where residents of San Bernadino County can bring in hazardous waste and electronic waste for proper disposal and recycling. Participants are limited to 125 lbs. of material and are not allowed to exit their vehicles when at the facility.	All

Chino City Hall, 13220 Central Avenue

Hours: Monday through Friday 7:30 am – 5:30 pm

Activity	Description	Ages
Home Improvement Loan Program	Home Repair Loans for low-to-moderate eligible households	Any
Home Improvement Grant Program	Home Repair Grants for low-to-moderate eligible households	Any
CalHOME Re-use Loans	Home Repair Loans for low-to-moderate eligible households	Any
Safe Home for Seniors	Home Improvement Grants for Health & Safety/Accessibility	55+
Emergency Assistance	Rent/Security Deposit/Utility Payment Assistance for eligible low-to-moderate households	Any
Social Workers Action Group (SWAG)	Homeless Intervention Program-administered by Community Services	Any
Fair Housing Services	CDBG Funded Fair Housing Awareness/Education and mediation	Any
Public Service Programs	CDBG Funded-Shelter/Counseling/Food Services to eligible low-to-moderate persons	Any

---

**APPENDIX I:  
ACCESSIBILITY SUMMARIES BY FACILITY**

---

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
<b>7th Street Park</b>												
7th Street Park	\$4,805	3			\$1,300	1					\$6,105	4
<b>Subtotal</b>	<b>\$4,805</b>	<b>3</b>			<b>\$1,300</b>	<b>1</b>					<b>\$6,105</b>	<b>4</b>
<b>7th Street Theater</b>												
EXTERIOR	\$54,923	17					\$280	1			\$55,203	18
INTERIOR	\$4,310	2	\$40,055	18	\$36,723	30					\$81,088	50
<b>Subtotal</b>	<b>\$59,233</b>	<b>19</b>	<b>\$40,055</b>	<b>18</b>	<b>\$36,723</b>	<b>30</b>	<b>\$280</b>	<b>1</b>			<b>\$136,291</b>	<b>68</b>
<b>Aguiar Square</b>												
Aguiar Square	\$57,577	27	\$7,045	3	\$8,000	1	\$560	1			\$73,182	33
<b>Subtotal</b>	<b>\$57,577</b>	<b>27</b>	<b>\$7,045</b>	<b>3</b>	<b>\$8,000</b>	<b>1</b>	<b>\$560</b>	<b>1</b>			<b>\$73,182</b>	<b>33</b>
<b>Ayala Park</b>												
ACCESSIBLE PARKING	\$61,742	18					\$280	1			\$62,022	19
BUILDING A					\$9,320	4	\$8,496	2			\$17,816	6
BUILDING B	\$1,194	1			\$8,500	4	\$8,238	2			\$17,932	7
BUILDING C	\$682	1			\$9,393	8	\$8,238	2			\$18,313	11
BUILDING D			\$1,805	1	\$10,417	10	\$8,000	1	\$2,118	6	\$22,340	18
EXTERIOR	\$54,493	19			\$8,000	1	\$1,785	4			\$64,278	25
<b>Subtotal</b>	<b>\$118,111</b>	<b>39</b>	<b>\$1,805</b>	<b>1</b>	<b>\$45,630</b>	<b>27</b>	<b>\$35,036</b>	<b>12</b>	<b>\$2,118</b>	<b>6</b>	<b>\$202,699</b>	<b>86</b>
<b>Ayala Park Operations Center</b>												
EXTERIOR	\$80,513	14	\$3,255	5			\$560	2			\$84,328	21
INTERIOR	\$928	3	\$4,309	4	\$2,261	11	\$8,000	1			\$15,498	19
<b>Subtotal</b>	<b>\$81,441</b>	<b>17</b>	<b>\$7,564</b>	<b>9</b>	<b>\$2,261</b>	<b>11</b>	<b>\$8,560</b>	<b>3</b>			<b>\$99,826</b>	<b>40</b>
<b>Carolyn Owens Centennial Square</b>												
Carolyn Owens Centennial Square	\$13,894	6	\$3,557	2	\$1,300	1	\$5,720	2			\$24,470	12
<b>Subtotal</b>	<b>\$13,894</b>	<b>6</b>	<b>\$3,557</b>	<b>2</b>	<b>\$1,300</b>	<b>1</b>	<b>\$5,720</b>	<b>2</b>			<b>\$24,470</b>	<b>12</b>
<b>Carolyn Owens Community Center</b>												
Carolyn Owens Community Center	\$22,870	27	\$7,977	16	\$6,200	9	\$280	1			\$37,326	54
<b>Subtotal</b>	<b>\$22,870</b>	<b>27</b>	<b>\$7,977</b>	<b>16</b>	<b>\$6,200</b>	<b>9</b>	<b>\$280</b>	<b>1</b>			<b>\$37,326</b>	<b>54</b>
<b>Central Park</b>												
Central Park	\$13,460	8	\$794	1			\$280	1			\$14,534	11
<b>Subtotal</b>	<b>\$13,460</b>	<b>8</b>	<b>\$794</b>	<b>1</b>			<b>\$280</b>	<b>1</b>			<b>\$14,534</b>	<b>11</b>
<b>Chaffey College Business Office</b>												
EXTERIOR	\$1,932	4									\$1,932	4
INTERIOR	\$1,098	1	\$1,135	3	\$8,660	11					\$10,893	15
<b>Subtotal</b>	<b>\$3,030</b>	<b>5</b>	<b>\$1,135</b>	<b>3</b>	<b>\$8,660</b>	<b>11</b>					<b>\$12,825</b>	<b>19</b>
<b>Chaffey College IT Center</b>												
EXTERIOR	\$1,672	2			\$238	1					\$1,910	4
INTERIOR	\$12,826	5	\$26,429	7	\$15,740	20	\$1,960	2			\$56,955	34
<b>Subtotal</b>	<b>\$14,498</b>	<b>7</b>	<b>\$26,429</b>	<b>7</b>	<b>\$15,978</b>	<b>21</b>	<b>\$1,960</b>	<b>2</b>			<b>\$58,865</b>	<b>38</b>
<b>Chaffey College/Chino Center</b>												
EXTERIOR	\$25,351	16	\$640	1	\$1,300	1	\$280	1			\$27,571	19

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
INTERIOR	\$9,328	7	\$10,030	6	\$35,172	18	\$7,686	3			\$62,216	34
<b>Subtotal</b>	<b>\$34,679</b>	<b>23</b>	<b>\$10,670</b>	<b>7</b>	<b>\$36,472</b>	<b>19</b>	<b>\$7,966</b>	<b>4</b>			<b>\$89,787</b>	<b>53</b>
Chino Branch Library												
EXTERIOR	\$29,973	12	\$500	1			\$560	1			\$31,033	14
INTERIOR	\$1,814	3	\$1,015	4	\$15,931	11					\$18,760	18
<b>Subtotal</b>	<b>\$31,787</b>	<b>15</b>	<b>\$1,515</b>	<b>5</b>	<b>\$15,931</b>	<b>11</b>	<b>\$560</b>	<b>1</b>			<b>\$49,793</b>	<b>32</b>
Chino Community Garden												
EXTERIOR	\$22,374	14	\$1,300	1			\$8,500	2			\$32,174	17
RESTROOMS					\$1,478	6					\$1,478	6
<b>Subtotal</b>	<b>\$22,374</b>	<b>14</b>	<b>\$1,300</b>	<b>1</b>	<b>\$1,478</b>	<b>6</b>	<b>\$8,500</b>	<b>2</b>			<b>\$33,652</b>	<b>23</b>
City Hall												
EXTERIOR	\$76,540	21			\$8,000	1	\$798	3	\$2,250	2	\$87,588	27
INTERIOR			\$100,944	31	\$66,710	65	\$29,224	6	\$9,204	7	\$206,081	109
<b>Subtotal</b>	<b>\$76,540</b>	<b>21</b>	<b>\$100,944</b>	<b>31</b>	<b>\$74,710</b>	<b>66</b>	<b>\$30,022</b>	<b>9</b>	<b>\$11,454</b>	<b>9</b>	<b>\$293,669</b>	<b>136</b>
Classics Park												
Classics Park	\$11,519	7									\$11,519	7
<b>Subtotal</b>	<b>\$11,519</b>	<b>7</b>									<b>\$11,519</b>	<b>7</b>
Community Building												
EXTERIOR	\$85,396	23	\$250	1	\$220	1	\$23,313	15			\$109,178	40
INTERIOR			\$160,426	23	\$25,841	29	\$29,339	7			\$215,606	59
<b>Subtotal</b>	<b>\$85,396</b>	<b>23</b>	<b>\$160,676</b>	<b>24</b>	<b>\$26,061</b>	<b>30</b>	<b>\$52,652</b>	<b>22</b>			<b>\$324,785</b>	<b>99</b>
Community Building Park												
Community Building Park	\$5,184	6	\$17,404	10							\$22,587	17
<b>Subtotal</b>	<b>\$5,184</b>	<b>6</b>	<b>\$17,404</b>	<b>10</b>							<b>\$22,587</b>	<b>17</b>
Community Garden												
Community Garden	\$13,108	6	\$500	1	\$225	1	\$280	1			\$14,113	10
<b>Subtotal</b>	<b>\$13,108</b>	<b>6</b>	<b>\$500</b>	<b>1</b>	<b>\$225</b>	<b>1</b>	<b>\$280</b>	<b>1</b>			<b>\$14,113</b>	<b>10</b>
Constellation Park												
Constellation Park	\$22,048	7	\$1,275	3							\$23,323	10
<b>Subtotal</b>	<b>\$22,048</b>	<b>7</b>	<b>\$1,275</b>	<b>3</b>							<b>\$23,323</b>	<b>10</b>
Cypress Trails Park/Restroom												
Cypress Trails Park/Restroom	\$20,318	12	\$2,478	3	\$14,340	10	\$280	1			\$37,416	27
<b>Subtotal</b>	<b>\$20,318</b>	<b>12</b>	<b>\$2,478</b>	<b>3</b>	<b>\$14,340</b>	<b>10</b>	<b>\$280</b>	<b>1</b>			<b>\$37,416</b>	<b>27</b>
Discovery Park												
Discovery Park	\$1,610	3			\$8,000	1	\$200	1			\$9,810	5
<b>Subtotal</b>	<b>\$1,610</b>	<b>3</b>			<b>\$8,000</b>	<b>1</b>	<b>\$200</b>	<b>1</b>			<b>\$9,810</b>	<b>5</b>
Energy Park												
Energy Park	\$11,269	20	\$5,750	2	\$9,538	3	\$2,505	1			\$29,061	26
<b>Subtotal</b>	<b>\$11,269</b>	<b>20</b>	<b>\$5,750</b>	<b>2</b>	<b>\$9,538</b>	<b>3</b>	<b>\$2,505</b>	<b>1</b>			<b>\$29,061</b>	<b>26</b>
Evergreen Park												
Evergreen Park	\$176	1			\$8,238	2	\$16,000	2			\$24,414	5
<b>Subtotal</b>	<b>\$176</b>	<b>1</b>			<b>\$8,238</b>	<b>2</b>	<b>\$16,000</b>	<b>2</b>			<b>\$24,414</b>	<b>5</b>

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
Family Services Center												
Family Services Center	\$67,851	22	\$4,705	6	\$68,125	21	\$13,883	4	\$179	1	\$154,743	55
<b>Subtotal</b>	<b>\$67,851</b>	<b>22</b>	<b>\$4,705</b>	<b>6</b>	<b>\$68,125</b>	<b>21</b>	<b>\$13,883</b>	<b>4</b>	<b>\$179</b>	<b>1</b>	<b>\$154,743</b>	<b>55</b>
Fire Station #1 & Training Center Facility												
Fire Station #1 & Training Center Facility	\$2,974	6			\$720	1	\$1,130	2			\$4,824	10
<b>Subtotal</b>	<b>\$2,974</b>	<b>6</b>			<b>\$720</b>	<b>1</b>	<b>\$1,130</b>	<b>2</b>			<b>\$4,824</b>	<b>10</b>
Fire Station #5												
Fire Station #5	\$23,804	9	\$200	1			\$1,250	2			\$25,254	13
<b>Subtotal</b>	<b>\$23,804</b>	<b>9</b>	<b>\$200</b>	<b>1</b>			<b>\$1,250</b>	<b>2</b>			<b>\$25,254</b>	<b>13</b>
Fire Station #63												
Fire Station #63	\$1,985	4			\$583	3	\$1,225	1			\$3,793	9
<b>Subtotal</b>	<b>\$1,985</b>	<b>4</b>			<b>\$583</b>	<b>3</b>	<b>\$1,225</b>	<b>1</b>			<b>\$3,793</b>	<b>9</b>
Fire Station #7												
Fire Station #7	\$4,335	8			\$666	3					\$5,001	12
<b>Subtotal</b>	<b>\$4,335</b>	<b>8</b>			<b>\$666</b>	<b>3</b>					<b>\$5,001</b>	<b>12</b>
Forest Park												
EXTERIOR	\$12,611	4			\$9,300	2	\$8,000	1			\$29,911	7
RESTROOMS					\$4,041	10					\$4,041	10
<b>Subtotal</b>	<b>\$12,611</b>	<b>4</b>			<b>\$13,341</b>	<b>12</b>	<b>\$8,000</b>	<b>1</b>			<b>\$33,952</b>	<b>17</b>
Founders Park												
Founders Park	\$9,122	3	\$4,617	6	\$11,343	7	\$100	1			\$25,182	17
<b>Subtotal</b>	<b>\$9,122</b>	<b>3</b>	<b>\$4,617</b>	<b>6</b>	<b>\$11,343</b>	<b>7</b>	<b>\$100</b>	<b>1</b>			<b>\$25,182</b>	<b>17</b>
Gallery Park												
Gallery Park	\$355	4	\$13,200	5			\$1,098	1			\$14,653	10
<b>Subtotal</b>	<b>\$355</b>	<b>4</b>	<b>\$13,200</b>	<b>5</b>			<b>\$1,098</b>	<b>1</b>			<b>\$14,653</b>	<b>10</b>
Garden Park												
EXTERIOR	\$7,142	7	\$238	1	\$29,200	7	\$17,074	6			\$53,654	21
RESTROOMS					\$5,042	5					\$5,042	5
<b>Subtotal</b>	<b>\$7,142</b>	<b>7</b>	<b>\$238</b>	<b>1</b>	<b>\$34,242</b>	<b>12</b>	<b>\$17,074</b>	<b>6</b>			<b>\$58,696</b>	<b>26</b>
Golden Tree Park												
Golden Tree Park					\$8,000	1					\$8,000	1
<b>Subtotal</b>					<b>\$8,000</b>	<b>1</b>					<b>\$8,000</b>	<b>1</b>
Gray Building/Chamber of Commerce												
Gray Building/Chamber of Commerce	\$14,603	8	\$1,371	4	\$7,795	9	\$5,000	1			\$28,768	23
<b>Subtotal</b>	<b>\$14,603</b>	<b>8</b>	<b>\$1,371</b>	<b>4</b>	<b>\$7,795</b>	<b>9</b>	<b>\$5,000</b>	<b>1</b>			<b>\$28,768</b>	<b>23</b>
Harvest Park												
Harvest Park	\$4,601	4			\$8,000	1	\$5,000	1			\$17,601	6
<b>Subtotal</b>	<b>\$4,601</b>	<b>4</b>			<b>\$8,000</b>	<b>1</b>	<b>\$5,000</b>	<b>1</b>			<b>\$17,601</b>	<b>6</b>

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
Heritage Park/Restroom/Concession												
Heritage Park/Restroom/Concession	\$47,225	17	\$3,156	5	\$40,699	9					\$91,079	32
<b>Subtotal</b>	<b>\$47,225</b>	<b>17</b>	<b>\$3,156</b>	<b>5</b>	<b>\$40,699</b>	<b>9</b>					<b>\$91,079</b>	<b>32</b>
Hidden Hollow												
Hidden Hollow	\$4,836	19	\$5,817	3	\$14,977	4	\$10,743	3			\$36,373	29
<b>Subtotal</b>	<b>\$4,836</b>	<b>19</b>	<b>\$5,817</b>	<b>3</b>	<b>\$14,977</b>	<b>4</b>	<b>\$10,743</b>	<b>3</b>			<b>\$36,373</b>	<b>29</b>
Inspiration Park												
Inspiration Park	\$18,234	2	\$1,626	2			\$200	1			\$20,060	5
<b>Subtotal</b>	<b>\$18,234</b>	<b>2</b>	<b>\$1,626</b>	<b>2</b>			<b>\$200</b>	<b>1</b>			<b>\$20,060</b>	<b>5</b>
Liberty Park												
Liberty Park	\$31,049	21	\$6,371	6	\$23,250	4	\$625	1			\$61,295	33
<b>Subtotal</b>	<b>\$31,049</b>	<b>21</b>	<b>\$6,371</b>	<b>6</b>	<b>\$23,250</b>	<b>4</b>	<b>\$625</b>	<b>1</b>			<b>\$61,295</b>	<b>33</b>
Liberty Park Recreation Center												
EXTERIOR	\$23,536	11			\$2,500	2	\$8,238	2			\$34,274	15
INTERIOR	\$5,778	4	\$300	2	\$7,336	24	\$8,100	2			\$21,514	32
<b>Subtotal</b>	<b>\$29,314</b>	<b>15</b>	<b>\$300</b>	<b>2</b>	<b>\$9,836</b>	<b>26</b>	<b>\$16,338</b>	<b>4</b>			<b>\$55,788</b>	<b>47</b>
Lotus Park												
Lotus Park	\$34,098	2	\$5,000	1	\$16,108	3	\$1,680	2			\$56,885	8
<b>Subtotal</b>	<b>\$34,098</b>	<b>2</b>	<b>\$5,000</b>	<b>1</b>	<b>\$16,108</b>	<b>3</b>	<b>\$1,680</b>	<b>2</b>			<b>\$56,885</b>	<b>8</b>
McLeod Park												
McLeod Park	\$8,902	9	\$3,037	4			\$19,861	4			\$31,800	18
<b>Subtotal</b>	<b>\$8,902</b>	<b>9</b>	<b>\$3,037</b>	<b>4</b>			<b>\$19,861</b>	<b>4</b>			<b>\$31,800</b>	<b>18</b>
Meridian Park - North												
Meridian Park - North	\$22,845	12			\$8,000	1					\$30,845	14
<b>Subtotal</b>	<b>\$22,845</b>	<b>12</b>			<b>\$8,000</b>	<b>1</b>					<b>\$30,845</b>	<b>14</b>
Meridian Park - South												
EXTERIOR	\$27,098	23	\$1,103	1			\$238	1	\$400	1	\$28,838	26
RESTROOMS	\$4,839	3			\$15,555	22	\$1,000	2			\$21,394	27
<b>Subtotal</b>	<b>\$31,937</b>	<b>26</b>	<b>\$1,103</b>	<b>1</b>	<b>\$15,555</b>	<b>22</b>	<b>\$1,238</b>	<b>3</b>	<b>\$400</b>	<b>1</b>	<b>\$50,232</b>	<b>53</b>
Monte Vista Park												
Monte Vista Park	\$11,793	3					\$8,000	1			\$19,793	4
<b>Subtotal</b>	<b>\$11,793</b>	<b>3</b>					<b>\$8,000</b>	<b>1</b>			<b>\$19,793</b>	<b>4</b>
Monte Vista Park Recreation Center/Teen Center												
EXTERIOR	\$672	1	\$250	1							\$922	3
INTERIOR	\$366	1	\$13,536	15	\$14,261	12	\$759	1			\$28,922	29
<b>Subtotal</b>	<b>\$1,038</b>	<b>2</b>	<b>\$13,786</b>	<b>16</b>	<b>\$14,261</b>	<b>12</b>	<b>\$759</b>	<b>1</b>			<b>\$29,844</b>	<b>32</b>
Mountain View Park/Restroom/Concession												
Mountain View Park/Restroom/Concession	\$76,079	29	\$6,322	11	\$42,128	12	\$3,600	3			\$128,128	56

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
<b>Subtotal</b>	<b>\$76,079</b>	<b>29</b>	<b>\$6,322</b>	<b>11</b>	<b>\$42,128</b>	<b>12</b>	<b>\$3,600</b>	<b>3</b>			<b>\$128,128</b>	<b>56</b>
<b>Mulberry Park</b>												
Mulberry Park	\$6,597	4	\$1,500	2	\$8,000	1	\$8,238	2			\$24,334	9
<b>Subtotal</b>	<b>\$6,597</b>	<b>4</b>	<b>\$1,500</b>	<b>2</b>	<b>\$8,000</b>	<b>1</b>	<b>\$8,238</b>	<b>2</b>			<b>\$24,334</b>	<b>9</b>
<b>Nature Retreat Park</b>												
EXTERIOR	\$317	1	\$50,500	2	\$8,000	1	\$238	1			\$59,055	5
RESTROOMS					\$732	1					\$732	1
<b>Subtotal</b>	<b>\$317</b>	<b>1</b>	<b>\$50,500</b>	<b>2</b>	<b>\$8,732</b>	<b>2</b>	<b>\$238</b>	<b>1</b>			<b>\$59,787</b>	<b>6</b>
<b>Neighborhood Activity Center (NAC)</b>												
EXTERIOR	\$20,710	7			\$8,000	1	\$238	1			\$28,948	10
INTERIOR	\$7,557	4	\$46,405	10	\$9,659	8	\$1,598	2			\$65,219	24
<b>Subtotal</b>	<b>\$28,267</b>	<b>11</b>	<b>\$46,405</b>	<b>10</b>	<b>\$17,659</b>	<b>9</b>	<b>\$1,836</b>	<b>3</b>			<b>\$94,167</b>	<b>34</b>
<b>Oak Tree Square Park</b>												
Oak Tree Square Park	\$8,424	3	\$200	1	\$11,625	2					\$20,249	7
<b>Subtotal</b>	<b>\$8,424</b>	<b>3</b>	<b>\$200</b>	<b>1</b>	<b>\$11,625</b>	<b>2</b>					<b>\$20,249</b>	<b>7</b>
<b>Old Schoolhouse Museum</b>												
Old Schoolhouse Museum	\$6,414	12	\$1,706	4	\$14,344	5					\$22,464	22
<b>Subtotal</b>	<b>\$6,414</b>	<b>12</b>	<b>\$1,706</b>	<b>4</b>	<b>\$14,344</b>	<b>5</b>					<b>\$22,464</b>	<b>22</b>
<b>Olympic Park</b>												
EXTERIOR	\$50,898	34	\$2,960	3	\$24,904	25	\$17,813	8		1	\$96,575	71
<b>Subtotal</b>	<b>\$50,898</b>	<b>34</b>	<b>\$2,960</b>	<b>3</b>	<b>\$24,904</b>	<b>25</b>	<b>\$17,813</b>	<b>8</b>		<b>1</b>	<b>\$96,575</b>	<b>71</b>
<b>Owen's Bistro</b>												
EXTERIOR	\$32,716	9					\$280	1			\$32,996	10
INTERIOR	\$2,714	5	\$6,570	2	\$7,677	19	\$55	1			\$17,016	27
<b>Subtotal</b>	<b>\$35,430</b>	<b>14</b>	<b>\$6,570</b>	<b>2</b>	<b>\$7,677</b>	<b>19</b>	<b>\$335</b>	<b>2</b>			<b>\$50,012</b>	<b>37</b>
<b>Police Department</b>												
Police Department	\$5,485	7	\$4,261	3	\$1,435	4	\$350	1			\$11,531	16
<b>Subtotal</b>	<b>\$5,485</b>	<b>7</b>	<b>\$4,261</b>	<b>3</b>	<b>\$1,435</b>	<b>4</b>	<b>\$350</b>	<b>1</b>			<b>\$11,531</b>	<b>16</b>
<b>Preserve Community Center</b>												
EXTERIOR	\$41,634	12									\$41,634	12
INTERIOR	\$34,662	5	\$48,092	3	\$1,927	5					\$84,681	17
<b>Subtotal</b>	<b>\$76,296</b>	<b>17</b>	<b>\$48,092</b>	<b>3</b>	<b>\$1,927</b>	<b>5</b>					<b>\$126,315</b>	<b>29</b>
<b>Public Works Services Center</b>												
EXTERIOR	\$66,466	19					\$280	1			\$66,746	20
INTERIOR	\$8,653	8	\$11,343	14	\$103,856	84	\$28,000	5			\$151,853	111
<b>Subtotal</b>	<b>\$75,119</b>	<b>27</b>	<b>\$11,343</b>	<b>14</b>	<b>\$103,856</b>	<b>84</b>	<b>\$28,280</b>	<b>6</b>			<b>\$218,598</b>	<b>131</b>
<b>Sebring Park</b>												
Sebring Park	\$1,931	3	\$696	2	\$3,250	2					\$5,876	8
<b>Subtotal</b>	<b>\$1,931</b>	<b>3</b>	<b>\$696</b>	<b>2</b>	<b>\$3,250</b>	<b>2</b>					<b>\$5,876</b>	<b>8</b>
<b>Secret Garden Park</b>												

Facility / Building	Priority 1		Priority 2		Priority 3		Priority 4		Priority 5		Total	
	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items	Est. Cost	Items
Secret Garden Park	\$246	1	\$500	1	\$8,000	1	\$16,000	2			\$24,746	5
<b>Subtotal</b>	<b>\$246</b>	<b>1</b>	<b>\$500</b>	<b>1</b>	<b>\$8,000</b>	<b>1</b>	<b>\$16,000</b>	<b>2</b>			<b>\$24,746</b>	<b>5</b>
Senior Center												
EXTERIOR	\$169,866	36	\$2,152	2			\$560	2			\$172,578	40
INTERIOR	\$1,182	3	\$6,350	6	\$3,240	7					\$10,772	16
<b>Subtotal</b>	<b>\$171,048</b>	<b>39</b>	<b>\$8,502</b>	<b>8</b>	<b>\$3,240</b>	<b>7</b>	<b>\$560</b>	<b>2</b>			<b>\$183,350</b>	<b>56</b>
Shady Grove Park/Restroom												
Shady Grove Park/Restroom	\$11,089	7	\$11,612	5	\$2,775	4	\$13,599	2			\$39,074	19
<b>Subtotal</b>	<b>\$11,089</b>	<b>7</b>	<b>\$11,612</b>	<b>5</b>	<b>\$2,775</b>	<b>4</b>	<b>\$13,599</b>	<b>2</b>			<b>\$39,074</b>	<b>19</b>
Symphony Park												
Symphony Park	\$2,876	7	\$5,397	2	\$8,000	1					\$16,273	10
<b>Subtotal</b>	<b>\$2,876</b>	<b>7</b>	<b>\$5,397</b>	<b>2</b>	<b>\$8,000</b>	<b>1</b>					<b>\$16,273</b>	<b>10</b>
Villa Park/Restroom/Concession												
Villa Park/Restroom/Concession	\$37,445	14	\$11,616	5	\$7,473	7	\$14,649	4			\$71,182	31
<b>Subtotal</b>	<b>\$37,445</b>	<b>14</b>	<b>\$11,616</b>	<b>5</b>	<b>\$7,473</b>	<b>7</b>	<b>\$14,649</b>	<b>4</b>			<b>\$71,182</b>	<b>31</b>
Walnut Park/Restroom												
Walnut Park/Restroom	\$10,716	9	\$10,725	3	\$8,315	6	\$6,799	1			\$36,555	20
<b>Subtotal</b>	<b>\$10,716</b>	<b>9</b>	<b>\$10,725</b>	<b>3</b>	<b>\$8,315</b>	<b>6</b>	<b>\$6,799</b>	<b>1</b>			<b>\$36,555</b>	<b>20</b>
Water Environmental Building												
EXTERIOR	\$50,663	23	\$640	4			\$280	1			\$51,583	28
INTERIOR	\$49,030	11	\$4,460	8	\$115,555	30	\$20,000	1			\$189,045	50
<b>Subtotal</b>	<b>\$99,693</b>	<b>34</b>	<b>\$5,100</b>	<b>12</b>	<b>\$115,555</b>	<b>30</b>	<b>\$20,280</b>	<b>2</b>			<b>\$240,628</b>	<b>78</b>
Youth Museum												
EXTERIOR	\$15,185	3									\$15,185	3
INTERIOR	\$366	1	\$44,825	19	\$85,622	8	\$10,973	8			\$141,786	36
<b>Subtotal</b>	<b>\$15,551</b>	<b>4</b>	<b>\$44,825</b>	<b>19</b>	<b>\$85,622</b>	<b>8</b>	<b>\$10,973</b>	<b>8</b>			<b>\$156,971</b>	<b>39</b>
<b>Grand Total</b>	<b>\$1,835,496</b>	<b>800</b>	<b>\$742,226</b>	<b>322</b>	<b>\$1,101,059</b>	<b>646</b>	<b>\$428,394</b>	<b>154</b>	<b>\$14,151</b>	<b>18</b>	<b>\$4,121,325</b>	<b>1973</b>

---

---

**APPENDIX J:  
BARRIERS BY TRANSITION PHASE**

---

---

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323780	Carolyn Owens Community Center		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
320360	Ayala Park	Golf Driving Range, Multi-Use Path	Amenity Not Evaluated	0	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$0
324222	Chaffey College IT Center	Parking Lot 1	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
352447	Gray Building/Chamber of Commerce		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
352582	Heritage Park/Restroom/Concession		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
317146	Preserve Community Center	Library	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
317147	Preserve Community Center	Girls and Boys Locker Rooms	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
317148	Preserve Community Center	Kitchen	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
317149	Preserve Community Center	Music Classroom	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
352683	Mountain View Park/Restroom/Concession		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
320326	Ayala Park	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
320327	Ayala Park	Access Aisle serving P1-A	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
320328	Ayala Park	Accessible Parking Spaces P1-A and P-1C	Parking Space - Van	1	CALIFORNIA: The van parking stall markings are not compliant.	\$420
320329	Ayala Park	Access Aisles serving P1-A and P-1C	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	\$420

PHASE ONE BARRIERS						
<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320330	Ayala Park	Accessible Parking Spaces P1-B and P1-D through P1-N	Parking Space - Car	1	CALIFORNIA: The car parking stall markings are not compliant.	\$5,040
320331	Ayala Park	Access Aisles serving P1-B and P1-D through P1-N	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$3,360
320391	Ayala Park	Parking Lot 4 (A-5)	Exterior Accessible Route	1	CALIFORNIA: The hazardous vehicular area does not have a detectable warning or the existing detectable warning is not compliant.	\$4,032
320398	Ayala Park	Accessible Parking Space P2-D	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
320399	Ayala Park	Access Aisle serving P2-C and P2-D	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
320400	Ayala Park	Accessible Parking Space P2-C	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
320401	Ayala Park	Accessible Parking Space P2-B	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
320402	Ayala Park	Access Aisle serving P2-A and P2-B	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
320403	Ayala Park	Accessible Parking Space P2-A	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
320407	Ayala Park	Accessible Parking Space P2-E	Parking Space - Car	1	CALIFORNIA: The car parking stall markings are not compliant.	\$420
320409	Ayala Park	Accessible Parking Space P2-I	Parking Space - Car	1	CALIFORNIA: The car parking stall markings are not compliant.	\$420
320410	Ayala Park	Accessible Parking Space P2-J	Parking Space - Van	1	CALIFORNIA: The van parking aisle is less than 96" wide, where the van stall is less than 144" wide.	\$420
320415	Ayala Park	Accessible Parking Space P3-B	Parking Space - Car	1	The standard car stall and/or access aisle has openings in ground surfaces greater than 1/2" wide.	\$250
320416	Ayala Park	Accessible Parking Space P3-C	Parking Space - Car	1	The standard car stall and/or access aisle has openings in ground surfaces greater than 1/2" wide.	\$460

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320353	Ayala Park	Building B - Circulation Path	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$1,194
320362	Ayala Park	Building C - Circulation Path	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$682
323781	Carolyn Owens Community Center	1.02	Parking Space-Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$280
323782	Carolyn Owens Community Center	1.02	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
323783	Carolyn Owens Community Center	1.06A	Curb Ramp	1	CALIFORNIA: The parallel curb ramp does not have a compliant detectable warning on the landing at the bottom of the curb ramp.	\$672
323784	Carolyn Owens Community Center	1.06B	Curb Ramp	1	The slope of the curb ramp flare is greater than 1:10 (10%).	\$1,750
323785	Carolyn Owens Community Center	1.08	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
323786	Carolyn Owens Community Center	1.09	Blended Transition	1	CALIFORNIA: The blended transition does not have a compliant detectable warning.	\$672
323787	Carolyn Owens Community Center	1.09	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$750
323789	Carolyn Owens Community Center	1.12A	Floor Surface	1	Gaps in the walking surface are over 1/2" wide, or elongated gaps are not perpendicular to the path of travel.	\$396
323790	Carolyn Owens Community Center	1.12A	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$396
323791	Carolyn Owens Community Center	1.12B	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$500

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323882	Carolyn Owens Community Center	1.15	Door	1	CALIFORNIA: The power operated door is not compliant.	\$2,600
323884	Carolyn Owens Community Center	1.18	Door	1	CALIFORNIA: The power operated door is not compliant.	\$2,600
323885	Carolyn Owens Community Center	1.24A	Accessible Route	1	CALIFORNIA: A warning curb is not provided on a walkway where the walkway edge is more than 4" above the adjacent surface.	\$480
323886	Carolyn Owens Community Center	1.24B	Guards	1	CALIFORNIA: Guards are not compliant or are not provided where required.	\$163
323901	Carolyn Owens Community Center	1.25	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$163
323902	Carolyn Owens Community Center	2.01A	Interior Access Route	1	CALIFORNIA: The width of the aisle is not compliant.	\$500
323903	Carolyn Owens Community Center	2.01B	Interior Access Route	1	CALIFORNIA: The width of the aisle is not compliant.	\$500
323957	Carolyn Owens Community Center	2.03A	Floor Surface	1	The carpet in the common area has an unstable pad or backing.	\$719
323960	Carolyn Owens Community Center	2.03B	Building Entrance-Door	1	The threshold at the accessible door is greater than ½" in height.	\$179
323961	Carolyn Owens Community Center	2.04	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$728
323989	Carolyn Owens Community Center	2.06A	Door	1	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$366
323991	Carolyn Owens Community Center	2.07A	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	\$1,250
324585	Carolyn Owens Community Center	2.07B	Building Entrance-Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$1,750
324586	Carolyn Owens Community Center	2.07C	Building Entrance-Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$1,750
324587	Carolyn Owens Community Center	2.07D	Building Entrance-Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$1,750

PHASE ONE BARRIERS						
<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324588	Carolyn Owens Community Center	2.13	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$163
324589	Carolyn Owens Community Center	2.13	Stairs	1	Stairways along the means of egress are not compliant.	\$840
317485	Chaffey College Business Office	Accessible Parking Space P1-A and P1-B	Parking Space - Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$560
317486	Chaffey College Business Office	Accessible Parking Space P1-C	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
317487	Chaffey College Business Office	Accessible Parking Space P1-C	Parking Space - Van	1	CALIFORNIA: The van parking aisle is less than 96" wide, where the van stall is less than 144" wide.	\$420
317488	Chaffey College Business Office	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
317120	Preserve Community Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
317121	Preserve Community Center	Access Aisle serving P-1A and P1-B	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317123	Preserve Community Center	Accessible Parking Space P1-B	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
317124	Preserve Community Center	Access Aisle serving P-1B and P1-C	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317125	Preserve Community Center	Accessible Parking Space P1-C	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317126	Preserve Community Center	Accessible Parking Space P1-C	Parking Space - Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$280
317128	Preserve Community Center	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$4,032
317129	Preserve Community Center	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The parallel curb ramp does not have a compliant turning space at the bottom of the curb ramp runs.	\$2,220
317130	Preserve Community Center	Loading Zone	Loading/Unloading Zone	1	CALIFORNIA: The loading/unloading access aisle is not marked or the existing aisle marking is not compliant.	\$420

PHASE ONE BARRIERS						
<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317152	Preserve Community Center	Curb Ramp CR-3	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$3,360
317153	Preserve Community Center	Curb Ramp CR-3	Curb Ramp	1	The curb ramp does not meet the slope requirements.	\$1,750
323718	Preserve Community Center	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
317696	Chaffey College/Chino Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
317697	Chaffey College/Chino Center	Access Aisle serving P1-A and P1-B	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317698	Chaffey College/Chino Center	Access Aisle serving P1-A and P1-B	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	\$0
317699	Chaffey College/Chino Center	Accessible Parking Space P1-B, P1-C, P1-D	Parking Space - Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$840
317701	Chaffey College/Chino Center	Gate G-1	Gate	1	The gate hardware is not compliant.	\$200
317703	Chaffey College/Chino Center	Stairs ST-1	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$1,304
317704	Chaffey College/Chino Center	Stairs ST-1	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70
317705	Chaffey College/Chino Center	Ramp R-1	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	\$3,260
317706	Chaffey College/Chino Center	Ramp R-1	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	\$6,620
317707	Chaffey College/Chino Center	Stairs ST-2	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$1,630
317708	Chaffey College/Chino Center	Curb Ramp CR-1 and CR-2	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$1,344

PHASE ONE BARRIERS						
Id	Facility	Location Description	Category	Barrier Priority	Detail	Estimate
317709	Chaffey College/Chino Center	Curb Ramp CR-3	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	\$1,750
317710	Chaffey College/Chino Center	Curb Ramp CR-3	Curb Ramp	1	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$1,289
317711	Chaffey College/Chino Center	Curb Ramp CR-3	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
317712	Chaffey College/Chino Center	Blended Transition BT-1	Exterior Accessible Route	1	CALIFORNIA: The hazardous vehicular area does not have a detectable warning or the existing detectable warning is not compliant.	\$672
317725	Chaffey College/Chino Center	Access Aisle serving P1-C and P1-D	Parking Space-Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$420
320325	Ayala Park	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The parallel curb ramp does not have a compliant detectable warning on the landing at the bottom of the curb ramp.	\$6,720
320333	Ayala Park	Walkway from Parking Lot 1 to Building D	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,896
320361	Ayala Park	Walkway between Building B and Building C	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$474
320374	Ayala Park	Playground	Exterior Accessible Route	1	CALIFORNIA: A warning curb is not provided on a walkway where the walkway edge is more than 4" above the adjacent surface.	\$7,200
320379	Ayala Park	Open Picnic Area	Exterior Accessible Route	1	An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.	\$896
320380	Ayala Park	Playground	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$198

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320381	Ayala Park	Playground	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$379
320383	Ayala Park	Walkway from Building D to Baseball Field	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$853
320384	Ayala Park	Walkway from Building D to Baseball Field	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$948
320385	Ayala Park	Horseshoe Court	Sport Court	1	An accessible route does not directly connect each side of the court.	\$10,035
320387	Ayala Park	Walkway to Skate Park	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$4,757
320389	Ayala Park	Walkway South of Skate Park	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
320390	Ayala Park	Walkway South of Skate Park	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
320404	Ayala Park	Curb Ramp CR-2	Curb Ramp	1	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$1,289
320405	Ayala Park	Curb Ramp CR-2, CR-3, CR-4	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$8,064
320412	Ayala Park	Curb Ramp CR-5	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
320413	Ayala Park	Curb Ramp CR-6	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
320417	Ayala Park	Curb Ramp CR-7	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$4,032
320418	Ayala Park	Curb Ramp CR-8	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$1,344
318334	City Hall	Parking Lot 1	Parking Space - Van	1	CALIFORNIA: A van space and adjacent van aisle are not provided.	\$840
318335	City Hall	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300

PHASE ONE BARRIERS						
<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318336	City Hall	Access Aisle serving P1-A	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
318337	City Hall	Access Aisle serving P1-A	Parking Space - Car	1	The access aisle is less than 60" wide.	\$0
318338	City Hall	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
318339	City Hall	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$4,955
318340	City Hall	Walkway W-2	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,568
318341	City Hall	Public Entrance	Building Entrance - Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$1,750
318342	City Hall	Public Entrance	Door	1	CALIFORNIA: The power operated door is not compliant.	\$2,600
318343	City Hall	Walkway W-3	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$2,141
318347	City Hall	Stairs ST-1	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$8,802
318351	City Hall	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The parallel curb ramp is not compliant, or is required but not provided.	\$1,750
318352	City Hall	Walkway W-4	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$10,703
318353	City Hall	Stairs ST-2	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$2,608
318355	City Hall	Accessible Parking Space P2-B	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
318356	City Hall	Access Aisle serving P2-E and P2-F	Parking Space - Car	1	The access aisle is less than 60" wide.	\$0

PHASE ONE BARRIERS						
<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318357	City Hall	Accessible Parking Space P2-C	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
318358	City Hall	Access Aisle serving P2-E and P2-F	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
318359	City Hall	Accessible Parking Space P2-F	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
318627	City Hall	Parking Lot 1	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
318628	City Hall	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
317815	Chino Branch Library	Parking Lot 1	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$840
317816	Chino Branch Library	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
317818	Chino Branch Library	Access Aisle serving P1-A and P1-B	Parking Space-Van	1	CALIFORNIA: The van aisle markings are not compliant.	\$420
317819	Chino Branch Library	Accessible Parking Space P1-A	Parking Space - Van	1	Ground surfaces of the van parking stall and access aisle are not firm, stable and slip resistant.	\$11,300
317820	Chino Branch Library	Accessible Parking Space P1-B	Parking Space - Car	1	Ground surfaces of the car parking stall and access aisle are not firm, stable and slip resistant.	\$6,300
317840	Chino Branch Library	Stairs ST-1	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$211
317841	Chino Branch Library	Stairs ST-1	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$3,260
317843	Chino Branch Library	Book Return at Main Entrance	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$728
317845	Chino Branch Library	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The parallel curb ramp does not have a compliant detectable warning on the landing at the bottom of the curb ramp.	\$672
317846	Chino Branch Library	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The parallel curb ramp is not compliant, or is required but not provided.	\$1,750

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317848	Chino Branch Library	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$951
323988	Chino Branch Library	Ramp R-1	Ramp	1	CALIFORNIA: The ramp run does not have edge protection or the edge protection is not compliant.	\$3,260
317512	Chaffey College IT Center	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
317548	Chaffey College IT Center	Exterior Entrance to Room 104 Student Lounge	Building Entrance-Door	1	The threshold at the accessible door is greater than ½" in height.	\$1,000
321002	Ayala Park Operations Center	Walkway from Building to Batting Cages	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$21,406
321008	Ayala Park Operations Center	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
321009	Ayala Park Operations Center	Access Aisle serving P1-A	Parking Space- Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
321010	Ayala Park Operations Center	Curb Ramp CR-1	Curb Ramp	1	The curb ramp projects into vehicular traffic lanes, parking space, or associated access aisle.	\$1,750
321011	Ayala Park Operations Center	Curb Ramp CR-2	Curb Ramp	1	The curb ramp projects into vehicular traffic lanes, parking space, or associated access aisle.	\$1,750
321012	Ayala Park Operations Center	Curb Ramp CR-3	Curb Ramp	1	The curb ramp projects into vehicular traffic lanes, parking space, or associated access aisle.	\$1,750
321013	Ayala Park Operations Center	Accessible Parking Space P1-D	Parking Space- Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
321014	Ayala Park Operations Center	Access Aisle serving P1-D and P1-E	Parking Space- Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
321015	Ayala Park Operations Center	Accessible Parking Space P1-E	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
321016	Ayala Park Operations Center	Walkway from Accessible Parking to Building	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$6,937
324489	Ayala Park Operations Center	Accessible Parking Space P1-B	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
324490	Ayala Park Operations Center	Accessible Parking Space P1-C	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
324492	Ayala Park Operations Center	Access Aisle serving P1-B and P1-C	Parking Space-Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
324494	Ayala Park Operations Center	Parking Lot 1 (A-4)	Parking Spaces-General	1	Accessible parking spaces are not dispersed where parking serves more than one accessible entrance.	\$420
319864	Community Building	Parking Lot 1	Parking Space - Van	1	CALIFORNIA: A van space and adjacent van aisle are not provided.	\$840
319866	Community Building	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: The car parking stall is less than 108" wide.	\$0
319867	Community Building	Accessible Parking Space P1-A, P1-B, and P1-C	Parking Space - Car	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	\$1,260
319868	Community Building	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
319869	Community Building	Access Aisles serving P1-A, P1-B, and P1-C	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$840
319870	Community Building	Accessible Parking Spaces P1-A, P1-B and P1-C	Parking Space - Car	1	The standard car stall and/or access aisle has openings in ground surfaces greater than 1/2" wide.	\$60
319879	Community Building	Ramp R-1	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	\$13,240
319880	Community Building	Ramp R-1	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	\$3,310
319881	Community Building	Ramp R-1	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	\$7,172
319882	Community Building	Ramp R-2	Ramp	1	The ramp has a running slope in excess of 1:12 (8.33%) and/or cross slope in excess of 1:48 (2.08%).	\$18,536
319883	Community Building	Ramp R-2	Ramp	1	CALIFORNIA: The ramp run does not have edge protection or the edge protection is not compliant.	\$1,630

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319884	Community Building	Ramp R-2	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	\$1,630
319886	Community Building	Entrance ENT-1	Building Entrance - Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
319891	Community Building	Accessible Parking Spaces P1-A through P1-E	Parking Space - Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$1,400
319892	Community Building	Accessible Parking Space P1-D	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
319893	Community Building	Access Aisle serving P1-D and P1-E	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
319894	Community Building	Accessible Parking Space P1-E	Parking Space - Car	1	The standard car stall and/or access aisle has openings in ground surfaces greater than 1/2" wide.	\$200
319898	Community Building	Entrance 4 (ENT4)	Building Entrance - Door	1	The bottom of the entry door vision light is higher than 43".	\$2,600
319961	Community Building	Entrance ENT-2	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$476
321034	Community Building	Parking Lot 1	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
324709	Community Building	Ramp R-2	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	\$3,972
324713	Community Building	Entrance ENT-3	Ramp	1	The ramp is required but not provided.	\$6,620
324714	Community Building	Entrance ENT-3	Building Entrance-Door	1	The accessible door has less than 32" clear width.	\$2,480
322112	Founders Park	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
322115	Founders Park	Baseball Field	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$2,150

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322128	Founders Park	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The parallel curb ramp does not have a compliant detectable warning on the landing at the bottom of the curb ramp.	\$672
352559	Gray Building/Chamber of Commerce	1.06	Exterior Accessible Route	1	CALIFORNIA: The detectable warning for areas other than bus stop, reflecting pool, hazardous vehicular area, or track crossing is not compliant.	\$840
352561	Gray Building/Chamber of Commerce	1.10	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$9,910
352562	Gray Building/Chamber of Commerce	2.02	Interior Access Route	1	Clear widths at turning area are less than 60" minimum.	\$125
352565	Gray Building/Chamber of Commerce	2.06A	Building Entrance-Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	\$845
352566	Gray Building/Chamber of Commerce	2.06B	Interior Access Route	1	CALIFORNIA: The width of the aisle is not compliant.	\$125
352567	Gray Building/Chamber of Commerce	2.06B	Vertical Level Change	1	Vertical level changes between 1/4" and 1/2" high are not beveled or vertical level changes greater than 1/2" high are not ramped.	\$113
352570	Gray Building/Chamber of Commerce	2.07B	Building Entrance-Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$2,188
352571	Gray Building/Chamber of Commerce	2.07B	Building Entrance-Door	1	CALIFORNIA: The required fire door takes more than 8.5 pounds of pressure to operate.	\$458
352583	Heritage Park/Restroom/Concession	1.03A	Parking Space-Van	1	CALIFORNIA: A van space and adjacent van aisle are not provided.	\$1,050
352584	Heritage Park/Restroom/Concession	1.06	Curb Ramp	1	A curb ramp is not provided where the accessible route crosses a curb.	\$2,188
352585	Heritage Park/Restroom/Concession	1.06B	Exterior Accessible Route	1	CALIFORNIA: The detectable warning for areas other than bus stop, reflecting pool, hazardous vehicular area, or track crossing is not compliant.	\$840

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352586	Heritage Park/Restroom/Concession	1.10A	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$9,960
352587	Heritage Park/Restroom/Concession	1.10C	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$4,955
352588	Heritage Park/Restroom/Concession	1.10D	Parking Space-Van	1	A curb or wheel stop is not provided where needed to prevent encroachment of vehicles over the required accessible route clear width.	\$236
352589	Heritage Park/Restroom/Concession	1.10E	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$3,360
352590	Heritage Park/Restroom/Concession	1.10F	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
352591	Heritage Park/Restroom/Concession	1.10G	Blended Transition	1	CALIFORNIA: The blended transition cross slope is greater than 1:48 (2.08%).	\$2,250
352592	Heritage Park/Restroom/Concession	1.10H	Exterior Accessible Route	1	A compliant accessible route is not provided from the public access to the amenity.	\$5,600
352593	Heritage Park/Restroom/Concession	1.12A	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$560
352594	Heritage Park/Restroom/Concession	1.12B	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496
352597	Heritage Park/Restroom/Concession	1.15A	Door	1	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$366

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352599	Heritage Park/Restroom/Concession	1.15B	Building Entrance-Door	1	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$845
352614	Heritage Park/Restroom/Concession	2.23B	Exterior Accessible Route	1	A compliant accessible route is not provided from the public access to the amenity.	\$5,600
352616	Heritage Park/Restroom/Concession	2.32A	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$3,964
352618	Heritage Park/Restroom/Concession	2.33A	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$991
317517	Chaffey College IT Center	Throughout Building	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$3,640
317531	Chaffey College IT Center	Throughout Building	Door	1	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$0
317532	Chaffey College IT Center	Throughout Building	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$7,686
317544	Chaffey College IT Center	Room 102 Staff Lounge	Controls And Dispensers	1	The height of controls throughout the common area are not compliant.	\$500
317546	Chaffey College IT Center	Room 102 Staff Lounge	Controls And Dispensers	1	The height of controls throughout the common area are not compliant.	\$1,000
317823	Chino Branch Library	Room 114 and Door 107	Door	1	The hardware at the accessible door (including sliding doors - both sides) requires tight grasping, pinching or twisting of the wrist to operate OR is mounted below 34" or above 48".	\$586
317829	Chino Branch Library	Reading Room 101	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$728
317838	Chino Branch Library	Staff Workroom 115	Controls And Dispensers	1	The height of controls throughout the common area are not compliant.	\$500

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320985	Ayala Park Operations Center	Rear Entrance	Door	1	The automatic door does not comply with ANSI requirements or is not functional.	\$100
320999	Ayala Park Operations Center	Main Entrance	Door	1	The automatic door does not comply with ANSI requirements or is not functional.	\$100
324493	Ayala Park Operations Center	Exterior Service Counter	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$728
317132	Preserve Community Center	Main entrance	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$1,464
317133	Preserve Community Center	Main entrance	Door	1	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$0
317135	Preserve Community Center	Office, Gym, Reception and Activity Rooms	Door	1	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$9,150
317143	Preserve Community Center	Ramp to Stage	Ramp	1	CALIFORNIA: The ramp is less than 48" wide.	\$19,860
317151	Preserve Community Center	Ramp to Stage	Ramp	1	Ramp landings at the top and bottom of ramp runs are not compliant.	\$4,188
317504	Chaffey College Business Office	Entrance Doors	Building Entrance - Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$1,098
317669	Chaffey College/Chino Center	Room 217 Conference Room	Interior Access Route	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$250
317683	Chaffey College/Chino Center	West Stairs	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$3,260
317684	Chaffey College/Chino Center	West Stairs	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$141
317686	Chaffey College/Chino Center	East Stair	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$35

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317687	Chaffey College/Chino Center	East Exit	Door	1	The push side of the accessible door does not have the required maneuvering clearances.	\$1,250
317713	Chaffey College/Chino Center	Throughout Building	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$4,392
317721	Chaffey College/Chino Center	Room 217 Conference Room	Controls And Dispensers	1	Controls throughout the common area are not compliant.	\$0
353031	Mountain View Park/Restroom/Concession	1.02B	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$350
353032	Mountain View Park/Restroom/Concession	1.02B	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$700
353035	Mountain View Park/Restroom/Concession	1.03A	Parking Space-Van	1	CALIFORNIA: The van parking aisle is less than 96" wide, where the van stall is less than 144" wide.	\$525
353036	Mountain View Park/Restroom/Concession	1.06A	Curb Ramp	1	The curb ramp does not meet the slope requirements.	\$2,188
353037	Mountain View Park/Restroom/Concession	1.06A	Curb Ramp	1	The landing at the top of the curb ramp is not a compliant size.	\$1,611
353038	Mountain View Park/Restroom/Concession	1.06A	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$840
353043	Mountain View Park/Restroom/Concession	1.06B	Curb Ramp	1	The curb ramp does not meet the slope requirements.	\$2,188
353044	Mountain View Park/Restroom/Concession	1.06B	Curb Ramp	1	The landing at the top of the curb ramp is not a compliant size.	\$1,611

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353045	Mountain View Park/Restroom/Concession	1.06B	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$840
353050	Mountain View Park/Restroom/Concession	1.10B	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$991
353051	Mountain View Park/Restroom/Concession	1.10C	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$991
353052	Mountain View Park/Restroom/Concession	1.10D	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$500
353053	Mountain View Park/Restroom/Concession	1.10E	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$991
353054	Mountain View Park/Restroom/Concession	1.10F	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$991
353072	Mountain View Park/Restroom/Concession	1.12A	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
353073	Mountain View Park/Restroom/Concession	1.12B	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496
353074	Mountain View Park/Restroom/Concession	1.12C	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496
353075	Mountain View Park/Restroom/Concession	1.12D	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353076	Mountain View Park/Restroom/Concession	1.12E	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$198
353077	Mountain View Park/Restroom/Concession	1.12F	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
353078	Mountain View Park/Restroom/Concession	1.12G	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
353079	Mountain View Park/Restroom/Concession	1.12H	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$198
353080	Mountain View Park/Restroom/Concession	1.13A	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$910
353082	Mountain View Park/Restroom/Concession	1.21A	Stairs	1	Treads have slopes greater than 1:48.	\$96
353083	Mountain View Park/Restroom/Concession	1.21A	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$352
353085	Mountain View Park/Restroom/Concession	1.21B	Stairs	1	Stairways along the means of egress are not compliant.	\$1,050
353087	Mountain View Park/Restroom/Concession	1.22A	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	\$16,550
353090	Mountain View Park/Restroom/Concession	1.24A	Ramp	1	CALIFORNIA: The ramp run does not have edge protection or the edge protection is not compliant.	\$4,075

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353092	Mountain View Park/Restroom/Concession	1.25A	Ramp	1	The handrail height is not compliant.	\$24,450
320334	Ayala Park	Building D - Concessions	Service Counter	2	The service counter height is greater than 36" and/or the counter length is less than 36", where a parallel approach is present.	\$1,805
323969	Carolyn Owens Community Center	2.05A	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$100
323975	Carolyn Owens Community Center	2.05B	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$500
323977	Carolyn Owens Community Center	2.05C	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$2,000
323979	Carolyn Owens Community Center	2.05D	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$200
323986	Carolyn Owens Community Center	2.05E	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$100
323987	Carolyn Owens Community Center	2.05F	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$200
323990	Carolyn Owens Community Center	2.06B	Door	2	The bottom of the door vision light is higher than 43" and less than 66".	\$2,600
324590	Carolyn Owens Community Center	2.22	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$602
324591	Carolyn Owens Community Center	2.24A	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$55
324592	Carolyn Owens Community Center	2.24B	Signage	2	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$55
324593	Carolyn Owens Community Center	2.24C	Signage	2	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$55

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324594	Carolyn Owens Community Center	2.24D	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$55
324595	Carolyn Owens Community Center	2.25	Building Entrance-Door	2	CALIFORNIA: The accessible entrance does not have signage with the International Symbol of Accessibility, in the existing building where not all entrances are accessible.	\$55
324596	Carolyn Owens Community Center	2.43A	Reach Range	2	Operable parts or items requiring an obstructed forward reach motion are higher than 48" maximum height where the depth of the obstruction is 20" maximum, or greater than 44" maximum height where the depth of the obstruction is 20" to 25" maximum, or lower than minimum 15" height above finish floor.	\$200
324598	Carolyn Owens Community Center	2.43C	Reach Range	2	Items requiring an obstructed forward reach motion are higher than 48" maximum height where the depth of the obstruction is 20" maximum, or greater than 44" maximum height where the depth of the obstruction is 20" to 25" maximum, or lower than minimum 15" height above finish floor.	\$1,000
324599	Carolyn Owens Community Center	2.47	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$200
317700	Chaffey College/Chino Center	Gate G-1 and G-2	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$640
317842	Chino Branch Library	Book Return at Main Entrance	Reach Range	2	Operable parts or items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$500
321003	Ayala Park Operations Center	Batting Cages	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$160
321004	Ayala Park Operations Center	Batting Cages	Controls And Dispensers	2	Controls throughout the common area are not compliant.	\$225
321005	Ayala Park Operations Center	Batting Cages	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$728
321006	Ayala Park Operations Center	Batting Cages	Controls And Dispensers	2	Clear space is not provided at the control or operating mechanism.	\$1,982
324495	Ayala Park Operations Center	Entrance Gate	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$160

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319887	Community Building	Adjacent to ENT-2	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$250
322114	Founders Park	Gate G-1	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$160
322116	Founders Park	Walkway W-2	Clear Space	2	Clear ground space is not provided at the operable part.	\$100
322118	Founders Park	Walkway W-3	Exterior Accessible Route	2	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$2,141
322119	Founders Park	Walkway W-4	Reach Range	2	Clear ground space is not provided at the operable part.	\$100
322121	Founders Park	Playground	Stairs	2	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$528
323142	Founders Park	Men's & Women's Restrooms	Restroom/Bath room	2	CALIFORNIA: The baby changing table is not compliant.	\$1,588
352563	Gray Building/Chamber of Commerce	2.05A	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$300
352564	Gray Building/Chamber of Commerce	2.05B	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$250
352573	Gray Building/Chamber of Commerce	2.22	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$752
352574	Gray Building/Chamber of Commerce	2.25	Building Entrance-Door	2	CALIFORNIA: The non-accessible entrance does not have signage indicating the location of the nearest accessible entrance, in the existing building where not all entrances are accessible.	\$69
352595	Heritage Park/Restroom/Concession	1.14A	Reach Range	2	Operable parts or items requiring an obstructed side reach motion are higher than 48" maximum where the obstruction depth is 10" maximum, or higher than 46" maximum where the obstruction depth is between 10" and 24" and/or lower than 15" minimum height above finish floor.	\$200

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352596	Heritage Park/Restroom/Concession	1.14A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$250
352598	Heritage Park/Restroom/Concession	1.15A	Door	2	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$250
352600	Heritage Park/Restroom/Concession	2.22A	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$2,256
352615	Heritage Park/Restroom/Concession	2.24A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$200
318362	City Hall	2nd Floor Administration Department	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
318365	City Hall	Throughout Building	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$3,410
318366	City Hall	2nd Floor Administration Department	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
318367	City Hall	Central Stair	Stairs	2	CALIFORNIA: Handrails are not compliant or are not provided.	\$8,150
318368	City Hall	Throughout Building	Door	2	The bottom of the door vision light is higher than 43" and less than 66".	\$31,200

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318370	City Hall	2nd Floor Human Resources Reception	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
318371	City Hall	2nd Floor Finance, Human Resources, Community Services Conference Room	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
318376	City Hall	2nd Floor Payroll	Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
318377	City Hall	Throughout Building	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$12,376
318378	City Hall	2nd Floor Finance, Human Resources, Community Services Breakroom	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
318381	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom - Door	2	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$500
318393	City Hall	2nd Floor Finance, Human Resources, Community Services Restroom Women	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$250
318400	City Hall	2nd Floor Finance, Human Resources, Community Services North Conference Room	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318404	City Hall	2nd Floor Finance, Human Resources, Community Services Northeast Corridor	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$250
318424	City Hall	Ground Floor Lobby	Work Surface	2	The work surface height is not compliant. Knee and toe clearances are not provided.	\$1,500
318427	City Hall	Throughout Building	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$1,100
318441	City Hall	Knob Operable Parts	Controls And Dispensers	2	Controls throughout the common area are not compliant.	\$900
318442	City Hall	Ground Floor Northeast Breakroom	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
318445	City Hall	Throughout Building	Door	2	CALIFORNIA: The hardware at the accessible door is not compliant.	\$1,758
318446	City Hall	Ground Floor Lobby	Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$5,414
318447	City Hall	Ground Floor Lobby	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$0
318448	City Hall	Ground Floor Lobby	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$728
318449	City Hall	Ground Floor Lobby	Head Room	2	The height of the interior accessible route is less than 80" AFF.	\$2,500
318450	City Hall	Public Entrance Vestibule	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$800
318451	City Hall	Public Entrance	Building Entrance - Door	2	The surface of the door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$400
318458	City Hall	Basement Breakroom	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318475	City Hall	City Council Chambers	Assembly Area	2	The accessible route does not connect all elements and areas of use that are required to be accessible; including raised areas and speaker platforms	\$5,800
318476	City Hall	City Council Chambers Conference Room	Exterior Accessible Route	2	A compliant accessible route is not provided from the public access to the amenity.	\$7,500
318478	City Hall	City Council Chambers to Restrooms	Exterior Accessible Route	2	A compliant accessible route is not provided from the public access to the amenity.	\$4,480
318479	City Hall	City Council Chambers	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$1,000
322926	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Signage	2	The provided signage does not have color contrast and a non-glare finish.	\$110
317514	Chaffey College IT Center	Throughout Building	Door	2	The bottom of the door vision light is higher than 43" and less than 66".	\$18,200
317515	Chaffey College IT Center	Throughout Building	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$2,090
317516	Chaffey College IT Center	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$385
317521	Chaffey College IT Center	Restrooms Throughout Building	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$1,750
317528	Chaffey College IT Center	Classrooms Throughout Building	Assembly Area	2	An assistive listening system is required, but not provided.	\$500
317539	Chaffey College IT Center	Room 104 Student Lounge	Vending Machine	2	The vending machines have operable parts which are not within reach range.	\$3,254
317547	Chaffey College IT Center	Room 101 Corporate Room	Assembly Area	2	An assistive listening system is required, but not provided.	\$250
317821	Chino Branch Library	Room 112, 113, and 115	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$165

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317822	Chino Branch Library	Staff Lounge 113	Dispenser	2	Items requiring a reach motion, but do not have an operable part, are not within compliant reach ranges.	\$250
317828	Chino Branch Library	Staff Workroom 115	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$200
317830	Chino Branch Library	Women's and Men's Restroom 106 and 108	Restroom/Bathroom - Door	2	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$400
320980	Ayala Park Operations Center	Main Lobby	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
320983	Ayala Park Operations Center	Equipment Room	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$200
320984	Ayala Park Operations Center	Equipment Room	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$500
321001	Ayala Park Operations Center	Exterior Service Counter	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
319899	Community Building	Throughout Building	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$990
319900	Community Building	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$605
319901	Community Building	Throughout Building	Door	2	CALIFORNIA: The hardware at the accessible door is not compliant.	\$5,567
319902	Community Building	Throughout Building	Controls And Dispensers	2	The height of controls throughout the common area are not compliant.	\$2,500
319904	Community Building	Access between Stories	Elevator	2	CALIFORNIA: An elevator is required but not provided.	\$80,000
319905	Community Building	2nd Floor Hallway	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$1,456

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319907	Community Building	Throughout Building	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$1,500
319908	Community Building	Throughout Building	Door	2	The door has less than 32" clear width.	\$28,600
319925	Community Building	Throughout Building	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$4,368
319927	Community Building	Auditorium & Multipurpose Room	Door	2	Double-leaf doors are used and neither side is compliant.	\$5,200
319928	Community Building	Throughout Building	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$900
319929	Community Building	Auditorium Room	Assembly Area	2	An assistive listening system is required, but not provided.	\$5,000
319930	Community Building	Auditorium Stage	Assembly Area	2	A direct accessible route is not provided from the assembly seating area to a performance area.	\$3,885
319933	Community Building	Conference Room	Assembly Area	2	An assistive listening system is required, but not provided.	\$500
319934	Community Building	Throughout Building	Door	2	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$3,294
319935	Community Building	Throughout Building	Door	2	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$0
319936	Community Building	Ground Floor Main Corridor/Kitchen	Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
319938	Community Building	Kitchen	U-Shaped or L-Shaped Layout	2	The clearance between opposing base cabinets, counter tops, appliances or walls within kitchen work areas in a U-shaped kitchen enclosed on three sides are less than 60".	\$9,850
319939	Community Building	Kitchen	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
319940	Community Building	Kitchen	Kitchen - Counter - Public	2	A minimum 30" wide section of the counter is not a minimum height of 28" and maximum height of 34" with knee and toe clearance.	\$2,382

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319942	Community Building	Kitchen	Sink	2	The accessible sink does not have push/lever hardware.	\$555
319944	Community Building	Kitchen	Dispenser	2	Items requiring a reach motion, but do not have an operable part, are not within compliant reach ranges.	\$500
319946	Community Building	Ground Floor Main Corridor	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$250
317134	Preserve Community Center	Office, Gym, and Activity Rooms	Door	2	The bottom of the door vision light is higher than 43" and less than 66".	\$46,800
317137	Preserve Community Center	Men's Restroom	Restroom/Bath room	2	CALIFORNIA: The baby changing table is not compliant.	\$794
317145	Preserve Community Center	Staff Lounge	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$498
317499	Chaffey College Business Office	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$165
317500	Chaffey College Business Office	Breakroom	Sink	2	The accessible sink is not installed with the front of the higher of the rim or counter surface 34" maximum above finished floor.	\$720
317502	Chaffey College Business Office	Breakroom	Dispenser	2	Items requiring a reach motion, but do not have an operable part, are not within compliant reach ranges.	\$250
317667	Chaffey College/Chino Center	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$275
317671	Chaffey College/Chino Center	Room 204	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
317673	Chaffey College/Chino Center	Women's Restroom 115 and 201 and Men's Restroom 114 and 203	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$2,000
317685	Chaffey College/Chino Center	Room 209 and 210	Door	2	The bottom of the door vision light is higher than 43" and less than 66".	\$5,200

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317689	Chaffey College/Chino Center	1st Floor Classrooms	Assembly Area	2	An assistive listening system is required, but not provided.	\$500
317693	Chaffey College/Chino Center	Women's Restroom 115	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$250
353034	Mountain View Park/Restroom/Concession	1.02C	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$200
353055	Mountain View Park/Restroom/Concession	1.11A	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$560
353056	Mountain View Park/Restroom/Concession	1.11B	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$560
353058	Mountain View Park/Restroom/Concession	1.11C	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353060	Mountain View Park/Restroom/Concession	1.11D	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353061	Mountain View Park/Restroom/Concession	1.11E	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353062	Mountain View Park/Restroom/Concession	1.11F	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353063	Mountain View Park/Restroom/Concession	1.11G	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353097	Mountain View Park/Restroom/Concession	2.22A	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$2,256
353100	Mountain View Park/Restroom/Concession	2.25A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$200
353102	Mountain View Park/Restroom/Concession	3.01A	Signage	2	The existing signage is not mounted at the latch side of the door or at a compliant height.	\$69
320419	Ayala Park	Building A - Drinking Fountain	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
320421	Ayala Park	Building A - Women's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
320423	Ayala Park	Building A - Men's Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
320424	Ayala Park	Building A - Men's Restroom	Restroom/Bathroom - Urinal	3	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$1,100
320355	Ayala Park	Building B - Women's Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	\$280
320357	Ayala Park	Building B - Drinking Fountain	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320359	Ayala Park	Building B - Men's Restroom	Restroom/Bath room - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
324777	Ayala Park	Building B - Women's Restroom	Restroom/Bath room-Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
320363	Ayala Park	Building C - Men's Restroom	Restroom/Bath room - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
320366	Ayala Park	Building C - Women's Restroom	Restroom/Bath room-Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
320367	Ayala Park	Building C - Women's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
320368	Ayala Park	Building C - Women's Restroom	Restroom/Bath room - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$200
320369	Ayala Park	Building C - Women's Restroom	Restroom/Bath room - Door	3	The wheelchair stall door is not self closing.	\$293
320370	Ayala Park	Building C - Women's Restroom	Restroom/Bath room-Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	\$280
320371	Ayala Park	Building C - Women's Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$200
320372	Ayala Park	Building C - Drinking Fountain	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
320335	Ayala Park	Building D - Women's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320336	Ayala Park	Building D - Women's Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$100
320337	Ayala Park	Building D - Women's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
320338	Ayala Park	Building D - Women's Restroom	Restroom/Bathroom - Door	3	The wheelchair stall door is not self closing.	\$293
320339	Ayala Park	Building D - Men's Restroom	Restroom/Bathroom - Door	3	The wheelchair stall door is not self closing.	\$293
320340	Ayala Park	Building D - Men's Restroom	Restroom/Bathroom-Door	3	The hardware at the wheelchair stall door is not compliant.	\$586
320343	Ayala Park	Building D - Men's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
320344	Ayala Park	Building D - Men's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400
320345	Ayala Park	Building D - Men's Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$65
320395	Ayala Park	Building D - Drinking Fountain	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
324597	Carolyn Owens Community Center	2.43B	Restroom/Bathroom-Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$1,100
324600	Carolyn Owens Community Center	3.02A	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
324601	Carolyn Owens Community Center	3.02B	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324602	Carolyn Owens Community Center	3.03A	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
324603	Carolyn Owens Community Center	3.03B	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
324604	Carolyn Owens Community Center	3.03C	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
324605	Carolyn Owens Community Center	3.03D	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
324606	Carolyn Owens Community Center	3.03E	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
324607	Carolyn Owens Community Center	3.08	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The toilet stall door is not compliant.	\$1,100
317702	Chaffey College/Chino Center	Picnic Area	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
320378	Ayala Park	Picnic Shelter	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$8,000
318344	City Hall	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
317513	Chaffey College IT Center	South Entrance	Clear Space	3	Clear space is not provided at the operable part.	\$238

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319962	Community Building	Entrance ENT-1 and ENT-2	Restroom/Bathroom-Signage	3	CALIFORNIA: The International Symbol signage at the exterior entry door is not compliant.	\$220
322113	Founders Park	Walkway W-1	Clear Space	3	Clear space is not provided at the operable part.	\$100
322120	Founders Park	Picnic Shelter	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
322122	Founders Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
322124	Founders Park	Men's & Women's Restrooms	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
322125	Founders Park	Men's & Women's Restrooms	Restroom/Bathroom-Door	3	The wheelchair stall door is not self closing.	\$586
322126	Founders Park	Men's & Women's Restrooms	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
322127	Founders Park	Men's Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$65
352568	Gray Building/Chamber of Commerce	2.06C	Restroom/Bathroom-Door	3	The door has less than 32" clear width.	\$1,405
352569	Gray Building/Chamber of Commerce	2.07A	Restroom/Bathroom-Door	3	The accessible restroom entry door does not have compliant maneuvering clearances.	\$1,563
352575	Gray Building/Chamber of Commerce	3.01	Restroom/Bathroom-Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	\$138
352576	Gray Building/Chamber of Commerce	3.02	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$349
352577	Gray Building/Chamber of Commerce	3.03	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$900

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352578	Gray Building/Chamber of Commerce	3.04	Restroom/Bath room-Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$1,375
352579	Gray Building/Chamber of Commerce	3.04	Restroom/Bath room-Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$788
352580	Gray Building/Chamber of Commerce	3.04	Restroom/Bath room-Water Closet	3	The grab bars at the water closet are not compliant.	\$888
352581	Gray Building/Chamber of Commerce	3.04	Restroom/Bath room-Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	\$391
352601	Heritage Park/Restroom/Concession	2.23A	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,625
352619	Heritage Park/Restroom/Concession	3.01A	Restroom/Bath room-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$138
352620	Heritage Park/Restroom/Concession	3.02A	Restroom/Bath room-Water Closet	3	The accessible dispensers are not at compliant heights.	\$350
352621	Heritage Park/Restroom/Concession	3.03A	Restroom/Bath room-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$900
352622	Heritage Park/Restroom/Concession	3.05A	Restroom/Bath room-Water Closet	3	The grab bars at the water closet are not compliant.	\$888
352623	Heritage Park/Restroom/Concession	4.02A	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$10,000

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352624	Heritage Park/Restroom/Concession	4.02A	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$10,000
352625	Heritage Park/Restroom/Concession	4.02B	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$10,000
352626	Heritage Park/Restroom/Concession	4.02B	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$6,799
318380	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$110
318383	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0
318384	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
318385	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
318387	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom-Door	3	The hardware at the wheelchair stall door is not compliant.	\$586
318388	City Hall	2nd Floor Finance, Human Resources, Community Services Restroom Women	Restroom/Bathroom - Coat Hook	3	The coat hook is not within an allowable reach range.	\$115
318389	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	\$710

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318390	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
318391	City Hall	2nd Floor Finance, Human Resources, Community Services Restroom Women	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$200
318392	City Hall	2nd Floor Finance, Human Resources, Community Services Restroom Women	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$200
318394	City Hall	2nd Floor Finance, Human Resources, Community Services Restroom Men	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
318395	City Hall	2nd Floor Finance, Human Resources, Community Services Restroom Men	Restroom/Bathroom - Toilet Stall	3	The wheelchair stall with a wall mounted water closet, in a multi-stall restroom, is less than 60" wide and 56" deep.	\$1,368
318396	City Hall	2nd Floor Finance, Human Resources, Community Services Restroom Men	Restroom/Bathroom - Urinal	3	The urinal dimensions are not compliant.	\$935
318397	City Hall	2nd Floor Finance, Human Resources, Community Services Restrooms	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$400
318405	City Hall	2nd Floor Staff Northeast Unisex Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	\$110
318406	City Hall	2nd Floor Staff Northeast Women Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
318407	City Hall	2nd Floor Staff Northeast Unisex Restroom	Restroom/Bathroom - Door	3	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$250

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318408	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Restroom/Bath room - Lavatory	3	Pipes are not insulated.	\$130
318409	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Restroom/Bath room - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$400
318410	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$500
318411	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$500
318412	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Restroom/Bath room - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$2,200
318413	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Restroom/Bath room - Lavatory	3	CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.	\$6,000
318414	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Restroom/Bath room - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$1,260
318415	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Restroom/Bath room - Water Closet	3	The side grab bar at the water closet is not compliant.	\$710
318416	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Restroom/Bath room - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
318417	City Hall	2nd Floor Staff Northeast Women Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$200
318418	City Hall	2nd Floor Staff Northeast Women Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$250
318419	City Hall	2nd Floor Staff Northeast Women Restroom	Restroom/Bath room - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$366

PHASE ONE BARRIERS						
<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318420	City Hall	2nd Floor Staff Northeast Women & Unisex Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
318423	City Hall	Ground Floor Lobby	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$5,439
318428	City Hall	Ground Floor Staff Men & Women Restroom	Restroom/Bathroom - Door	3	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$500
318429	City Hall	Ground Floor Staff Men & Women Restroom	Restroom/Bathroom - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0
318430	City Hall	Ground Floor Staff Men & Women Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
318431	City Hall	Ground Floor Staff Men & Women Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$2,500
318432	City Hall	Ground Floor Staff Men & Women Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$1,500
318433	City Hall	Ground Floor Staff Women Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$200
318434	City Hall	Ground Floor Staff Men & Women Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$1,000
318435	City Hall	Ground Floor Staff Men & Women Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$400
318436	City Hall	Ground Floor Staff Men & Women Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
318437	City Hall	Ground Floor Staff Men & Women Restroom	Restroom/Bathroom - Toilet Stall	3	A wheelchair stall is not provided in a multi-user restroom.	\$5,500
318438	City Hall	Ground Floor Staff Men Restroom	Restroom/Bathroom - Urinal	3	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$1,100

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318439	City Hall	Ground Floor Staff Men Restroom	Restroom/Bathroom - Shelving	3	Where provided, shelves are not located within 40" - 48" above the finished floor.	\$200
318452	City Hall	Public Entrance Men & Women Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$400
318453	City Hall	Public Entrance Men & Women Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
318454	City Hall	Public Entrance Men & Women Restroom	Restroom/Bathroom - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$732
318455	City Hall	Public Entrance Men Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$0
318456	City Hall	Public Entrance Men Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
318462	City Hall	Basement Men & Women Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$110
318463	City Hall	Basement Men & Women Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
318464	City Hall	Basement Women Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$750
318465	City Hall	Basement Men & Women Restroom	Restroom/Bathroom - Locker	3	The locker area does not have accessible lockers.	\$660
318466	City Hall	Basement Men Restroom	Restroom/Bathroom-Door	3	The wheelchair stall door is not self closing.	\$293
318467	City Hall	Basement Men & Women Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$2,736

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318468	City Hall	Basement Men & Women Restroom	Restroom/Bath room - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
318469	City Hall	Basement Men & Women Restroom	Restroom/Bath room - Transfer Shower Stall	3	The transfer shower is not compliant.	\$7,280
318470	City Hall	Basement Women Restroom	Restroom/Bath room - Door	3	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$250
318471	City Hall	Basement Women Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$200
318472	City Hall	Basement Women Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$250
318474	City Hall	Basement Women Restroom	Restroom/Bath room-Door	3	The hardware at the wheelchair stall door is not compliant.	\$293
318683	City Hall	Ground Floor Staff Men Restroom	Restroom/Bath room-Urinal	3	The urinal dimensions are not compliant.	\$935
322927	City Hall	Basement Men & Women Restroom	Signage	3	The provided signage does not have color contrast and a non-glare finish.	\$110
322928	City Hall	Basement Men & Women Restroom	Restroom/Bath room-Bath Tub	3	The spray unit does not have a minimum 59" long hose	\$1,300
322929	City Hall	Basement Men & Women Restroom	Locker and Dressing Rooms	3	The locker room does not have a compliant bench.	\$1,578
322931	City Hall	Ground Floor Lobby	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$5,439
317519	Chaffey College IT Center	Restrooms Throughout Building	Restroom/Bath room - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317520	Chaffey College IT Center	Restrooms Throughout Building	Restroom/Bath room - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$2,562
317522	Chaffey College IT Center	Restrooms Throughout Building	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$0
317523	Chaffey College IT Center	Women's Restroom 304	Restroom/Bath room - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
317524	Chaffey College IT Center	Restrooms Throughout Building	Restroom/Bath room-Door	3	The hardware at the wheelchair stall door is not compliant.	\$1,465
317525	Chaffey College IT Center	Women's Restroom 304	Restroom/Bath room - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
317526	Chaffey College IT Center	Men's Restroom 303 and Women's Restroom 304	Restroom/Bath room - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$2,736
317527	Chaffey College IT Center	Men's Restroom 303	Restroom/Bath room - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
317529	Chaffey College IT Center	Women's Restroom 210	Restroom/Bath room - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
317530	Chaffey College IT Center	Unisex Restroom 111	Restroom/Bath room - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	\$110
317533	Chaffey College IT Center	Unisex Restroom 111	Restroom/Bath room - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
317534	Chaffey College IT Center	Unisex Restroom 111	Restroom/Bath room - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$200
317535	Chaffey College IT Center	Unisex Restroom 111	Restroom/Bath room - Lavatory	3	Pipes are not insulated.	\$65

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317536	Chaffey College IT Center	Unisex Restroom 111	Restroom/Bath room - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
317537	Chaffey College IT Center	Elevator	Elevator	3	A tactile, raised star minimum 2" high is not provided to the left of the floor designation on both jambs at the main elevator entry level.	\$280
317540	Chaffey College IT Center	Women's Restroom 105 and Men's Restroom 106	Restroom/Bath room - Lavatory	3	Pipes are not insulated.	\$130
317541	Chaffey College IT Center	Women's Restroom 105 and Men's Restroom 106	Restroom/Bath room-Door	3	The wheelchair stall door is not self closing.	\$586
317542	Chaffey College IT Center	Men's Restroom 106	Restroom/Bath room - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
317543	Chaffey College IT Center	Women's Restroom 105 and Men's Restroom 106	Restroom/Bath room - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
317717	Chaffey College IT Center	Restrooms Throughout Building	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$0
317824	Chino Branch Library	Staff Unisex Restroom 111	Restroom/Bath room - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
317825	Chino Branch Library	Staff Unisex Restroom 111	Restroom/Bath room - Door	3	The door has less than 32" clear width.	\$1,124
317826	Chino Branch Library	Staff Unisex Restroom 111	Restroom/Bath room - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	\$110
317827	Chino Branch Library	Staff Unisex Restroom 111	Restroom/Bath room	3	The entire restroom is not compliant due to limited room dimensions.	\$12,000
317831	Chino Branch Library	Men's Restroom 108	Restroom/Bath room - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317832	Chino Branch Library	Women's Restroom 106	Restroom/Bath room - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
317833	Chino Branch Library	Women's and Men's Restroom 106 and 108	Restroom/Bath room - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
317834	Chino Branch Library	Women's and Men's Restroom 106 and 108	Restroom/Bath room - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0
317835	Chino Branch Library	Women's and Men's Restroom 106 and 108	Restroom/Bath room-Door	3	The wheelchair stall door is not self closing.	\$586
317836	Chino Branch Library	Women's and Men's Restroom 106 and 108	Restroom/Bath room-Door	3	The hardware at the wheelchair stall door is not compliant.	\$586
317837	Chino Branch Library	Men's Restroom 108	Restroom/Bath room - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
320987	Ayala Park Operations Center	Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
320988	Ayala Park Operations Center	Women's Restroom	Restroom/Bath room-Coat Hook	3	The coat hook is not within an allowable reach range.	\$115
320989	Ayala Park Operations Center	Women's Restroom	Restroom/Bath room - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
320990	Ayala Park Operations Center	Women's Restroom	Restroom/Bath room - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0
320991	Ayala Park Operations Center	Men's Restroom	Restroom/Bath room - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
320992	Ayala Park Operations Center	Men's Restroom	Restroom/Bath room - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0
320993	Ayala Park Operations Center	Men's Restroom	Restroom/Bath room-Coat Hook	3	The coat hook is not within an allowable reach range.	\$115

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320994	Ayala Park Operations Center	Men's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
320996	Ayala Park Operations Center	Men's Restroom	Restroom/Bath room - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
320997	Ayala Park Operations Center	Women's Restroom	Restroom/Bath room - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
320998	Ayala Park Operations Center	Women's Restroom	Restroom/Bath room - Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	\$313
319903	Community Building	Ground Floor Main Corridor	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$5,439
319909	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Unisex	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	\$110
319910	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
319911	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Door	3	The door has less than 32" clear width.	\$1,124
319913	Community Building	Unisex Restroom 2nd Floor	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$250
319914	Community Building	Unisex Restroom 2nd Floor	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$250
319915	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$200
319916	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Lavatory	3	Pipes are not insulated.	\$65
319917	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Lavatory	3	The lavatory faucet hardware is not compliant.	\$555

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319918	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
319919	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Water Closet	3	The grab bars at the water closet are not compliant.	\$710
319920	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
319947	Community Building	Women's Restroom Ground Floor	Restroom/Bath room - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
319948	Community Building	Men's & Women's Restroom Ground Floor	Restroom/Bath room - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0
319949	Community Building	Men's & Women's Restroom Ground Floor	Restroom/Bath room - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
319950	Community Building	Women's Restroom Ground Floor	Dining And Work Surface	3	CALIFORNIA: The dining or work surface is not compliant.	\$2,382
319951	Community Building	Men's & Women's Restroom Ground Floor	Restroom/Bath room - Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$1,440
319952	Community Building	Women's Restroom Ground Floor	Restroom/Bath room - Lavatory	3	The lavatory faucet hardware is not compliant.	\$555
319953	Community Building	Men's & Women's Restroom Ground Floor	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$1,250
319954	Community Building	Women's Restroom Ground Floor	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$200
319955	Community Building	Women's Restroom Ground Floor	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$250

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319956	Community Building	Women's Restroom Ground Floor	Restroom/Bath room - Toilet Stall	3	A wheelchair stall is not provided in a multi-user restroom.	\$2,750
319957	Community Building	Men's Restroom Ground Floor	Restroom/Bath room - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
319958	Community Building	Men's Restroom Ground Floor	Restroom/Bath room - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$200
319959	Community Building	Men's Restroom Ground Floor	Restroom/Bath room - Urinal	3	The urinal dimensions are not compliant.	\$935
319960	Community Building	Men's Restroom Ground Floor	Restroom/Bath room - Toilet Stall	3	A wheelchair stall is not provided in a multi-user restroom.	\$2,750
324708	Community Building	Men's & Women's Restroom Ground Floor	Restroom/Bath room-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$110
324711	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
324712	Community Building	Unisex Restroom 2nd Floor	Restroom/Bath room-Water Closet	3	The water closet in a single user / unisex restroom does not have the required clearance.	\$1,368
317136	Preserve Community Center	Men's Restroom	Restroom/Bath room-Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
317138	Preserve Community Center	Women's Restroom	Restroom/Bath room	3	CALIFORNIA: The baby changing table is not compliant.	\$794
317139	Preserve Community Center	Women's Restroom	Restroom/Bath room-Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317140	Preserve Community Center	Women's Restroom	Restroom/Bath room-Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	\$280
317141	Preserve Community Center	Women's Restroom	Restroom/Bath room - Door	3	The wheelchair stall door is not self closing.	\$293
317489	Chaffey College Business Office	Men's Restroom	Restroom/Bath room - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
317490	Chaffey College Business Office	Women's Restroom	Restroom/Bath room - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
317491	Chaffey College Business Office	Men's and Women's Restroom	Restroom/Bath room - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0
317492	Chaffey College Business Office	Men's and Women's Restroom	Restroom/Bath room - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
317493	Chaffey College Business Office	Men's Restroom	Restroom/Bath room - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
317494	Chaffey College Business Office	Men's Restroom	Restroom/Bath room - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$1,100
317495	Chaffey College Business Office	Men's and Women's Restroom	Restroom/Bath room - Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$1,440
317496	Chaffey College Business Office	Men's Restroom	Restroom/Bath room - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$100
317497	Chaffey College Business Office	Women's Restroom	Restroom/Bath room - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$1,100

PHASE ONE BARRIERS						
<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317498	Chaffey College Business Office	Women's Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$100
317505	Chaffey College Business Office	Men's & Women's Restroom	Restroom/Bathroom-Door	3	The push side of the door does not have the required maneuvering clearances.	\$2,500
317672	Chaffey College/Chino Center	2nd Floor Drinking Fountains	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$5,439
317674	Chaffey College/Chino Center	Women's Restroom 201	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
317675	Chaffey College/Chino Center	Women's Restroom 115 and 201 and Men's Restroom 114 and 203	Restroom/Bathroom - Water Closet	3	The grab bars at the water closet are not compliant.	\$2,840
317676	Chaffey College/Chino Center	Women's Restroom 201 and Men's Restroom 203	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$500
317677	Chaffey College/Chino Center	Women's Restroom 115 and 201 and Men's Restroom 114 and 203	Restroom/Bathroom - Coat Hook	3	The coat hook is not within an allowable reach range.	\$460
317678	Chaffey College/Chino Center	Women's Restroom 115 and 201 and Men's Restroom 114 and 203	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$1,464
317679	Chaffey College/Chino Center	Men's Restroom 203	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
317680	Chaffey College/Chino Center	Men's Restroom 114 and 203	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$2,736
317681	Chaffey College/Chino Center	Men's Restroom 203	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317682	Chaffey College/Chino Center	Men's Restroom 114 and 203	Restroom/Bathroom-Door	3	The wheelchair stall door is not self closing.	\$586
317688	Chaffey College/Chino Center	1st Floor Drinking Fountains	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$5,439
317690	Chaffey College/Chino Center	Men's Restroom 114	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
317691	Chaffey College/Chino Center	Women's Restroom 115	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
317692	Chaffey College/Chino Center	Women's Restroom 115	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$200
317722	Chaffey College/Chino Center	2nd Floor Drinking Fountains	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$5,439
317723	Chaffey College/Chino Center	Women's Restroom 115 and 201 and Men's Restroom 114 and 203	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$0
317724	Chaffey College/Chino Center	1st Floor Drinking Fountains	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$5,439
324096	Chaffey College/Chino Center	Women's Restroom 115 and 201 and Men's Restroom 114 and 203	Restroom/Bathroom-Door	3	The hardware at the wheelchair stall door is not compliant.	\$1,172
353046	Mountain View Park/Restroom/Concession	1.10A	Exterior Accessible Route	3	The amenity is not located on an accessible route.	\$15,000

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353093	Mountain View Park/Restroom/Concession	2.06A	Restroom/Bathroom-Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$458
353095	Mountain View Park/Restroom/Concession	2.06B	Restroom/Bathroom-Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$458
353104	Mountain View Park/Restroom/Concession	3.02A	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
353105	Mountain View Park/Restroom/Concession	3.02B	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
353107	Mountain View Park/Restroom/Concession	3.02C	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory located adjacent the side wall /side partition does not have the required side clearance.	\$900
353108	Mountain View Park/Restroom/Concession	3.04A	Restroom/Bathroom-Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$788
353109	Mountain View Park/Restroom/Concession	3.08A	Restroom/Bathroom-Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$1,375
353110	Mountain View Park/Restroom/Concession	3.08B	Restroom/Bathroom-Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$1,375
353111	Mountain View Park/Restroom/Concession	3.10A	Restroom/Bathroom-Urinal	3	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$1,375
353112	Mountain View Park/Restroom/Concession	4.02A	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$10,000

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353113	Mountain View Park/Restroom/Concession	4.02B	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$10,000
320406	Ayala Park	Parking Lot 2 (A-2)	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
320420	Ayala Park	Building A - Drinking Fountain	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
324780	Ayala Park	Building A - Drinking Fountain	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$496
320358	Ayala Park	Building B - Drinking Fountain	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
324776	Ayala Park	Building B - Drinking Fountain	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
320373	Ayala Park	Building C - Drinking Fountain	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
324778	Ayala Park	Building C - Drinking Fountain	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
320396	Ayala Park	Building D - Drinking Fountain	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
323788	Carolyn Owens Community Center	1.10	Signage	4	Directional signage indicating the accessible route from accessible parking to the facility is not provided, where existing routes are both accessible and non-accessible.	\$280

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317694	Chaffey College/Chino Center	Parking Lot 1	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
320332	Ayala Park	Walkway from Parking Lot 1 to Building D	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$1,098
320375	Ayala Park	Playground	Stairs	4	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$211
320377	Ayala Park	Picnic Shelter	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
320388	Ayala Park	Walkway South of Skate Park	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
318333	City Hall	Parking Lot 1	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
318346	City Hall	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
318360	City Hall	Parking Lot 2	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
317814	Chino Branch Library	Parking Lot 1	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$560
321007	Ayala Park Operations Center	Parking Lot 1 (A-4)	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324496	Ayala Park Operations Center	Walkway from Accessible Parking	Signage	4	Directional signage indicating the accessible route from accessible parking to the facility is not provided, where existing routes are both accessible and non-accessible.	\$280
319865	Community Building	Parking Lot 1	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$560
319871	Community Building	Stairs ST-1	Stairs	4	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$141
319872	Community Building	Stairs ST-1	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$3,260
319873	Community Building	Stairs ST-2	Stairs	4	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$845
319874	Community Building	Stairs ST-3	Stairs	4	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$141
319875	Community Building	Stairs ST-3	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$4,238
319876	Community Building	Stairs ST-3	Stairs	4	Steps do not have uniform and compliant riser heights and/or tread depths.	\$4,590
319877	Community Building	Stairs ST-4	Stairs	4	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$352
319878	Community Building	Stairs ST-4	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$4,238
319885	Community Building	Stairs ST-5	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$1,630
319888	Community Building	Stairs ST-6	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$978
319889	Community Building	Entrance ENT-3	Building Entrance - Door	4	CALIFORNIA: The non-accessible entrance does not have signage indicating the location of the nearest accessible entrance, in the existing building where not all entrances are accessible.	\$55
319895	Community Building	Stairs ST-7	Stairs	4	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$246

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319896	Community Building	Stairs ST-7	Stairs	4	Steps do not have uniform and compliant riser heights and/or tread depths.	\$1,224
319897	Community Building	Stairs ST-7	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$815
322123	Founders Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$100
352572	Gray Building/Chamber of Commerce	2.11	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls are not compliant.	\$5,000
318363	City Hall	Throughout Building	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$4,000
318374	City Hall	2nd Floor Finance, Human Resources, Community Services Conference Room	Kitchen - Appliance Controls	4	Controls and/or dispensers are not within an allowable reach range.	\$1,098
318398	City Hall	West Stairwell	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$8,150
318422	City Hall	Ground Floor Lobby	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$980
318457	City Hall	Northeast Stair Ground to Basement	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$7,498
318473	City Hall	Basement Stair from Breakroom to Ground Floor	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$7,498
317518	Chaffey College IT Center	3rd Floor Drinking Fountain	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$980
317538	Chaffey College IT Center	Room 104 Student Lounge	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$980
320986	Ayala Park Operations Center	Main Lobby	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319922	Community Building	Throughout Building	Controls And Dispensers	4	CALIFORNIA: The location of electrical outlets are not compliant.	\$10,500
319923	Community Building	Stairs	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$6,520
319924	Community Building	Stairs	Stairs	4	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70
319931	Community Building	Auditorium Stage	Stairs	4	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$141
319932	Community Building	Auditorium Stage	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$5,868
319937	Community Building	Kitchen	Kitchen - Appliance Controls	4	Appliance controls cannot be operated with one hand, require tight grasping, pinching, or twisting of the wrist, or require more than 5 pounds force to operate.	\$240
324710	Community Building	Throughout Building	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls are not compliant.	\$6,000
317668	Chaffey College/Chino Center	Room 216 Breakroom	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$1,098
317670	Chaffey College/Chino Center	Room 218 and 219	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$6,588
317720	Chaffey College/Chino Center	Room 217 Conference Room	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$0
353030	Mountain View Park/Restroom/Concession	1.02A	Parking Spaces-General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$350
353098	Mountain View Park/Restroom/Concession	2.23A	Picnic Table	4	A compliant picnic table is not provided.	\$1,625
353099	Mountain View Park/Restroom/Concession	2.23B	Picnic Table	4	A compliant picnic table is not provided.	\$1,625

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320346	Ayala Park	Building D - Employee Space	Door	5	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
320347	Ayala Park	Building D - Employee Space	Door	5	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$400
320348	Ayala Park	Building D - Employee Space	Door	5	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
320349	Ayala Park	Building D - Employee Space	Building Entrance-Door	5	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$366
320350	Ayala Park	Building D - Employee Space	Building Entrance-Door	5	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$366
320352	Ayala Park	Building D - Employee Space	Reach Range	5	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$400
318348	City Hall	Staff Entrance	Building Entrance - Door	5	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$1,750
318349	City Hall	Staff Entrance	Reach Range	5	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$500
318350	City Hall	Staff Entrance	Building Entrance - Door	5	The bottom of the entry door vision light is higher than 43".	\$2,600
318361	City Hall	Staff Entrance	Building Entrance - Door	5	The threshold at the accessible door is greater than ½" in height.	\$179
318369	City Hall	2nd Floor Finance, Human Resources, Community Services Employee Entry	Door	5	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
318386	City Hall	2nd Floor Finance, Human Resources, Community Services Restroom Women	Restroom/Bath room-Door	5	The wheelchair stall door is not self closing.	\$293
318421	City Hall	2nd Floor Finance, Human Resources, Community Services Employee Entry	Door	5	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250

**PHASE ONE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318426	City Hall	Ground Floor East Corridor Staff Work Area	Dining And Work Surface	5	CALIFORNIA: The dining or work surface is not compliant.	\$2,382
318440	City Hall	Ground Floor Staff Northwest Corner	Door	5	The push side of the accessible door does not have the required maneuvering clearances.	\$1,250
					<b>Total Cost:</b>	<b>\$1,569,046</b>

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323369	Aguiar Square		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
323751	Carolyn Owens Centennial Square		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
328820	Community Garden		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
324715	Neighborhood Activity Center (NAC)	Parking Lot	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
318852	Family Services Center	Entrance Doors	Amenity Not Evaluated	0	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$0
353114	Old Schoolhouse Museum	Calabrese Architects	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
353186	Villa Park/Restroom/Concession		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
323372	Aguiar Square	1.02B	Parking Space-Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$280
323373	Aguiar Square	1.02C	Parking Space-Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$280
323374	Aguiar Square	1.03A	Parking Space-Van	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	\$420
323463	Aguiar Square	1.03A	Parking Space-Van	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	\$420
323464	Aguiar Square	1.03B	Parking Space-Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
323465	Aguiar Square	1.03C	Parking Space-Van	1	CALIFORNIA: The van aisle markings are not compliant.	\$420
323466	Aguiar Square	1.03D	Parking Space-Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
323527	Aguiar Square	1.03E	Parking Space-Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$420
323528	Aguiar Square	1.06A	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
323529	Aguiar Square	1.06A	Curb Ramp	1	CALIFORNIA: The landing at the top of the curb ramp is less than 48" long and/or does not extend the full width of the curb ramp excluding flares.	\$1,750
323530	Aguiar Square	1.06A	Curb Ramp	1	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$1,289
323531	Aguiar Square	1.06B	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323533	Aguiar Square	1.06C	Blended Transition	1	CALIFORNIA: The blended transition does not have a compliant detectable warning.	\$672
323534	Aguiar Square	1.10A	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$991
323549	Aguiar Square	1.10B	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
323550	Aguiar Square	1.10C	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$6,822
323551	Aguiar Square	1.10C	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$6,822
323552	Aguiar Square	1.10D	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$5,946
323553	Aguiar Square	1.10E	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,411
323554	Aguiar Square	1.10F	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
323555	Aguiar Square	1.12A	Floor Surface	1	Gaps in the walking surface are over 1/2" wide, or elongated gaps are not perpendicular to the path of travel.	\$198
323556	Aguiar Square	1.12B	Floor Surface	1	Gaps in the walking surface are over 1/2" wide, or elongated gaps are not perpendicular to the path of travel.	\$496
323557	Aguiar Square	1.13A	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$728
323558	Aguiar Square	1.13B	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$728
323559	Aguiar Square	1.21A	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$704
323560	Aguiar Square	1.24A	Ramp	1	CALIFORNIA: The ramp run does not have edge protection or the edge protection is not compliant.	\$3,260

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323561	Aguiar Square	1.25A	Ramp	1	CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.	\$1,630
323753	Carolyn Owens Centennial Square	1.12	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$198
323755	Carolyn Owens Centennial Square	1.21	Stairs	1	Treads have slopes greater than 1:48.	\$7,650
323756	Carolyn Owens Centennial Square	1.21	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$352
323757	Carolyn Owens Centennial Square	1.25	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$3,260
323758	Carolyn Owens Centennial Square	2.01	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$1,706
323764	Carolyn Owens Centennial Square	4.02	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$728
328821	Community Garden	1.01A	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$420
328822	Community Garden	1.03A	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$420
328823	Community Garden	1.03B	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$420
328824	Community Garden	1.10A	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$4,480
328825	Community Garden	1.12A	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$7,168
328827	Community Garden	1.15A	Gate	1	The gate hardware is not compliant.	\$200
317850	Senior Center	Loading/Unloading Area	Loading/Unloading Zone	1	An accessible passenger loading/unloading zone is not provided where a loading/unloading area is present.	\$5,153
317851	Senior Center	Loading/Unloading Area	Exterior Accessible Route	1	CALIFORNIA: The hazardous vehicular area does not have a detectable warning or the existing detectable warning is not compliant.	\$6,720

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317865	Senior Center	Patio Entrance Door	Building Entrance - Door	1	The maneuvering clearance at the accessible door is not level and clear.	\$1,250
317866	Senior Center	Patio Stairs	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$458
317869	Senior Center	Patio Ramp	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	\$9,780
317870	Senior Center	Patio Stairs	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$4,564
317871	Senior Center	Stairs ST-1, ST-2, ST-3	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$317
317872	Senior Center	Stairs ST-1, ST-2, ST-3	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$5,868
317873	Senior Center	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	\$1,750
317875	Senior Center	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$6,937
317876	Senior Center	Walkway W-2	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$11,099
317877	Senior Center	Ramp R-1	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	\$17,874
317878	Senior Center	Ramp R-1	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	\$9,454
317879	Senior Center	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The landing at the top of the curb ramp is less than 48" long and/or does not extend the full width of the curb ramp excluding flares.	\$1,750
317880	Senior Center	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
317881	Senior Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
317882	Senior Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
317883	Senior Center	Access Aisle serving P1-A and P1-B	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317884	Senior Center	Access Aisle serving P1-A and P1-B	Parking Space - Van	1	CALIFORNIA: The van aisle markings are not compliant.	\$0

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317885	Senior Center	Accessible Parking Space P1-B	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317886	Senior Center	Accessible Parking Space P1-B through P1-J	Parking Space - Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$2,520
317888	Senior Center	Accessible Parking Space P1-C	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317889	Senior Center	Access Aisle serving P1-C and P1-D	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317890	Senior Center	Access Aisle serving P1-C and P1-D	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$0
317891	Senior Center	Accessible Parking Space P1-D	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317892	Senior Center	Accessible Parking Space P1-E	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317893	Senior Center	Access Aisle serving P1-E and P1-F	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$420
317894	Senior Center	Accessible Parking Space P1-F	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317895	Senior Center	Accessible Parking Space P1-G	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317897	Senior Center	Access Aisle serving P1-G and P1-H	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317898	Senior Center	Access Aisle serving P1-G and P1-H	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$0
317899	Senior Center	Accessible Parking Space P1-H	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317900	Senior Center	Accessible Parking Space P1-I	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317901	Senior Center	Access Aisle serving P1-I and P1-J	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317902	Senior Center	Access Aisle serving P1-I and P1-J	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$0
317903	Senior Center	Accessible Parking Space P1-J	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
319599	Neighborhood Activity Center (NAC)	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$14,270
319600	Neighborhood Activity Center (NAC)	Stairs ST-1	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$106
319601	Neighborhood Activity Center (NAC)	Stairs ST-2	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$176
319602	Neighborhood Activity Center (NAC)	Stairs ST-2	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$3,912
319627	Neighborhood Activity Center (NAC)	Ramp R-1	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$79
319628	Neighborhood Activity Center (NAC)	Stairs ST-3	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$978
319630	Neighborhood Activity Center (NAC)	Walkway W-2	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,189
316597	Chino Community Garden	Ramp R-1	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	\$2,648
316598	Chino Community Garden	Access Aisle serving P1-A	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
316599	Chino Community Garden	Access Aisle serving P1-A	Parking Space-Van	1	CALIFORNIA: The van aisle markings are not compliant.	\$420
316600	Chino Community Garden	Walkway from Riverside Drive	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$758

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
316603	Chino Community Garden	Circulation Paths	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$190
316604	Chino Community Garden	Book Return	Controls And Dispensers	1	Controls throughout the common area are not compliant.	\$225
316614	Chino Community Garden	Open Picnic Area	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$228
316615	Chino Community Garden	Open Picnic Area	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$228
316616	Chino Community Garden	Garden Area	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$8,960
316617	Chino Community Garden	Garden Area Gate	Exterior Accessible Route	1	In areas along the route there are level changes of 1/2" or greater that are not ramped.	\$79
316618	Chino Community Garden	Garden Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$2,000
316619	Chino Community Garden	Garden Area	Controls And Dispensers	1	Controls throughout the common area are not compliant.	\$450
316620	Chino Community Garden	Garden Area	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$896
316621	Chino Community Garden	Utility Shed	Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
322510	Owen's Bistro	Walkway from CR-1 to Building Entrance	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$13,874
322511	Owen's Bistro	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
322512	Owen's Bistro	Access Aisle serving P1-A	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
322513	Owen's Bistro	Access Aisle serving P1-A	Parking Space - Van	1	CALIFORNIA: The van parking aisle for perpendicular and angled parking is not on the passenger side.	\$420
322514	Owen's Bistro	Access Aisle serving P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall markings are not compliant.	\$420

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322515	Owen's Bistro	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
322516	Owen's Bistro	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The landing at the top of the curb ramp is less than 48" long and/or does not extend the full width of the curb ramp excluding flares.	\$1,750
322517	Owen's Bistro	Walkway from CR-1 to Building Entrance	Exterior Accessible Route	1	CALIFORNIA: The reflecting pool does not have one of the following at the edge of the reflecting pool: railing, walls, warning curb, or a detectable warning.	\$4,000
327290	Owen's Bistro	Accessible Parking Space P1-A	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
324405	Olympic Park	Van Accessible Parking Space P1-A	Parking Space-Van	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	\$420
324406	Olympic Park	Access Aisle serving P1-A and P1-B	Parking Space-Van	1	CALIFORNIA: The van aisle markings are not compliant.	\$420
324407	Olympic Park	Access Aisle serving P1-A and P1-B	Parking Space-Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
324408	Olympic Park	Van Accessible Parking Space P1-A	Parking Space-Van	1	The van stall and/or access aisle has openings in ground surfaces greater than 1/2" wide.	\$1,168
324409	Olympic Park	Accessible Parking Space P1-B	Parking Space-Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
324410	Olympic Park	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The landing at the top of the curb ramp has a slope greater than 2%.	\$1,750
324411	Olympic Park	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
324412	Olympic Park	Walkway Northwest of Parking Lot	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$3,171
324413	Olympic Park	Walkway Northwest of Parking Lot	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$224
324414	Olympic Park	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	\$1,750
324415	Olympic Park	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$2,016
324416	Olympic Park	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp grade breaks are located on the curb ramp run or landing.	\$0
324417	Olympic Park	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The counter slopes of adjoining gutters and streets within 24" of the curb ramp are greater than 1:20 (5%).	\$0

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324418	Olympic Park	Curb Ramp CR-1	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$100
324423	Olympic Park	Walkway East of Parking Lot	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$2,180
324424	Olympic Park	Walkway East of Parking Lot	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,427
324425	Olympic Park	Trash Enclosure Ramp R-1	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	\$714
324426	Olympic Park	Trash Enclosure Ramp R-1	Ramp	1	CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.	\$652
324428	Olympic Park	Exercise Stations	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$1,120
324430	Olympic Park	Walkway along North Side of Site	Exterior Accessible Route	1	The walkway does not have a compliant turning space at a change of direction.	\$3,805
324433	Olympic Park	Walkway along North Side of Site	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,903
324434	Olympic Park	Covered Picnic Area (East)	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$218
324436	Olympic Park	Walkway along South Side of Site	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$3,171
324437	Olympic Park	Walkway along South Side of Site	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$119
324438	Olympic Park	Walkway along South Side of Site	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$224
324439	Olympic Park	Walkway at Restrooms	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$20
324440	Olympic Park	Storage/Utility Room	Building Entrance-Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324442	Olympic Park	Walkway at Restrooms	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,487
324443	Olympic Park	Walkway at Restrooms	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$238
324448	Olympic Park	Covered Picnic Area (West)	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
324449	Olympic Park	Walkway through the Center of Site	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,744
324450	Olympic Park	Walkway through the Center of Site	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$3,013
324453	Olympic Park	Walkway through the Center of Site	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$3,171
324458	Olympic Park	Tennis Courts	Building Entrance-Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	\$1,352
320029	Water Environmental Building	Gate G-1	Gate	1	The gate hardware is not compliant.	\$200
320030	Water Environmental Building	Gate G-1	Gate	1	The gate maneuvering clearance area is not compliant.	\$568
320031	Water Environmental Building	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$476
320034	Water Environmental Building	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
320035	Water Environmental Building	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking aisle is less than 96" wide, where the van stall is less than 144" wide.	\$420
320036	Water Environmental Building	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
320037	Water Environmental Building	Gate G-2	Gate	1	The gate maneuvering clearance area is not compliant.	\$568
320039	Water Environmental Building	Walkway W-2	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$320

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320040	Water Environmental Building	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp is non-compliant.	\$2,422
320041	Water Environmental Building	Entrance ENT-1	Building Entrance - Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
320042	Water Environmental Building	Gate G-3	Gate	1	The gate maneuvering clearance area is not compliant.	\$568
320044	Water Environmental Building	Entrance ENT-2	Building Entrance - Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
320045	Water Environmental Building	Gate G-4	Gate	1	The gate maneuvering clearance area is not compliant.	\$568
320047	Water Environmental Building	Stairs ST-1	Stairs	1	Stairs have open risers.	\$15,960
320048	Water Environmental Building	Stairs ST-1	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$669
320049	Water Environmental Building	Stairs ST-1	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$7,824
320050	Water Environmental Building	Entrance ENT-2	Building Entrance - Door	1	The accessible door has less than 32" clear width.	\$2,480
320051	Water Environmental Building	Entrance ENT-2	Building Entrance - Door	1	The threshold at the accessible door is greater than ½" in height.	\$179
320063	Water Environmental Building	Entrance ENT-3	Building Entrance - Door	1	The accessible door has less than 32" clear width.	\$2,480
320102	Water Environmental Building	Entrance ENT-4 and ENT-5	Building Entrance - Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$3,500
320104	Water Environmental Building	Entrance ENT-6 and ENT-7 on 2nd Floor	Building Entrance - Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	\$1,352
320105	Water Environmental Building	Entrance ENT-6 and ENT-7 on 2nd Floor	Building Entrance - Door	1	The threshold at the accessible door is greater than 1/2 inch in height.	\$358

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
321116	Water Environmental Building	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
319229	Youth Museum	Main Entrance	Building Entrance - Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
319230	Youth Museum	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$12,685
319231	Youth Museum	North Entrance/Exit	Building Entrance - Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
317592	7th Street Theater	Accessible Parking Space P1-A, P1-B, P1-C, P1-D	Parking Space - Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$1,120
317593	7th Street Theater	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317594	7th Street Theater	Access Aisle serving P1-A and P1-B	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$420
317595	7th Street Theater	Accessible Parking Space P1-B	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317596	7th Street Theater	Accessible Parking Space P1-C	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317597	7th Street Theater	Access Aisle serving P1-C and P1-D	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$0
317598	7th Street Theater	Access Aisle serving P1-C and P1-D	Parking Space - Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317599	7th Street Theater	Accessible Parking Space P1-D	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317600	7th Street Theater	Accessible Parking Space P1-E	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
317601	7th Street Theater	Accessible Parking Space P1-E	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317602	7th Street Theater	Access Aisle serving P1-E	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317603	7th Street Theater	Ramp R-1	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	\$4,634
317604	7th Street Theater	Ramp R-1	Ramp	1	CALIFORNIA: The ramp landings are not compliant.	\$3,972
317605	7th Street Theater	Ramp R-1	Ramp	1	CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.	\$652
317606	7th Street Theater	Parking Lot 2	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$200
324021	7th Street Theater	Parking Lot 1	Parking Space-Car	1	CALIFORNIA: A curb or wheelstop is not provided where needed to prevent encroachment of vehicles over the required accessible route clear width.	\$189
324023	7th Street Theater	Ramp R-1	Ramp	1	CALIFORNIA: The ramp run does not have edge protection or the edge protection is not compliant.	\$1,956
318802	Family Services Center	Parking Lot 1	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$420
318803	Family Services Center	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: The car parking stall markings are not compliant.	\$0
318804	Family Services Center	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$420
318805	Family Services Center	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$280
318806	Family Services Center	Accessible Parking Space P1-A	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
318808	Family Services Center	Entrance Doors	Building Entrance - Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	\$2,704
318809	Family Services Center	Stairs ST-1	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70
318810	Family Services Center	Stairs ST-1	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$1,630
318811	Family Services Center	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$5,351

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318812	Family Services Center	Walkway W-2	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,189
318813	Family Services Center	Walkway W-3	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
318815	Family Services Center	Throughout Building	Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	\$6,446
318818	Family Services Center	Throughout Building	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$1,750
318821	Family Services Center	Throughout Building	Controls And Dispensers	1	The height of controls throughout the common area are not compliant.	\$1,750
318827	Family Services Center	Throughout Building	Door	1	The door has less than 32" clear width.	\$31,200
318828	Family Services Center	Staff Corridor	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
318833	Family Services Center	Staff Women's Restroom	Restroom/Bathroom - Door	1	The space between two doors in a series is less than 48" clear with doors open 90 degrees.	\$1,080
318853	Family Services Center	Staff Entrance	Building Entrance - Door	1	The threshold at the accessible door is greater than 1/2" in height.	\$179
318854	Family Services Center	Staff Entrance	Building Entrance - Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
323654	Family Services Center	Accessible Parking Space P1-A	Parking Space-Car	1	CALIFORNIA: The car parking aisle slope is greater than 1:48 (2.08%).	\$5,000
323655	Family Services Center	Walkway W-1	Exterior Accessible Route	1	In areas along the route there are level changes of 1/2" or greater that are not ramped.	\$0
323659	Family Services Center	Parking Lot 1	Parking Spaces-General	1	Accessible parking spaces are not dispersed where parking serves more than one accessible entrance.	\$0
319603	Neighborhood Activity Center (NAC)	Main Entrance	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	\$3,310
319622	Neighborhood Activity Center (NAC)	Throughout Building	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$3,294
319623	Neighborhood Activity Center (NAC)	Physical Activity Room	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$728

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319625	Neighborhood Activity Center (NAC)	Gymnasium	Controls And Dispensers	1	Controls throughout the common area are not compliant.	\$225
317860	Senior Center	Auditorium	Door	1	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$0
317861	Senior Center	Auditorium	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
317863	Senior Center	Main Corridors	Controls And Dispensers	1	Controls throughout the common area are not compliant.	\$450
319233	Youth Museum	Main Entrance	Building Entrance - Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
322485	Owen's Bistro	Main Entrance	Building Entrance-Door	1	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$366
322487	Owen's Bistro	Entrance Door to Patio Area	Building Entrance-Door	1	The maneuvering clearance at the accessible door is not level and clear.	\$1,250
322488	Owen's Bistro	Entrance Door to Patio Area	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
322508	Owen's Bistro	Men's Restroom	Door	1	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$366
322509	Owen's Bistro	Men's Restroom	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
320052	Water Environmental Building	Throughout Building	Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	\$9,083
320053	Water Environmental Building	Throughout Building	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$2,912
320054	Water Environmental Building	Throughout Building	Controls And Dispensers	1	The height of controls throughout the common area are not compliant.	\$9,000
320057	Water Environmental Building	Throughout Building	Ramp	1	A ramp is required but not provided.	\$8,606
320060	Water Environmental Building	Throughout Building	Door	1	The threshold at the accessible door is greater than ½" in height.	\$716

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320061	Water Environmental Building	1st Floor Corridor	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
320062	Water Environmental Building	1st Floor Corridor at Unisex Restroom	Door	1	The door has less than 32" clear width.	\$5,200
320095	Water Environmental Building	Interior Stairs	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$141
320096	Water Environmental Building	Interior Stairs	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$6,194
320097	Water Environmental Building	Interior Stairs	Stairs	1	The rear of the stairs is open.	\$728
320101	Water Environmental Building	2nd Floor Corridor at Unisex Restroom	Door	1	The door has less than 32" clear width.	\$5,200
317607	7th Street Theater	Main Entrance	Building Entrance - Door	1	The accessible door has less than 32" clear width.	\$2,480
317659	7th Street Theater	Entrance Doors	Building Entrance - Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$1,830
353115	Old Schoolhouse Museum	1.02	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$350
353116	Old Schoolhouse Museum	1.03	Parking Space-Van	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	\$525
353117	Old Schoolhouse Museum	1.08	Exterior Accessible Route	1	CALIFORNIA: The detectable warning for areas other than bus stop, reflecting pool, hazardous vehicular area, or track crossing is not compliant.	\$840
353118	Old Schoolhouse Museum	2.01	Interior Access Route	1	CALIFORNIA: The width of the aisle is not compliant.	\$125
353119	Old Schoolhouse Museum	2.02	Interior Access Route	1	CALIFORNIA: The width of the aisle is not compliant.	\$125
353120	Old Schoolhouse Museum	2.03	Floor Surface	1	The carpet in the common area has an unstable pad or backing.	\$144

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353121	Old Schoolhouse Museum	2.04	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$910
353123	Old Schoolhouse Museum	2.06	Building Entrance-Door	1	The threshold at the accessible door is greater than ½" in height.	\$224
353124	Old Schoolhouse Museum	2.06	Door	1	CALIFORNIA: The hardware at the accessible door is not compliant.	\$366
353150	Old Schoolhouse Museum	2.13	Stairs	1	Stairways along the means of egress are not compliant.	\$1,050
353151	Old Schoolhouse Museum	2.17	Stairs	1	Handrails are not compliant.	\$1,630
355555	Old Schoolhouse Museum	2.24	Interior Accessible Route	1	Clear widths are less than 36" minimum, including protruding objects.	\$125
353189	Villa Park/Restroom/Concession	1.02B	Parking Space-Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$6,250
353190	Villa Park/Restroom/Concession	1.02B	Parking Space-Car	1	CALIFORNIA: The car aisle markings are not compliant.	\$525
353191	Villa Park/Restroom/Concession	1.09A	Curb Ramp	1	The curb ramp projects into vehicular traffic lanes, parking space, or associated access aisle.	\$2,188
353192	Villa Park/Restroom/Concession	1.10A	Exterior Accessible Route	1	A compliant accessible route is not provided from the property line to the site facilities.	\$4,480
353193	Villa Park/Restroom/Concession	1.10B	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
353194	Villa Park/Restroom/Concession	1.10C	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$991

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353195	Villa Park/Restroom/Concession	1.10D	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
353196	Villa Park/Restroom/Concession	1.10E	Exterior Accessible Route	1	A compliant accessible route is not provided from the public access to the amenity.	\$5,600
353197	Villa Park/Restroom/Concession	1.10F	Exterior Accessible Route	1	A compliant accessible route is not provided from the public access to the amenity.	\$5,600
353198	Villa Park/Restroom/Concession	1.10G	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
353199	Villa Park/Restroom/Concession	1.10H	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
353201	Villa Park/Restroom/Concession	1.12A	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$496
353202	Villa Park/Restroom/Concession	1.12B	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$496
353203	Villa Park/Restroom/Concession	1.13A	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$910
323562	Aguiar Square	2.05A	Reach Range	2	Items requiring an unobstructed forward reach motion are higher than 48" maximum or lower than 15" minimum height above finish floor.	\$500
323563	Aguiar Square	2.29A	Assembly Area	2	Assembly areas do not provide wheelchair spaces.	\$6,295
323564	Aguiar Square	2.30A	Assembly Area	2	An assistive listening system is required, but not provided.	\$250
323761	Carolyn Owens Centennial Square	2.29	Assembly Area	2	Assembly areas do not provide wheelchair spaces.	\$3,148

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323763	Carolyn Owens Centennial Square	4.02	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$409
328826	Community Garden	1.14A	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$500
317867	Senior Center	Patio Stairs	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	\$652
317868	Senior Center	Patio	Work Surface	2	The work surface height is not compliant. Knee and toe clearances are not provided.	\$1,500
316622	Chino Community Garden	Covered Picnic Area	Picnic Table	2	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$1,300
324444	Olympic Park	Play Area	Ground Surface-Poured-In-Place Rubber	2	The ground surface is damaged.	\$360
324446	Olympic Park	Covered Picnic Area (West)	Picnic Table	2	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$1,300
324452	Olympic Park	Walkway through the Center of Site	Picnic Table	2	The picnic table surface height exceeds 34" or is lower than 28" above grade.	\$1,300
320028	Water Environmental Building	Gate G-1	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$160
320038	Water Environmental Building	Gate G-2	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$160
320043	Water Environmental Building	Gate G-3	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$160
320046	Water Environmental Building	Gate G-4	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$160
318816	Family Services Center	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$220
318817	Family Services Center	Throughout Building	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$1,210
318820	Family Services Center	Throughout Building	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$750

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318839	Family Services Center	Reception	Counter	2	The sales or service counter does not have an accessible portion with maximum 36" height surface above finish floor or ground.	\$1,805
318840	Family Services Center	Breakroom	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
318845	Family Services Center	Main Corridor Men's & Women's Restroom	Restroom/Bathroom - Door	2	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$0
319608	Neighborhood Activity Center (NAC)	Men's and Women's Restroom	Restroom/Bathroom - Door	2	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$300
319612	Neighborhood Activity Center (NAC)	Throughout Building	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$990
319613	Neighborhood Activity Center (NAC)	Throughout Building	Door	2	The bottom of the door vision light is higher than 43" and less than 66".	\$36,400
319614	Neighborhood Activity Center (NAC)	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$220
319615	Neighborhood Activity Center (NAC)	Kitchen/Concession	Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
319616	Neighborhood Activity Center (NAC)	Kitchen	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
319619	Neighborhood Activity Center (NAC)	Throughout Building	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$1,500
319620	Neighborhood Activity Center (NAC)	Multipurpose Room	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
319621	Neighborhood Activity Center (NAC)	Multipurpose Room	Assembly Area	2	The assistive listening device is not compliant or is not provided.	\$1,500
319624	Neighborhood Activity Center (NAC)	Gymnasium	Assembly Area	2	An assistive listening system is required, but not provided.	\$2,250

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317854	Senior Center	Men's & Women's Restroom	Restroom/Bathroom - Door	2	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$0
317859	Senior Center	Men's & Women's Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$300
317862	Senior Center	Computer Room	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$150
317864	Senior Center	Main Corridors	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$450
317907	Senior Center	Auditorium	Assembly Area	2	An assistive listening system is required, but not provided.	\$5,250
324280	Senior Center	Men's & Women's Restroom	Operable Part	2	Clear floor space is not provided at the operable part.	\$200
319238	Youth Museum	Exhibit	Ramp	2	A ramp is required but not provided.	\$11,254
319239	Youth Museum	Throughout Building	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$1,456
319246	Youth Museum	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$165
319247	Youth Museum	Throughout Building	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$825
319248	Youth Museum	Main Corridor	Ramp	2	CALIFORNIA: The ramp railings are not compliant.	\$3,912
319249	Youth Museum	Exhibit	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$1,456
319250	Youth Museum	Throughout Building	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$1,456
319251	Youth Museum	Throughout Building	Controls And Dispensers	2	The height of controls throughout the common area are not compliant.	\$1,000
319252	Youth Museum	Main Corridor	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$1,456
319253	Youth Museum	Exhibit	Interior Access Route	2	The interior accessible route has less than 36" clear width.	\$500
319254	Youth Museum	Exhibit	Interior Access Route	2	Clear widths at turning area are less than 60" minimum.	\$0
319255	Youth Museum	Main Corridor	Interior Access Route	2	The interior accessible route has non-compliant slopes.	\$546

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319256	Youth Museum	Exhibit	Accessible Route	2	The interior accessible route has less than 36" clear width.	\$300
319257	Youth Museum	Storage Room	Door	2	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
319258	Youth Museum	Main Corridor	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$500
319259	Youth Museum	Storage/Breakroom	Accessible Route	2	A ramp is required but not provided.	\$3,972
319260	Youth Museum	Basement	Door	2	CALIFORNIA: The hardware at the accessible door is not compliant.	\$1,465
319263	Youth Museum	Basement	Door	2	The door has less than 32" clear width.	\$10,400
319267	Youth Museum	Basement	Head Room	2	The height of the interior accessible route is less than 80" AFF.	\$2,912
322486	Owen's Bistro	Bar	Dining And Work Surface	2	CALIFORNIA: The dining or work surface is not compliant.	\$3,970
322490	Owen's Bistro	Bar	Dining And Work Surface	2	CALIFORNIA: A compliant dining table is not provided.	\$2,600
320056	Water Environmental Building	Hallway Doors	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$750
320058	Water Environmental Building	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$275
320059	Water Environmental Building	Throughout Building	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$1,650
320075	Water Environmental Building	Men's and Women's Restroom	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$0
320078	Water Environmental Building	1st Floor	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
320088	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$500
320089	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Protruding Object	2	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$500
320099	Water Environmental Building	2nd Floor	Sink	2	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$65

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317608	7th Street Theater	Ticket Counter	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
317611	7th Street Theater	Concessions	Sink	2	The sink rim is higher than 34", and does not have knee and toe clearance (does not apply to mop basins, utility sinks, or bar sinks).	\$720
317613	7th Street Theater	Concessions	Dispenser	2	Items requiring a reach motion, but do not have an operable part, are not within compliant reach ranges.	\$500
317614	7th Street Theater	Concessions	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
317619	7th Street Theater	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$330
317635	7th Street Theater	Lobby	Ramp	2	CALIFORNIA: The ramp landings are not compliant.	\$7,282
317636	7th Street Theater	Theater	Ramp	2	CALIFORNIA: The ramp railings are not compliant.	\$3,423
317637	7th Street Theater	Theater	Assembly Area	2	Assembly areas do not provide wheelchair spaces.	\$6,000
317638	7th Street Theater	Theater	Assembly Area	2	The wheelchair space is not the minimum required dimensions.	\$2,000
317640	7th Street Theater	Stage	Stairs	2	CALIFORNIA: Handrails are not compliant or are not provided.	\$2,608
317641	7th Street Theater	Stage	Stairs	2	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$141
317642	7th Street Theater	Theater	Assembly Area	2	An assistive listening system is required, but not provided.	\$1,000
317643	7th Street Theater	Theater	Assembly Area	2	A direct accessible route is not provided from the assembly seating area to a performance area.	\$1,031
317644	7th Street Theater	Back of Stage	Interior Access Route	2	The accessible route does not connect all elements and areas of use that are required to be accessible; including raised areas and speaker platforms	\$5,000
317645	7th Street Theater	Back of Stage	Door	2	The push side of the accessible door does not have the required maneuvering clearances.	\$1,250

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317646	7th Street Theater	Throughout Building	Door	2	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$2,562
317647	7th Street Theater	Throughout Building	Door	2	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$0
317658	7th Street Theater	Classroom/Greenroom	Door	2	The bottom of the door vision light is higher than 43" and less than 66".	\$2,600
353122	Old Schoolhouse Museum	2.05	Reach Range	2	Items requiring an unobstructed forward reach motion are higher than 48" maximum or lower than 15" minimum height above finish floor.	\$1,250
355553	Old Schoolhouse Museum	2.05	Operable Part	2	Clear floor space is not provided at the operable part.	\$125
355554	Old Schoolhouse Museum	2.24	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$250
355556	Old Schoolhouse Museum	3.03	Sink	2	Exposed pipes lack insulation and/or sharp or abrasive surfaces are present under the sink.	\$81
353200	Villa Park/Restroom/Concession	1.11A	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353204	Villa Park/Restroom/Concession	1.14A	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353205	Villa Park/Restroom/Concession	1.14A	Reach Range	2	Operable parts or items requiring an obstructed side reach motion are higher than 48" maximum where the obstruction depth is 10" maximum, or higher than 46" maximum where the obstruction depth is between 10" and 24" and/or lower than 15" minimum height above finish floor.	\$500
353208	Villa Park/Restroom/Concession	2.24A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$200
353210	Villa Park/Restroom/Concession	2.33A	Exterior Accessible Route	2	An accessible route within the play area has not been provided.	\$9,925

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323565	Aguiar Square	4.02A	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is located on a wall or post-mounted cantilevered, but is not minimum 18" and maximum 19" in depth.	\$8,000
323759	Carolyn Owens Centennial Square	2.23	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
328829	Community Garden	4.03A	Restroom/Bathroom	3	Controls on dispensers are not compliant.	\$225
319598	Neighborhood Activity Center (NAC)	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
324420	Olympic Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is located on a wall or post-mounted cantilevered, but is not minimum 18" and maximum 19" in depth.	\$8,000
324422	Olympic Park	Walkway East of Parking Lot	Clear Space	3	Clear space is not provided at the operable part.	\$238
324429	Olympic Park	Walkway along North Side of Site	Dining Table	3	CALIFORNIA: A compliant dining table is not provided.	\$1,300
324431	Olympic Park	Walkway along North Side of Site	Clear Space	3	Clear space is not provided at the operable part.	\$238
324435	Olympic Park	Covered Picnic Area (East)	Clear Space	3	Clear space is not provided at the operable part.	\$396
324447	Olympic Park	Covered Picnic Area (West)	Clear Space	3	Clear space is not provided at the operable part.	\$238
324451	Olympic Park	Walkway through the Center of Site	Clear Space	3	Clear space is not provided at the operable part.	\$238
324455	Olympic Park	Drinking Fountain DF-2	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is located on a wall or post-mounted cantilevered, but is not minimum 18" and maximum 19" in depth.	\$8,000
324459	Olympic Park	Men's Restroom RR-1	Restroom/Bathroom-Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
324460	Olympic Park	Men's Restroom RR-1	Restroom/Bathroom-Door	3	The door has less than 32" clear width.	\$0
324461	Olympic Park	Men's Restroom RR-1	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$400

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324462	Olympic Park	Men's Restroom RR-1	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The toilet stall door is not compliant.	\$250
324464	Olympic Park	Family Restroom RR-2	Restroom/Bathroom-Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	\$110
324465	Olympic Park	Family Restroom RR-2	Restroom/Bathroom-Door	3	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$2,600
324466	Olympic Park	Family Restroom RR-2	Restroom/Bathroom-Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
324467	Olympic Park	Family Restroom RR-2	Restroom/Bathroom-Door	3	The door has less than 32" clear width.	\$0
324468	Olympic Park	Family Restroom RR-2	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
324469	Olympic Park	Family Restroom RR-2	Restroom/Bathroom-Lavatory	3	The lavatory faucet hardware is not compliant.	\$555
324470	Olympic Park	Women's Restroom RR-3	Restroom/Bathroom-Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
324471	Olympic Park	Women's Restroom RR-3	Restroom/Bathroom-Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
324472	Olympic Park	Women's Restroom RR-3	Restroom/Bathroom-Door	3	The door has less than 32" clear width.	\$0
324473	Olympic Park	Women's Restroom RR-3	Restroom/Bathroom-Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
324474	Olympic Park	Women's Restroom RR-3	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
324475	Olympic Park	Women's Restroom RR-3	Restroom/Bathroom-Door	3	The hardware at the wheelchair stall door is not compliant.	\$293
324476	Olympic Park	Women's Restroom RR-3	Restroom/Bathroom-Door	3	The door has less than 32" clear width.	\$293

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318823	Family Services Center	Staff Area	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$5,439
318825	Family Services Center	Main Corridor	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$5,439
318829	Family Services Center	Staff Women's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
318830	Family Services Center	Staff Women's Restroom	Restroom/Bathroom - Door	3	The door has less than 32" clear width.	\$2,248
318831	Family Services Center	Staff Women's Restroom	Restroom/Bathroom - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$586
318832	Family Services Center	Staff Women's Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$2,500
318834	Family Services Center	Staff Women's Restroom	Restroom/Bathroom	3	The entire restroom is not compliant due to limited room dimensions.	\$12,000
318835	Family Services Center	Staff Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
318836	Family Services Center	Staff Men's Restroom	Restroom/Bathroom - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
318837	Family Services Center	Staff Men's Restroom	Restroom/Bathroom - Door	3	The door has less than 32" clear width.	\$1,124
318838	Family Services Center	Staff Men's Restroom	Restroom/Bathroom	3	The entire restroom is not compliant due to limited room dimensions.	\$12,000
318844	Family Services Center	Main Corridor Women's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
318846	Family Services Center	Main Corridor Women's Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
318847	Family Services Center	Main Corridor Women's Restroom	Restroom/Bathroom - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318848	Family Services Center	Main Corridor Women's Restroom	Restroom/Bathroom	3	The entire restroom is not compliant due to limited room dimensions.	\$12,000
318849	Family Services Center	Main Corridor Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
318850	Family Services Center	Main Corridor Men's Restroom	Restroom/Bathroom - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
318851	Family Services Center	Main Corridor Men's Restroom	Restroom/Bathroom	3	The entire restroom is not compliant due to limited room dimensions.	\$12,000
323656	Family Services Center	Staff Men's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
323657	Family Services Center	Staff Women's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
323658	Family Services Center	Main Corridor Men's & Women's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$110
319604	Neighborhood Activity Center (NAC)	Men's and Women's Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
319605	Neighborhood Activity Center (NAC)	Men's and Women's Restroom	Restroom/Bathroom - Water Closet	3	The wheelchair stall door is not self closing.	\$586
319606	Neighborhood Activity Center (NAC)	Main Corridor	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$5,439
319607	Neighborhood Activity Center (NAC)	Men's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
319609	Neighborhood Activity Center (NAC)	Men's Restroom	Restroom/Bathroom - Urinal	3	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$1,100
319610	Neighborhood Activity Center (NAC)	Men's Restroom	Restroom/Bathroom - Coat Hook	3	The coat hook is not within an allowable reach range.	\$115
319611	Neighborhood Activity Center (NAC)	Men's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319617	Neighborhood Activity Center (NAC)	Kitchen	Sink	3	The sink faucet hardware is not compliant.	\$555
317855	Senior Center	Men's Restroom	Restroom/Bathroom - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$0
317856	Senior Center	Men's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
317857	Senior Center	Men's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
317858	Senior Center	Men's Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$630
317905	Senior Center	Women's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
317906	Senior Center	Men's & Women's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$110
318088	Senior Center	Men's & Women's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$400
319234	Youth Museum	Employee Work Area	Door	3	The accessible spring hinge door has a sweep period of less than 1.5 seconds from a 70° open position to the closed position.	\$366
319240	Youth Museum	Unisex Restrooms	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
319241	Youth Museum	Unisex Restrooms	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$1,200
319242	Youth Museum	Unisex Restrooms	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$2,736
319243	Youth Museum	Unisex Restrooms	Restroom/Bathroom - Coat Hook	3	The coat hook is not within an allowable reach range.	\$230
319244	Youth Museum	Unisex Restrooms	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 35" above finish floor to the bottom of the reflective surface, where it is not installed above a lavatory or counter.	\$400
319245	Youth Museum	Unisex Restrooms	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
319264	Youth Museum	Access to Basement	Interior Access Route	3	CALIFORNIA: An elevator is required but not provided.	\$80,000
322492	Owen's Bistro	Women's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
322493	Owen's Bistro	Women's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
322494	Owen's Bistro	Women's Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	\$355
322495	Owen's Bistro	Women's Restroom	Restroom/Bathroom-Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
322496	Owen's Bistro	Women's Restroom	Restroom/Bathroom-Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$200
322497	Owen's Bistro	Men's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$1,100
322498	Owen's Bistro	Women's Restroom	Exterior Accessible Route	3	CALIFORNIA: The accessible route does not have 80" vertical clearance.	\$200
322499	Owen's Bistro	Women's Restroom	Door	3	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$366
322500	Owen's Bistro	Women's Restroom	Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
322501	Owen's Bistro	Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
322502	Owen's Bistro	Men's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
322503	Owen's Bistro	Women's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
322504	Owen's Bistro	Men's Restroom	Restroom/Bathroom - Urinal	3	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$1,100
322505	Owen's Bistro	Men's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
322506	Owen's Bistro	Men's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322507	Owen's Bistro	Men's Restroom	Restroom/Bathroom-Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$200
327293	Owen's Bistro	Men's Restroom	Restroom/Bathroom-Door	3	The push side of the door does not have the required maneuvering clearances.	\$1,250
327296	Owen's Bistro	Women's Restroom	Restroom/Bathroom-Floor Space	3	The required turning space within the restroom is not provided.	\$100
327297	Owen's Bistro	Women's Restroom	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$100
320064	Water Environmental Building	Women's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
320065	Water Environmental Building	Women's Restroom	Restroom/Bathroom - Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
320066	Water Environmental Building	Men's and Women's Restroom	Restroom/Bathroom - Door	3	The door has less than 32" clear width.	\$2,248
320067	Water Environmental Building	Women's Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
320068	Water Environmental Building	Women's Restroom	Restroom/Bathroom - Lavatory	3	The lavatory does not have the required knee clearance.	\$720
320069	Water Environmental Building	Men's and Women's Restroom	Restroom/Bathroom - Lavatory	3	The lavatory faucet hardware is not compliant.	\$1,110
320070	Water Environmental Building	Men's and Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$750
320071	Water Environmental Building	Men's and Women's Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$400
320072	Water Environmental Building	Men's and Women's Restroom	Restroom/Bathroom - Toilet Stall	3	A wheelchair stall is not provided in a multi-user restroom.	\$5,500
320073	Water Environmental Building	Women's Restroom	Restroom/Bathroom-Floor Space	3	The required turning space within the restroom is not provided.	\$9,250
320074	Water Environmental Building	Men's Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$65

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320076	Water Environmental Building	Men's Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
320077	Water Environmental Building	Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
320079	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	\$220
320080	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Door	3	The hardware at the accessible door requires tight grasping, pinching or twisting of the wrist to operate	\$586
320081	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Door	3	The push side of the door does not have the required maneuvering clearances.	\$2,500
320082	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Door	3	The door has less than 32" clear width.	\$2,248
320083	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Shelving	3	Where provided, shelves are not located within 40" - 48" above the finished floor.	\$400
320084	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
320085	Water Environmental Building	Unisex Restroom 1st Floor	Restroom/Bathroom - Lavatory	3	The lavatory faucet hardware is not compliant.	\$555
320086	Water Environmental Building	Unisex Restroom 1st Floor	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$200
320087	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$0
320090	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$2,200
320091	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$0
320092	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$1,260
320093	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Water Closet	3	The grab bars at the water closet are not compliant.	\$1,420

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320094	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
320098	Water Environmental Building	Access from 1st to 2nd Floor	Elevator	3	CALIFORNIA: An elevator is required but not provided.	\$80,000
324543	Water Environmental Building	Men's and Women's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$110
324545	Water Environmental Building	Unisex Restroom 1st & 2nd Floor	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$110
317609	7th Street Theater	Lobby	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$5,439
317610	7th Street Theater	Lobby	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$5,439
317615	7th Street Theater	Women's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
317616	7th Street Theater	Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
317617	7th Street Theater	Men's and Women's Restroom	Restroom/Bathroom - Door	3	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$200
317618	7th Street Theater	Men's & Women's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
317620	7th Street Theater	Women's Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
317621	7th Street Theater	Men's & Women's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$500
317622	7th Street Theater	Men's & Women's Restroom	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$400
317623	7th Street Theater	Men's & Women's Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.	\$6,000

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317624	7th Street Theater	Men's & Women's Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
317625	7th Street Theater	Women's Restroom	Restroom/Bathroom - Water Closet	3	The wheelchair stall door is not self closing.	\$293
317626	7th Street Theater	Women's Restroom	Restroom/Bathroom - Water Closet	3	The hardware at the wheelchair stall door is not compliant.	\$293
317627	7th Street Theater	Women's Restroom	Restroom/Bathroom - Coat Hook	3	The coat hook is not within an allowable reach range.	\$115
317628	7th Street Theater	Women's Restroom	Restroom/Bathroom- Water Closet	3	CALIFORNIA: The wheelchair stall with out-swinging door does not have the required dimensions.	\$1,100
317629	7th Street Theater	Men's & Women's Restroom	Restroom/Bathroom - Water Closet	3	The grab bars at the water closet are not compliant.	\$2,840
317630	7th Street Theater	Men's & Women's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
317631	7th Street Theater	Men's Restroom	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
317632	7th Street Theater	Men's & Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$1,000
317633	7th Street Theater	Men's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$1,100
317648	7th Street Theater	Men's and Women's Restroom at Back of House	Restroom/Bathroom - Door	3	The force required to open the interior, hinged, non-fire door is more than 5 pounds.	\$732
317649	7th Street Theater	Women's Restroom at Back of House	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
317650	7th Street Theater	Women's Restroom at Back of House	Restroom/Bathroom - Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
317651	7th Street Theater	Men's and Women's Restroom at Back of House	Restroom/Bathroom- Door	3	The hardware at the wheelchair stall door is not compliant.	\$586

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317652	7th Street Theater	Men's and Women's Restroom at Back of House	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$2,736
317653	7th Street Theater	Women's Restroom at Back of House	Restroom/Bathroom - Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	\$313
317654	7th Street Theater	Women's Restroom at Back of House	Restroom/Bathroom - Water Closet	3	The side grab bar at the water closet is not compliant.	\$355
317655	7th Street Theater	Men's and Women's Restroom at Back of House	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
317656	7th Street Theater	Men's and Women's Restroom at Back of House	Restroom/Bathroom - Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$400
323992	7th Street Theater	Men's and Women's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$110
353149	Old Schoolhouse Museum	2.07	Restroom/Bathroom- Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,563
353152	Old Schoolhouse Museum	2.24	Restroom/Bathroom- Signage	3	The provided signage is not mounted at the latch side of the door or at a compliant height.	\$69
353153	Old Schoolhouse Museum	3.02	Restroom/Bathroom- Mirror	3	The mirror is mounted higher than 40" above finish floor to the bottom of the reflective surface, where it is installed above a lavatory or counter.	\$250
353154	Old Schoolhouse Museum	3.03	Restroom/Bathroom- Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$900
353155	Old Schoolhouse Museum	3.06	Restroom/Bathroom- Floor Space	3	The required turning space within the restroom is not provided.	\$11,563
316606	Chino Community Garden	Women's Restroom	Restroom/Bathroom - Water Closet	3	The toilet paper dispenser is not at a compliant location.	\$280
316608	Chino Community Garden	Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$93

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
316609	Chino Community Garden	Women's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
316610	Chino Community Garden	Men's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
316611	Chino Community Garden	Men's Restroom	Restroom/Bathroom- Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
316612	Chino Community Garden	Men's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$93
353206	Villa Park/Restroom/Concession	2.06	Restroom/Bathroom- Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$366
353207	Villa Park/Restroom/Concession	2.23A	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,625
353211	Villa Park/Restroom/Concession	3.02A	Restroom/Bathroom- Water Closet	3	The accessible dispensers are not at compliant heights.	\$1,400
353212	Villa Park/Restroom/Concession	303.A	Restroom/Bathroom- Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$900
353213	Villa Park/Restroom/Concession	303.A	Restroom/Bathroom- Lavatory	3	Pipes are not insulated.	\$81
353214	Villa Park/Restroom/Concession	3.04A	Restroom/Bathroom- Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$350
353215	Villa Park/Restroom/Concession	3.04B	Restroom/Bathroom- Water Closet	3	CALIFORNIA: The wheelchair stall with out-swinging door does not have the required dimensions.	\$2,750

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323371	Aguiar Square	1.02A	Parking Spaces-General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$560
323760	Carolyn Owens Centennial Square	2.25	Signage	4	Directional signage indicating the accessible route from accessible parking to the facility is not provided, where existing routes are both accessible and non-accessible.	\$280
323762	Carolyn Owens Centennial Square	4.02	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$5,440
328828	Community Garden	2.24A	Signage	4	Signage identifying the name of a permanent indoor or outdoor space does not have raised lettering and/or visual character height requirements.	\$280
317852	Senior Center	Parking Lot 1	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
318087	Senior Center	Loading/Unloading Area	Loading/Unloading Zone	4	CALIFORNIA: The loading/unloading access aisle does not have compliant signage.	\$280
319597	Neighborhood Activity Center (NAC)	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
316601	Chino Community Garden	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	The controls at the accessible drinking fountain are not compliant.	\$8,000
316602	Chino Community Garden	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	The spout and/or water flow of the lower level drinking fountain is not compliant.	\$500
327291	Owen's Bistro	Accessible Parking Space P1-A	Parking Spaces-General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
324404	Olympic Park	Parking Lot 1	Parking Spaces-General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
324419	Olympic Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$2,505

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324421	Olympic Park	Drinking Fountain DF-1	Reach Range	4	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$5,000
324427	Olympic Park	Exercise Stations	Exterior Accessible Route-Signage	4	The sign providing directional and information is noncompliant. Signs that identify, direct to or give information about accessible elements and features of a building or site, shall have a non-glare finish and contrast with their background.	\$1,400
324445	Olympic Park	Play Area	Stairs	4	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$563
324454	Olympic Park	Drinking Fountain DF-2	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$2,505
324456	Olympic Park	Drinking Fountain DF-2	Reach Range	4	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$5,000
324457	Olympic Park	Tennis Courts	Exterior Accessible Route-Signage	4	The sign providing directional and information is noncompliant. Signs that identify, direct to or give information about accessible elements and features of a building or site, shall have a non-glare finish and contrast with their background.	\$560
320032	Water Environmental Building	Parking Lot 1	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
317660	7th Street Theater	Parking Lot 1	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
318807	Family Services Center	Parking Lot 1	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
318819	Family Services Center	Throughout Building	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls are not compliant.	\$10,000
318824	Family Services Center	Main Corridor	Drinking Fountain/Water Cooler	4	The spout of the standing height drinking fountain is not between 38" minimum and 43" maximum.	\$2,505

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
318842	Family Services Center	Breakroom	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$1,098
319618	Neighborhood Activity Center (NAC)	Kitchen	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$500
319626	Neighborhood Activity Center (NAC)	Office Area	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$1,098
319235	Youth Museum	Exhibit	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$1,630
319236	Youth Museum	Exhibit	Stairs	4	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70
319237	Youth Museum	Exhibit	Stairs	4	Steps do not have uniform and compliant riser heights and/or tread depths.	\$612
319261	Youth Museum	Basement Stair	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$4,890
319262	Youth Museum	Basement Stair	Stairs	4	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70
319265	Youth Museum	Basement	Stairs	4	CALIFORNIA: Handrails are not compliant or are not provided.	\$1,630
319266	Youth Museum	Basement	Stairs	4	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70
324772	Youth Museum	Throughout Building	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls are not compliant.	\$2,000
322491	Owen's Bistro	Main Entrance	Signage	4	Means of egress signage does not have tactile lettering.	\$55
320055	Water Environmental Building	Throughout Building	Controls And Dispensers	4	CALIFORNIA: The location of electrical outlets are not compliant.	\$20,000
353187	Villa Park/Restroom/Concession	1.02A	Parking Spaces-General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$350
353188	Villa Park/Restroom/Concession	1.02B	Parking Spaces-General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$350

**PHASE TWO BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353209	Villa Park/Restroom/Concession	2.25A	Exterior Accessible Route-Signage	4	Signage on the accessible route is not compliant.	\$350
353216	Villa Park/Restroom/Concession	4.02A	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$13,599
324441	Olympic Park	Storage/Utility Room	Amenity Not Evaluated	5	The amenity cannot be accessed and, therefore, cannot be evaluated.	\$0
318814	Family Services Center	Staff Entrance	Building Entrance - Door	5	The threshold at the accessible door is greater than ½" in height.	\$179
					<b>Total Cost:</b>	<b>\$1,351,799</b>

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
328830	Cypress Trails Park/Restroom		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
324432	Monte Vista Park Recreation Center/Teen Center	Parking Lot	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
352632	Liberty Park		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
352665	McLeod Park		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
353159	Sebring Park		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
353167	Shady Grove Park/Restroom		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
353223	Walnut Park/Restroom		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
328831	Cypress Trails Park/Restroom	1.02a	Parking Space-Van	1	CALIFORNIA: The van parking aisle for perpendicular and angled parking is not on the passenger side.	\$420
328901	Cypress Trails Park/Restroom	1.09a	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
328902	Cypress Trails Park/Restroom	1.09b	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$1,344
328903	Cypress Trails Park/Restroom	1.10a	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$1,982
328904	Cypress Trails Park/Restroom	1.10b	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$4,000
328905	Cypress Trails Park/Restroom	1.12a	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$7,928
328906	Cypress Trails Park/Restroom	1.12b	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$991

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
328907	Cypress Trails Park/Restroom	1.12c	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$991
328911	Cypress Trails Park/Restroom	1.15a	Gate	1	The gate hardware is not compliant.	\$200
328912	Cypress Trails Park/Restroom	1.15b	Gate	1	The gate hardware is not compliant.	\$200
329751	Cypress Trails Park/Restroom	1.21a	Stairs	1	Stairways along the means of egress are not compliant.	\$840
329756	Cypress Trails Park/Restroom	2.33a	Exterior Accessible Route	1	CALIFORNIA: The accessible route does not have 80" vertical clearance.	\$750
317369	Discovery Park	Play Area	Stairs	1	CALIFORNIA: The transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$141
317370	Discovery Park	Playground	Exterior Accessible Route	1	CALIFORNIA: A warning curb is not provided on a walkway where the walkway edge is more than 4" above the adjacent surface.	\$1,200
317373	Discovery Park	Dog Park	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$269
316225	Liberty Park Recreation Center	Curb Ramp CR-1	Curb Ramp	1	The curb ramp projects into vehicular traffic lanes, parking space, or associated access aisle.	\$1,750
316226	Liberty Park Recreation Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
316227	Liberty Park Recreation Center	Access Aisle serving P1-A and P1-B	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
316228	Liberty Park Recreation Center	Accessible Parking Space P1-B	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
316229	Liberty Park Recreation Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: A curb or wheelstop is not provided where needed to prevent encroachment of vehicles over the required accessible route clear width.	\$189
316230	Liberty Park Recreation Center	Accessible Parking Space P1-B	Parking Space - Van	1	CALIFORNIA: A curb or wheelstop is not provided where needed to prevent encroachment of vehicles over the required accessible route clear width.	\$189

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
316231	Liberty Park Recreation Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall markings are not compliant.	\$420
316232	Liberty Park Recreation Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall is less than 108" wide.	\$420
316233	Liberty Park Recreation Center	Access Aisle serving P1-A and P1-B	Parking Space - Van	1	CALIFORNIA: The van parking aisle is less than 96" wide, where the van stall is less than 144" wide.	\$420
316234	Liberty Park Recreation Center	Accessible Parking Space P1-A	Parking Space - Van	1	Compliant signage is not provided at the van stall.	\$280
323715	Liberty Park Recreation Center	Parking Lot	Parking Space-Car	1	CALIFORNIA: A curb or wheelstop is not provided where needed to prevent encroachment of vehicles over the required accessible route clear width.	\$2,268
322464	Forest Park	Curb Ramp CR-1 through CR-8	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$5,376
322465	Forest Park	Curb Ramp CR-6	Curb Ramp	1	The curb ramp landing is not level. The slope of the curb ramp landing exceeds the maximum allowable 1:48 (2.08%).	\$1,289
322466	Forest Park	Walkway to Restrooms	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
322483	Forest Park	Walkway from CR-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
322950	Meridian Park - South	Accessible Parking Space P1-A	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
322953	Meridian Park - South	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
322954	Meridian Park - South	Access Aisle serving P1-A	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
322955	Meridian Park - South	Accessible Parking Space P1-A	Parking Space - Van	1	The van stall and/or access aisle has openings in ground surfaces greater than 1/2" wide.	\$0
322958	Meridian Park - South	Walkway from Moonspinner Street to CR-1	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,427

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322959	Meridian Park - South	Walkway from Moonspinner Street to CR-1	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,546
322960	Meridian Park - South	Walkway from Moonspinner Street to CR-1	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$714
322963	Meridian Park - South	Walkway from Moonspinner Street to CR-1	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$714
322964	Meridian Park - South	Walkway from Moonspinner Street to CR-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$2,537
322965	Meridian Park - South	Walkway West of Play Area	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,546
322966	Meridian Park - South	Walkway from Play Area to Restrooms	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$714
322969	Meridian Park - South	Walkway from Preserve Loop to CR-1	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$119
322970	Meridian Park - South	Walkway from Preserve Loop to CR-1	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,546
322971	Meridian Park - South	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
322972	Meridian Park - South	Curb Ramp CR-2	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$40
322982	Meridian Park - South	Walkway to DF-1	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$20
323018	Meridian Park - South	Walkway West of Field	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$714
323019	Meridian Park - South	Walkway West of Field	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,427

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323020	Meridian Park - South	Walkway West of Field	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$714
323021	Meridian Park - South	Walkway West of Field	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$119
323022	Meridian Park - South	Walkway West of Field	Exterior Accessible Route	1	A compliant turning space is not provided at a change of direction.	\$714
323023	Meridian Park - South	Walkway West of Field	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$119
323024	Meridian Park - South	Walkway West of Field	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$119
322736	Nature Retreat Park	Playground	Stairs	1	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$317
322705	Garden Park	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$238
322722	Garden Park	Northeast and Northwest Picnic Areas	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$1,434
322723	Garden Park	Walkway W-2	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$595
322727	Garden Park	Walkway W-4	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,189
322728	Garden Park	Walkway W-5	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,189
322729	Garden Park	Walkway W-6	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,784
322730	Garden Park	Walkway W-5	Exterior Accessible Route	1	The walkway does not have a compliant turning space at a change of direction.	\$714
320944	Monte Vista Park Recreation Center/Teen Center	Curb Ramp CR-1	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
316214	Gallery Park	Walkway from Vanderbilt Street	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$190
316215	Gallery Park	South Covered Seating Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$95
316221	Gallery Park	Play Area	Exterior Accessible Route	1	CALIFORNIA: A warning curb is not provided on a walkway where the walkway edge is more than 4" above the adjacent surface.	\$0
323653	Gallery Park	Play Area	Stairs	1	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70
323952	Hidden Hallow	Walkway from Alder Creek Street to Play Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
323953	Hidden Hallow	Walkway from Alder Creek Street to Play Area	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$496
323954	Hidden Hallow	Walkway from Alder Creek Street to Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$218
323955	Hidden Hallow	Walkway East of Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$317
323956	Hidden Hallow	Walkway East of Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
323958	Hidden Hallow	Walkway East of Play Area	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,546
323966	Hidden Hallow	Walkway West of Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
323967	Hidden Hallow	Walkway West of Play Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$99
323968	Hidden Hallow	Walkway West of Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$317

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323970	Hidden Hallow	Walkway West of Play Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$218
323971	Hidden Hallow	Walkway from Blue Spruce Street to Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
323972	Hidden Hallow	Walkway East of Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$317
323973	Hidden Hallow	Walkway East of Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
323974	Hidden Hallow	Walkway East of Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$317
323981	Hidden Hallow	West Walkway	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
323982	Hidden Hallow	West Walkway	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
323983	Hidden Hallow	West Walkway	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
323984	Hidden Hallow	West Walkway	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
323985	Hidden Hallow	West Walkway	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$99
320945	Monte Vista Park Recreation Center/Teen Center	Main Entrance	Building Entrance - Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
316591	Liberty Park Recreation Center	Entrance Doors	Door	1	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$1,600
316592	Liberty Park Recreation Center	Entrance Doors	Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$1,464
316593	Liberty Park Recreation Center	Entrance Doors	Building Entrance-Door	1	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$1,464

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
316594	Liberty Park Recreation Center	Entrance Doors	Building Entrance-Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
352633	Liberty Park	1.10A	Parking Space-Van	1	A curb or wheel stop is not provided where needed to prevent encroachment of vehicles over the required accessible route clear width.	\$236
352635	Liberty Park	1.10B	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	\$500
352636	Liberty Park	1.10B	Exterior Accessible Route	1	A compliant accessible route is not provided from the public access to the amenity.	\$2,240
352639	Liberty Park	1.10D	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	\$500
352640	Liberty Park	1.10D	Exterior Accessible Route	1	A compliant accessible route is not provided from the public access to the amenity.	\$1,120
352641	Liberty Park	1.12A	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$3,964
352642	Liberty Park	1.12B	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$3,964
352643	Liberty Park	1.12C	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$3,964
352644	Liberty Park	1.12D	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$1,982
352645	Liberty Park	1.12E	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496
352646	Liberty Park	1.12A	Exterior Accessible Route	1	The accessible route has greater than 1:20 (5%) running slope and 1:50 (2%) cross slope.	\$1,982
352647	Liberty Park	1.12G	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$3,964
352648	Liberty Park	1.12H	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,982
352649	Liberty Park	1.12I	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352650	Liberty Park	1.14A	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	\$500
352651	Liberty Park	1.14B	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$200
352655	Liberty Park	1.22A	Ramp	1	CALIFORNIA: The ramp has running slopes and/or rises in excess of 1:12.	\$828
352656	Liberty Park	1.22A	Ramp	1	CALIFORNIA: The exterior ramp railings are not compliant.	\$204
352657	Liberty Park	1.22A	Ramp	1	CALIFORNIA: The exterior ramp railings do not extend 12" horizontally above the landing beyond the top and bottom of the ramp runs and in the same direction of the ramp run.	\$815
352659	Liberty Park	1.25A	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$204
352661	Liberty Park	2.33A	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$910
352666	McLeod Park	1.01A	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$525
352667	McLeod Park	1.09A	Exterior Accessible Route	1	CALIFORNIA: The detectable warning for areas other than bus stop, reflecting pool, hazardous vehicular area, or track crossing is not compliant.	\$840
352668	McLeod Park	1.10A	Exterior Accessible Route	1	A compliant accessible route is not provided from the public access to the amenity.	\$2,240
352669	McLeod Park	1.12A	Exterior Accessible Route	1	The accessible route has running slopes greater than 1:20 (5%).	\$3,964
352670	McLeod Park	1.12B	Exterior Accessible Route	1	The surfacing of the accessible route is not compliant.	\$100
352671	McLeod Park	1.12C	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496
352672	McLeod Park	1.21A	Stairs	1	Steps do not have uniform and compliant riser heights and/or tread depths.	\$383
352673	McLeod Park	1.21B	Stairs	1	CALIFORNIA: Treads, including top and bottom treads, of the interior stair flight do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$176
352674	McLeod Park	1.21B	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$179

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320745	Monte Vista Park	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
320746	Monte Vista Park	Access Aisle serving P1-A	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
320749	Monte Vista Park	Playground	Stairs	1	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$493
323002	Meridian Park - South	Men's Restroom	Building Entrance-Door	1	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
323003	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Door	1	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$2,600
323012	Meridian Park - South	Men's Restroom	Interior Access Route	1	The interior accessible route has non-compliant slopes.	\$989
353160	Sebring Park	1.01A	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$525
353162	Sebring Park	2.03A	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$496
353163	Sebring Park	2.04A	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$910
322096	Secret Garden Park	Playground	Stairs	1	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$246
353168	Shady Grove Park/Restroom	1.02A	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$350
353169	Shady Grove Park/Restroom	1.12A	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496
353170	Shady Grove Park/Restroom	1.12B	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496
353171	Shady Grove Park/Restroom	1.12C	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353172	Shady Grove Park/Restroom	1.12D	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
353179	Shady Grove Park/Restroom	2.33B	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$910
353180	Shady Grove Park/Restroom	2.33C	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$910
353225	Walnut Park/Restroom	1.03A	Parking Space-Van	1	A van space is not provided.	\$525
353226	Walnut Park/Restroom	1.06A	Curb Ramp	1	A curb ramp is not provided where the accessible route crosses a curb.	\$2,188
353227	Walnut Park/Restroom	1.10A	Parking Space-Car	1	CALIFORNIA: A curb or wheelstop is not provided where needed to prevent encroachment of vehicles over the required accessible route clear width.	\$3,544
353228	Walnut Park/Restroom	1.10B	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$496
353229	Walnut Park/Restroom	1.10C	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
353230	Walnut Park/Restroom	1.10D	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$496
353231	Walnut Park/Restroom	1.12A	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$496
353232	Walnut Park/Restroom	1.12B	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$496
353233	Walnut Park/Restroom	1.12C	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$496
328908	Cypress Trails Park/Restroom	1.14a	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$991
328909	Cypress Trails Park/Restroom	1.14b	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
328910	Cypress Trails Park/Restroom	1.14c	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$991

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322980	Meridian Park - South	Play Area	Play Component - Play Table	2	The play table does not provide knee clearance 24" high minimum, 17" deep minimum, and 30" wide minimum, and/or the tops of rims, curbs, or other obstructions at the play table are higher than 31".	\$1,103
322737	Nature Retreat Park	Playground	Transfer System	2	The side of the transfer platform used for transfer is obstructed.	\$500
322738	Nature Retreat Park	Playground	Play Component	2	50% or more of the elevated play components are not on an accessible route.	\$50,000
322724	Garden Park	Walkway W-3	Clear Space	2	Clear ground space is not provided at the operable part.	\$238
320943	Monte Vista Park Recreation Center/Teen Center	Main Entrance	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$250
316217	Gallery Park	South Covered Seating Area	Picnic Table	2	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$1,300
316218	Gallery Park	Play Area	Transfer System	2	The transfer platform connecting to elevated play elements has a non-compliant height lower than 11" or higher than 18".	\$5,000
316219	Gallery Park	Play Area	Play Component	2	The play component requires transfer to entry points or seats, but at least one means of support is not provided.	\$5,000
316220	Gallery Park	Play Area	Ground Surface-Fibar	2	The ground surface has not been inspected and maintained regularly.	\$600
316222	Gallery Park	North Seating Area	Picnic Table	2	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$1,300
323976	Hidden Hallow	Play Area	Protruding Object	2	Protruding objects posted on two posts more than 12" apart: the lowest part of the object is over 27" or under 80" above finish floor	\$500
323978	Hidden Hallow	Play Area	Transfer System	2	The transfer platform connecting to elevated play elements has a non-compliant height lower than 11" or higher than 18".	\$5,000
323980	Hidden Hallow	Play Area	Stairs	2	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$317
320940	Monte Vista Park Recreation Center/Teen Center	Egress Doors	Signage	2	Tactile means of egress signage is not provided at the latch side of the door. (Applies to designated egress stairways, exit doors, areas of refuge)	\$220

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320941	Monte Vista Park Recreation Center/Teen Center	Throughout Building	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$385
320942	Monte Vista Park Recreation Center/Teen Center	Throughout Building	Door	2	CALIFORNIA: The hardware at the accessible door is not compliant.	\$2,637
320946	Monte Vista Park Recreation Center/Teen Center	Reception	Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
320947	Monte Vista Park Recreation Center/Teen Center	Resource Center	Door	2	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$250
320950	Monte Vista Park Recreation Center/Teen Center	Multipurpose Room	Assembly Area	2	An assistive listening system is required, but not provided.	\$500
320952	Monte Vista Park Recreation Center/Teen Center	Cafe	Sink	2	The accessible sink does not have push/lever hardware.	\$555
320953	Monte Vista Park Recreation Center/Teen Center	Cafe	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$728
320955	Monte Vista Park Recreation Center/Teen Center	Kitchen	Sink	2	Sinks do not have knee and/or toe clearance.	\$1,986
320956	Monte Vista Park Recreation Center/Teen Center	Kitchen	Sink	2	The accessible sink does not have push/lever hardware.	\$555

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320957	Monte Vista Park Recreation Center/Teen Center	Kitchen	Dispenser	2	Items requiring a reach motion, but do not have an operable part, are not within compliant reach ranges.	\$500
320958	Monte Vista Park Recreation Center/Teen Center	Kitchen	Dining And Work Surface	2	CALIFORNIA: The dining or work surface is not compliant.	\$2,382
320959	Monte Vista Park Recreation Center/Teen Center	Kitchen	Dispenser	2	Items requiring a reach motion, but do not have an operable part, are not within compliant reach ranges.	\$250
320972	Monte Vista Park Recreation Center/Teen Center	Multipurpose Room	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$728
324478	Monte Vista Park Recreation Center/Teen Center	Main Entrance	Signage	2	The provided signage does not have color contrast and a non-glare finish.	\$55
316589	Liberty Park Recreation Center	Break Room	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$200
316590	Liberty Park Recreation Center	Break Room	Reach Range	2	Items requiring an unobstructed forward reach motion are higher than 48" maximum or lower than 15" minimum height above finish floor.	\$100
352637	Liberty Park	1.10C	Exterior Accessible Route	2	An accessible route within the play area has not been provided.	\$4,963
352653	Liberty Park	1.14C	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
352654	Liberty Park	1.14D	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$280
352658	Liberty Park	1.25A	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	\$204
352660	Liberty Park	2.25A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$250
352662	Liberty Park	4.02A	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$179

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352675	McLeod Park	2.02A	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$224
352676	McLeod Park	2.02B	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$224
352677	McLeod Park	2.24A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$349
352678	McLeod Park	2.33A	Exterior Accessible Route	2	An accessible route to at least one of each type of ground component within the play area has not been provided.	\$2,240
353161	Sebring Park	1.11A	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353166	Sebring Park	2.24A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$200
322098	Secret Garden Park	Playground	Transfer System	2	The side of the transfer platform used for transfer is obstructed.	\$500
353173	Shady Grove Park/Restroom	1.14A	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353174	Shady Grove Park/Restroom	1.14B	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353175	Shady Grove Park/Restroom	1.14C	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$496
353177	Shady Grove Park/Restroom	2.25A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$200
353178	Shady Grove Park/Restroom	2.33A	Exterior Accessible Route	2	An accessible route to at least one of each type of ground component within the play area has not been provided.	\$9,925
353224	Walnut Park/Restroom	1.02A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$200
353298	Walnut Park/Restroom	2.24A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$600
353299	Walnut Park/Restroom	2.33A	Exterior Accessible Route	2	An accessible route within the play area has not been provided.	\$9,925

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
329752	Cypress Trails Park/Restroom	2.23a	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
329753	Cypress Trails Park/Restroom	2.23b	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
329754	Cypress Trails Park/Restroom	2.23c	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
329757	Cypress Trails Park/Restroom	3.02a	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$400
329758	Cypress Trails Park/Restroom	3.02b	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
329759	Cypress Trails Park/Restroom	3.02c	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
329760	Cypress Trails Park/Restroom	3.02d	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
329761	Cypress Trails Park/Restroom	4.02a	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
329762	Cypress Trails Park/Restroom	4.02b	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
329778	Cypress Trails Park/Restroom	4.02c	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$8,000
317372	Discovery Park	Dog Park	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
316238	Liberty Park Recreation Center	Women's Restroom	Building Entrance-Door	3	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
316252	Liberty Park Recreation Center	Men's Restroom	Building Entrance-Door	3	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322467	Forest Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
322481	Forest Park	Picnic Area	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
322734	Nature Retreat Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
322707	Garden Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
322709	Garden Park	West Picnic Shelter	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
322713	Garden Park	East Picnic Shelter	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
322720	Garden Park	Northwest Picnic Areas	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
322721	Garden Park	Northeast Picnic Areas	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
323314	Garden Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$8,000
323316	Garden Park	Drinking Fountain 2 (DF2)	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$8,000
323951	Hidden Hallow	Southeast Walkway	Clear Space	3	Clear space is not provided at the operable part.	\$238
323959	Hidden Hallow	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$5,439
323965	Hidden Hallow	Covered Picnic Area	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
328433	Hidden Hallow	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320960	Monte Vista Park Recreation Center/Teen Center	Restroom Lobby	Door	3	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$0
320961	Monte Vista Park Recreation Center/Teen Center	Restroom Lobby	Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
320962	Monte Vista Park Recreation Center/Teen Center	Restroom Lobby	Door	3	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar and door stops which can be 78" minimum.	\$366
320963	Monte Vista Park Recreation Center/Teen Center	Restroom Lobby	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$5,439
320964	Monte Vista Park Recreation Center/Teen Center	Women's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
320965	Monte Vista Park Recreation Center/Teen Center	Men's and Women's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$0
320966	Monte Vista Park Recreation Center/Teen Center	Men's and Women's Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$130
320967	Monte Vista Park Recreation Center/Teen Center	Women's Restroom	Restroom/Bathroom - Lavatory	3	The lavatory faucet hardware is not compliant.	\$555
320968	Monte Vista Park Recreation Center/Teen Center	Men's and Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$750
320969	Monte Vista Park Recreation Center/Teen Center	Men's and Women's Restroom	Restroom/Bathroom - Toilet Stall	3	A wheelchair stall is not provided in a multi-user restroom.	\$5,500

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320970	Monte Vista Park Recreation Center/Teen Center	Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
320971	Monte Vista Park Recreation Center/Teen Center	Men's Restroom	Restroom/Bathroom - Urinal	3	The urinal dimensions are not compliant.	\$935
316235	Liberty Park Recreation Center	Women's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
316236	Liberty Park Recreation Center	Women's Restroom	Restroom/Bathroom- Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
316237	Liberty Park Recreation Center	Women's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
316239	Liberty Park Recreation Center	Women's Restroom	Restroom/Bathroom- Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
316240	Liberty Park Recreation Center	Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
316243	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom- Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
316244	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom- Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
316245	Liberty Park Recreation Center	Men's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
316246	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom- Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
316247	Liberty Park Recreation Center	Men's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
316248	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom - Door	3	The wheelchair stall door is not self closing.	\$293
316249	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom- Door	3	The hardware at the wheelchair stall door is not compliant.	\$293

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
316250	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
316251	Liberty Park Recreation Center	Women's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
316254	Liberty Park Recreation Center	Men's Restroom	Building Entrance-Door	3	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$366
316255	Liberty Park Recreation Center	Women's Restroom	Building Entrance-Door	3	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$366
316585	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
316586	Liberty Park Recreation Center	Women's Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
316587	Liberty Park Recreation Center	Women's Restroom	Restroom/Bathroom-Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
316588	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom-Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
323712	Liberty Park Recreation Center	Men's Restroom	Door	3	CALIFORNIA: The surface of the swinging door within 10" of the finish floor or ground for the full width of the door on the push side is not smooth.	\$200
323713	Liberty Park Recreation Center	Women's Restroom	Door	3	CALIFORNIA: The surface of the swinging door within 10" of the finish floor or ground for the full width of the door on the push side is not smooth.	\$200
323714	Liberty Park Recreation Center	Women's Restroom	Restroom/Bathroom-Door	3	The push side of the door does not have the required maneuvering clearances.	\$1,250
323716	Liberty Park Recreation Center	Men's Restroom	Restroom/Bathroom-Door	3	The push side of the door does not have the required maneuvering clearances.	\$1,250
352634	Liberty Park	1.10B	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,625
352638	Liberty Park	1.10D	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,625
352663	Liberty Park	4.02A	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$10,000

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352664	Liberty Park	4.02B	Drinking Fountain/Water Cooler	3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$10,000
322985	Meridian Park - South	Women's Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
322986	Meridian Park - South	Women's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
322987	Meridian Park - South	Women's Restroom	Restroom/Bathroom - Door	3	The door does not have 80" minimum head clearance from finish floor, excluding door closer hinged bar, which can be 78" minimum.	\$2,600
322988	Meridian Park - South	Women's Restroom	Restroom/Bathroom - Door	3	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$400
322989	Meridian Park - South	Women's Restroom	Restroom/Bathroom-Door	3	The door has a projection within the clear width.	\$1,124
322990	Meridian Park - South	Women's Restroom	Building Entrance-Door	3	CALIFORNIA: Maneuvering clearance at the exterior side of the pull door with frontal approach is not level and clear.	\$1,250
322992	Meridian Park - South	Women's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$350
322994	Meridian Park - South	Women's Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$720
322995	Meridian Park - South	Women's Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.	\$3,000
322996	Meridian Park - South	Women's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
322997	Meridian Park - South	Women's Restroom	Interior Access Route	3	The interior accessible route has non-compliant slopes.	\$1,706
322999	Meridian Park - South	Women's Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$100
323000	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
323001	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323004	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Door	3	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$400
323005	Meridian Park - South	Men's Restroom	Restroom/Bathroom-Door	3	The door has a projection within the clear width.	\$1,124
323006	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
323008	Meridian Park - South	Men's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$350
323010	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Lavatory	3	The lavatory is mounted higher than 34" to the higher of the rim or counter.	\$720
323013	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
323015	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Water Closet	3	The space between the grab bar and projecting objects above the grab bar is less than 12" minimum.	\$100
323016	Meridian Park - South	Men's Restroom	Restroom/Bathroom - Water Closet	3	The rear grab bar at the water closet is not compliant.	\$355
322716	Garden Park	Men's Restroom	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
322717	Garden Park	Men's and Women's Restrooms	Restroom/Bathroom-Door	3	The wheelchair stall door is not self closing.	\$586
322718	Garden Park	Men's and Women's Restrooms	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$2,736
322719	Garden Park	Men's and Women's Restrooms	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$560
323315	Garden Park	Women's Restroom	Restroom/Bathroom	3	CALIFORNIA: The baby changing table is not compliant.	\$794
322735	Nature Retreat Park	Men's and Women's Restrooms	Restroom/Bathroom - Door	3	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$732
322469	Forest Park	Men's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
322470	Forest Park	Men's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322471	Forest Park	Men's Restroom	Restroom/Bathroom	3	CALIFORNIA: The baby changing table is not compliant.	\$794
322472	Forest Park	Men's Restroom	Restroom/Bathroom - Door	3	The wheelchair stall door is not self closing.	\$293
322474	Forest Park	Men's Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
322475	Forest Park	Men's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400
322476	Forest Park	Women's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400
322477	Forest Park	Women's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
322478	Forest Park	Women's Restroom	Restroom/Bathroom	3	CALIFORNIA: The baby changing table is not compliant.	\$794
322480	Forest Park	Women's Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
353164	Sebring Park	2.23A	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,625
353165	Sebring Park	2.23B	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,625
322094	Secret Garden Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
353176	Shady Grove Park/Restroom	2.23A	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,625
353181	Shady Grove Park/Restroom	3.02A	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$400
353182	Shady Grove Park/Restroom	3.02B	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$400
353183	Shady Grove Park/Restroom	3.04A	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$350
353234	Walnut Park/Restroom	1.16A	Restroom/Bathroom-Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$252
353235	Walnut Park/Restroom	2.23A	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$3,250

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353300	Walnut Park/Restroom	3.01A	Restroom/Bathroom-Signage	3	The provided signage is not mounted at the latch side of the door or at a compliant height.	\$138
353301	Walnut Park/Restroom	3.02A	Restroom/Bathroom-Water Closet	3	The accessible dispensers are not at compliant heights.	\$350
353302	Walnut Park/Restroom	3.04A	Restroom/Bathroom-Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$1,575
353304	Walnut Park/Restroom	3.08 A	Restroom/Bathroom-Water Closet	3	CALIFORNIA- The water closet does not have the required clear floor space.	\$2,750
329755	Cypress Trails Park/Restroom	2.25a	Signage	4	The sign has characters that are not compliant in character proportions and height.	\$280
317367	Discovery Park	Entrance Signs	Signage	4	Signage identifying a permanent outdoor space does not have visual characters which comply with the height requirements, and/or does not have raised lettering and Braille.	\$200
316257	Liberty Park Recreation Center	Drinking Fountain by Restrooms	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
316258	Liberty Park Recreation Center	Drinking Fountain by Restrooms	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
322468	Forest Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
324775	Meridian Park - South	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
322733	Nature Retreat Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322706	Garden Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
322708	Garden Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	The spout height is higher than 36" at the lower/wheelchair level drinking fountain.	\$8,000
322710	Garden Park	Playground PG-1	Stairs	4	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$246
322712	Garden Park	Playground PG-2	Stairs	4	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$352
322725	Garden Park	Drinking Fountain DF-2	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
322726	Garden Park	Drinking Fountain DF-2	Drinking Fountain/Water Cooler	4	The spout height is higher than 36" at the lower/wheelchair level drinking fountain.	\$8,000
316224	Gallery Park	Walkway West of Play Area	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$1,098
323962	Hidden Hallow	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$2,505
323963	Hidden Hallow	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	The spout and/or water flow of the lower level drinking fountain is not compliant.	\$8,000
323964	Hidden Hallow	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
320954	Monte Vista Park Recreation Center/Teen Center	Kitchen	Kitchen - Oven - Public	4	The location of the controls requires reaching across burners.	\$759
316595	Liberty Park Recreation Center	Drinking Fountain	Drinking Fountain/Water Cooler	4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$100
316596	Liberty Park Recreation Center	Drinking Fountain	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
352652	Liberty Park	1.14C	Controls And Dispensers	4	CALIFORNIA: The location of electrical outlets are not compliant.	\$625
352679	McLeod Park	4.02A	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$6,799
352680	McLeod Park	4.02A	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$3,131
352681	McLeod Park	4.02B	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$6,799
352682	McLeod Park	4.02B	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$3,131
320748	Monte Vista Park	Drinking Fountain 1 (DF1)	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
322991	Meridian Park - South	Women's Restroom	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls are not compliant.	\$500
323007	Meridian Park - South	Men's Restroom	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls are not compliant.	\$500

**PHASE THREE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322095	Secret Garden Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
322102	Secret Garden Park	Drinking Fountain DF-1	Drinking Fountain/Water Cooler	4	The spout height is higher than 36" at the lower/wheelchair level drinking fountain.	\$8,000
353184	Shady Grove Park/Restroom	4.02A	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$6,799
353185	Shady Grove Park/Restroom	4.02B	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$6,799
353305	Walnut Park/Restroom	4.02A	Drinking Fountain/Water Cooler	4	The minimum number of drinking fountains is not provided. If the minimum number is provided, two levels or a hi-lo are not provided. If more than 2 are provided, less than 50% are high or less than 50% are low.	\$6,799
322973	Meridian Park - South	Trash Enclosure	Reach Range	5	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$400
					<b>Total Cost:</b>	<b>\$605,687</b>

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324697	Central Park		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
379321	Community Building Park	Community Building Park	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
322909	Meridian Park - North	Unpaved Trail	Amenity Not Evaluated	0	The amenity is not regulated by the ADA.	\$0
356915	Oak Tree Square Park		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
319365	7th Street Park	Access to Park	Curb Ramp	1	A curb ramp is not provided where the accessible route crosses a curb.	\$1,750
319366	7th Street Park	Access to Picnic Area	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$1,935
321041	7th Street Park	On-Street Parking	Parking Space-General	1	An accessible parking space is not provided where an off-street parking facility is not provided.	\$1,120
324698	Central Park	1.03A	Parking Space-Van	1	A van space is not provided.	\$420
324699	Central Park	1.10A	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$2,688
324700	Central Park	1.10B	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$4,480
324701	Central Park	1.10C	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$1,792
324702	Central Park	1.10D	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$896
324703	Central Park	1.10E	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$896

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324704	Central Park	1.10F	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$1,792
324705	Central Park	1.12A	Exterior Accessible Route	1	In areas along the route there are level changes of 1/2" or greater that are not ramped.	\$496
319269	Classics Park	Walkway W-1	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$496
319270	Classics Park	Walkway W-2	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,487
319271	Classics Park	Playground	Stairs	1	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$282
319272	Classics Park	Labyrinth	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$4,301
319273	Classics Park	Walkway W-3	Exterior Accessible Route	1	The walkway does not have a compliant turning space at a change of direction.	\$496
319274	Classics Park	Walkway W-4	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
319275	Classics Park	Walkway W-5	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$496
379305	Community Building Park	1.12A	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$1,120
379309	Community Building Park	1.15A	Gate	1	The gate hardware is not compliant.	\$250
379310	Community Building Park	1.15A	Gate	1	The gate maneuvering clearance area is not compliant.	\$1,563
379312	Community Building Park	1.21A	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$1,223

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
379313	Community Building Park	1.21A	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$132
379320	Community Building Park	2.34A	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$896
320426	Constellation Park	Northeast Entrance	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$396
320428	Constellation Park	Southeast Entrance	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$991
320430	Constellation Park	Stone Walks	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$6,822
320432	Constellation Park	Stone Walks	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$10,233
320434	Constellation Park	Play Area	Exterior Accessible Route	1	CALIFORNIA: A warning curb is not provided on a walkway where the walkway edge is more than 4" above the adjacent surface.	\$1,680
320436	Constellation Park	Play Area	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	\$1,750
320438	Constellation Park	Play Area	Stairs	1	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$176
324071	Energy Park	Covered Picnic Area	Protruding Object	1	The free-standing post-mounted object is protruding.	\$500
324072	Energy Park	Walkway South of Center Art Installation	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,110
324073	Energy Park	Walkway South of Center Art Installation	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,189
324074	Energy Park	Walkway South of Center Art Installation	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$79

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324075	Energy Park	Walkway South of Center Art Installation	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$79
324076	Energy Park	Walkway North of Center Art Installation	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$79
324077	Energy Park	Walkway North of Center Art Installation	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$79
324078	Energy Park	Walkway North of Center Art Installation	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,031
324080	Energy Park	Walkway North of Center Art Installation	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,031
324081	Energy Park	North Spiral Walkway	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$79
324082	Energy Park	North Spiral Walkway	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$793
324083	Energy Park	North Spiral Walkway	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,031
324084	Energy Park	North Spiral Walkway	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$79
324085	Energy Park	North Spiral Walkway	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$396
324086	Energy Park	North Spiral Walkway	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$634
324087	Energy Park	North Spiral Walkway	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$317

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324088	Energy Park	North Spiral Walkway	Accessible Route	1	CALIFORNIA: A warning curb is not provided on a walkway where the walkway edge is more than 4" above the adjacent surface.	\$480
324089	Energy Park	Walkway East of Center Art Installation	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$1,110
324090	Energy Park	Walkway East of Center Art Installation	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$396
324095	Energy Park	Play Area	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$775
322105	Evergreen Park	Playground	Stairs	1	CALIFORNIA: The top of the transfer steps do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$176
322897	Harvest Park	North and South Decomposed Granite Walkway	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$717
322898	Harvest Park	North and South Decomposed Granite Walkway	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$793
322905	Harvest Park	North Decomposed Granite Walkway	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$2,867
322907	Harvest Park	North Decomposed Granite Walkway	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$224
322451	Inspiration Park	East Walkway	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$2,378
322452	Inspiration Park	Walkways throughout Park	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route is less than 48" wide.	\$15,856
324500	Lotus Park	Decomposed Granite Walkway	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has an unstable surface.	\$32,256

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324503	Lotus Park	Paved Walkway	Exterior Accessible Route	1	CALIFORNIA: The slopes of the exterior accessible route are not compliant.	\$1,842
322911	Meridian Park - North	Walkway At Basketball Court	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$1,110
322912	Meridian Park - North	Park Loop	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$2,973
322913	Meridian Park - North	Park Loop	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$496
322914	Meridian Park - North	Park Loop	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,487
322915	Meridian Park - North	Walkway from P1-A	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$99
322916	Meridian Park - North	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
322917	Meridian Park - North	Access Aisle serving P1-A	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
322918	Meridian Park - North	Access Aisle serving P1-A	Parking Space - Van	1	The van aisle is not compliant.	\$420
322919	Meridian Park - North	Park Loop	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$496
322920	Meridian Park - North	Walkway to Basketball Court	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
322921	Meridian Park - North	Walkway At Basketball Court	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$502

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322922	Meridian Park - North	Walkway to Basketball Court	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,982
322437	Mulberry Park	West Walkway from Weatherwood Street	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$1,586
322439	Mulberry Park	Covered Picnic Area	Exterior Accessible Route	1	CALIFORNIA: A warning curb is not provided on a walkway where the walkway edge is more than 4" above the adjacent surface.	\$480
322445	Mulberry Park	Covered Picnic Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$3,411
326889	Mulberry Park	On-Street Parking	Parking Space-General	1	An accessible parking space is not provided where an off-street parking facility is not provided.	\$1,120
356916	Oak Tree Square Park	1.12A	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
356917	Oak Tree Square Park	1.12B	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$3,964
356918	Oak Tree Square Park	1.12C	Exterior Accessible Route	1	The accessible route has areas of vertical level changes in excess of 1/4" that are not beveled or ramped.	\$496
322887	Symphony Park	Walkway from Desales and Hilbert Street to Picnic Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$238
322889	Symphony Park	Music/Art Structure	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70
322891	Symphony Park	Stage	Stairs	1	CALIFORNIA: The top of the stair flight and all stair treads do not have a stripe which provides visual contrast of dark-on-light or light-on-dark distinguished from the remainder of the surface.	\$70

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322892	Symphony Park	Stage	Stairs	1	CALIFORNIA: Handrails are not compliant or are not provided.	\$1,956
322893	Symphony Park	Xylophone Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$238
322895	Symphony Park	Drums Area	Exterior Accessible Route	1	Sidewalk has areas of vertical level changes in excess of 1/4" that are not ramped.	\$79
322896	Symphony Park	Xylophone Area	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$224
324706	Central Park	2.23A	Dining And Work Surface	2	CALIFORNIA: The dining or work surface is not compliant.	\$794
379306	Community Building Park	1.14A	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$280
379307	Community Building Park	1.14B	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$280
379308	Community Building Park	1.14C	Exterior Accessible Route	2	Clear ground space is not provided at the operable part.	\$313
379311	Community Building Park	1.15A	Gate	2	The gate does not have a smooth surface within 10" of the ground.	\$200
379314	Community Building Park	2.23A	Picnic Table	2	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$1,625
379315	Community Building Park	2.23B	Picnic Table	2	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$1,625
379316	Community Building Park	2.25A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$581
379317	Community Building Park	2.33A	Exterior Accessible Route	2	The ground level accessible route connecting play components is less than 44" width, and the playground size is less than 1000 SF.	\$3,750
379318	Community Building Park	2.33B	Exterior Accessible Route	2	The ground level accessible route connecting play components is less than 44" width, and the playground size is less than 1000 SF.	\$2,500
379319	Community Building Park	2.33B	Play Component	2	The number of existing types of ground level components is less than the required minimum.	\$6,250
320433	Constellation Park	Pet Waste Station	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$200
320435	Constellation Park	Playground	Ground Surface - Fibar	2	The ground surface has not been inspected and maintained regularly.	\$250

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324912	Constellation Park	Playground	Transfer System	2	A means of support is not provided at the transfer platform and/or transfer steps.	\$825
324091	Energy Park	Drinking Fountain DF-1	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$5,000
324094	Energy Park	Play Area	Play Component-Swing	2	A compliant turning space is not provided at a school-age swing.	\$750
322449	Inspiration Park	Stairs ST-1	Stairs	2	CALIFORNIA: The stair handrail extensions are not compliant.	\$326
322458	Inspiration Park	Picnic Area	Picnic Table	2	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$1,300
324507	Lotus Park	Drinking Fountain DF-1	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$5,000
322438	Mulberry Park	Pet Waste Dispenser	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$200
322447	Mulberry Park	Covered Picnic Area	Picnic Table	2	The picnic table does not allow a clear space for forward wheelchair approach with knee and toe clearance.	\$1,300
356920	Oak Tree Square Park	2.25A	Signage	2	Signs or bulletin boards are not located within the height and viewing distance requirements for the size of visual characters.	\$200
322888	Symphony Park	Music/Art Structure	Exterior Accessible Route	2	An accessible route within the play area has not been provided.	\$2,875
322890	Symphony Park	Stage	Assembly Area	2	An accessible route does not connect the assembly area wheelchair spaces with performing areas.	\$2,522
319367	7th Street Park	Picnic Area	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
324070	Energy Park	Covered Picnic Area	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,300
324079	Energy Park	Walkway North of Center Art Installation	Clear Space	3	Clear space is not provided at the operable part.	\$238
324093	Energy Park	Drinking Fountain DF-1	Drinking Fountain/Water C	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
322104	Evergreen Park	Walkway 1 (W1)	Clear Space	3	Clear space is not provided at the operable part.	\$238

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
322107	Evergreen Park	Drinking Fountain DF-1	Drinking Fountain/Water	C3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
322131	Golden Tree Park	Drinking Fountain DF-1	Drinking Fountain/Water	C3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
322901	Harvest Park	Drinking Fountain DF-1	Drinking Fountain/Water	C3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
324502	Lotus Park	Pet Waste Bag Dispenser	Clear Space	3	Clear space is not provided at the operable part.	\$108
324505	Lotus Park	Drinking Fountain DF-1	Drinking Fountain/Water	C3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
324506	Lotus Park	Drinking Fountain DF-1	Drinking Fountain/Water	C3	CALIFORNIA: The drinking fountain is located on a wall or post-mounted cantilevered, but is not minimum 18" and maximum 19" in depth.	\$8,000
322910	Meridian Park - North	Drinking Fountain DF-1	Drinking Fountain/Water	C3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
322443	Mulberry Park	Drinking Fountain DF-1	Drinking Fountain/Water	C3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
356919	Oak Tree Square Park	2.23A	Picnic Table	3	CALIFORNIA: A compliant picnic table is not provided.	\$1,625
356922	Oak Tree Square Park	4.02A	Drinking Fountain/Water	C3	CALIFORNIA: The minimum number of drinking fountains is not provided.	\$10,000
327690	Symphony Park	Drinking Fountain DF-1	Drinking Fountain/Water	C3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000

**PHASE FOUR BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
324707	Central Park	2.25A	Signage	4	The sign has characters that are not compliant in character proportions and height.	\$280
324092	Energy Park	Drinking Fountain DF-1	Drinking Fountain/Water	C4	Knee and toe clearance is not provided at the lower level fountain.	\$2,505
322108	Evergreen Park	Drinking Fountain DF-1	Drinking Fountain/Water	C4	The minimum number and types of drinking fountains are not provided.	\$8,000
322109	Evergreen Park	Drinking Fountain 1 (DF1)	Drinking Fountain/Water	C4	The spout height is higher than 36" at the lower/wheelchair level drinking fountain.	\$8,000
322903	Harvest Park	Playground	Play Component	4	The play component which has manipulative or interactive features that require reaching is not within the child's reach range.	\$5,000
322450	Inspiration Park	Pet waste station	Controls And Dispensers	4	Controls and/or dispensers are not within an allowable reach range.	\$200
324501	Lotus Park	Garden Signs	Exterior Accessible Route-S	4	Signage with visual lettering is located lower than 40" from the finish floor or ground.	\$1,680
324504	Lotus Park	Drinking Fountain DF-1	Drinking Fountain/Water	C4	Knee and toe clearance is not provided at the lower level fountain.	\$0
322442	Mulberry Park	Drinking Fountain DF-1	Drinking Fountain/Water	C4	A clear space is not positioned at the lower level drinking fountain for a forward approach and centered on the unit.	\$238
322444	Mulberry Park	Drinking Fountain DF-1	Drinking Fountain/Water	C4	The minimum number and types of drinking fountains are not provided.	\$8,000
					<b>Total Cost:</b>	<b>\$325,792</b>

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
329779	Fire Station #1 & Training Center Facility		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
352416	Fire Station #5		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
353655	Fire Station #63		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
353639	Fire Station #7		Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
323311	Police Department	Police Station - New	Amenity Not Evaluated	0	The building amenity is evaluated under its separate building components.	\$0
317375	Public Works Services Center	Walkway from Schaefer Avenue to Main Office	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided from the bus stop and its alighting area to adjacent sidewalks, paths, and streets.	\$2,867
317376	Public Works Services Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The van parking stall slope is greater than 1:48 (2.08%).	\$6,300
317377	Public Works Services Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$280
317378	Public Works Services Center	Access Aisle serving P1-A and P1-B	Parking Space - Van	1	CALIFORNIA: The van parking aisle slope is greater than 1:48 (2.08%).	\$5,000
317380	Public Works Services Center	Accessible Parking Space P1-A	Parking Space - Van	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	\$420
317381	Public Works Services Center	Accessible Parking Space P1-B	Parking Space - Car	1	CALIFORNIA: The parking stall is less than the required minimum length of 216" (18').	\$420
317382	Public Works Services Center	Accessible Parking Space P1-B	Parking Space - Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$6,300
317383	Public Works Services Center	Walkway at Main Office	Exterior Accessible Route	1	CALIFORNIA: The exterior accessible route has slopes in excess of maximum 1:20 (5%) running slope and/or maximum 1:48 (2.08)% cross slope.	\$23,839
317384	Public Works Services Center	Walkway at Main Office	Exterior Accessible Route	1	The accessible route has gaps in the surface greater than 1/2" wide.	\$0
317387	Public Works Services Center	Main Office - Entrance Door	Building Entrance-Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$1,750

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317388	Public Works Services Center	Side Gate	Gate	1	The gate does not have a smooth surface within 10" of the ground.	\$160
317389	Public Works Services Center	Side Gate	Gate	1	The force required to open the gate is more than 5 pounds.	\$366
317420	Public Works Services Center	Warehouse - Entrance Doors	Building Entrance-Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$10,500
317457	Public Works Services Center	Path of Travel from Main Office to Warehouse and Maintenance Garage	Exterior Accessible Route	1	An accessible route does not connect accessible building or facility entrances with all accessible spaces and elements within the building or facility. At least one accessible route shall connect accessible elements that are on the same site.	\$2,299
317477	Public Works Services Center	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The curb ramp is non-compliant.	\$2,422
317478	Public Works Services Center	Curb Ramp CR-2	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$672
323721	Public Works Services Center	Accessible Parking Space P1-B	Parking Space-Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$280
323722	Public Works Services Center	Curb Ramp CR-1	Curb Ramp	1	The curb ramp projects into vehicular traffic lanes, parking space, or associated access aisle.	\$1,750
323813	Public Works Services Center	Parking Lot	Parking Spaces-General	1	The minimum number of accessible parking spaces is not provided.	\$840
329780	Fire Station #1 & Training Center Facility	1.08a	Blended Transition	1	CALIFORNIA: The blended transition does not have a compliant detectable warning.	\$672
329781	Fire Station #1 & Training Center Facility	1.08b	Blended Transition	1	CALIFORNIA: The blended transition does not have a compliant detectable warning.	\$672
329782	Fire Station #1 & Training Center Facility	2.03	Floor Surface	1	The carpet in the common area has an unstable pad or backing.	\$719
329783	Fire Station #1 & Training Center Facility	2.06A	Building Entrance-Door	1	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$366
329784	Fire Station #1 & Training Center Facility	2.06B	Building Entrance-Door	1	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$366
329785	Fire Station #1 & Training Center Facility	2.06B	Building Entrance-Door	1	The threshold at the accessible door is greater than ½" in height.	\$179

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
352417	Fire Station #5	1.02	Parking Space-Car	1	CALIFORNIA: Signage is not provided at the standard accessible space, or the existing signage is not compliant.	\$350
352425	Fire Station #5	1.03	Parking Space-Van	1	CALIFORNIA: A van space and adjacent van aisle are not provided.	\$1,050
352436	Fire Station #5	1.03	Parking Space-Car	1	CALIFORNIA: The car stall slope is greater than 1:48 (2.08%).	\$7,875
352437	Fire Station #5	1.09	Exterior Accessible Route	1	CALIFORNIA: The detectable warning for areas other than bus stop, reflecting pool, hazardous vehicular area, or track crossing is not compliant.	\$840
352438	Fire Station #5	1.10	Exterior Accessible Route	1	CALIFORNIA: An accessible route is not provided to each functional area in the restaurant, cafeteria, banquet facility, bar or similar facility, including sunken, raised and outdoor areas.	\$9,910
352439	Fire Station #5	2.04	Protruding Object	1	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the accessible route.	\$910
352443	Fire Station #5	2.06	Door	1	The threshold at the accessible door is greater than ½" in height.	\$224
352444	Fire Station #5	2.06	Building Entrance-Door	1	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$458
352445	Fire Station #5	2.07	Building Entrance-Door	1	CALIFORNIA: The maneuvering clearance at the entry door is not compliant.	\$2,188
353657	Fire Station #63	1.02	Parking Space-Van	1	Signage is not located at a compliant height.	\$350
353658	Fire Station #63	2.03	Floor Surface	1	The carpet in the common area has an unstable pad or backing.	\$720
353659	Fire Station #63	2.06A	Building Entrance-Door	1	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$458
353660	Fire Station #63	2.06B	Building Entrance-Door	1	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$458
353640	Fire Station #7	1.02A	Parking Space-Van	1	CALIFORNIA: Signage is not provided at the van accessible space, or the existing signage is not compliant.	\$350
353641	Fire Station #7	1.02B	Parking Space-Van	1	Signage is not located at a compliant height.	\$350

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353643	Fire Station #7	1.08A	Exterior Accessible Route	1	CALIFORNIA: The detectable warning for areas other than bus stop, reflecting pool, hazardous vehicular area, or track crossing is not compliant.	\$840
353644	Fire Station #7	1.08B	Exterior Accessible Route	1	CALIFORNIA: The detectable warning for areas other than bus stop, reflecting pool, hazardous vehicular area, or track crossing is not compliant.	\$840
353645	Fire Station #7	1.08C	Exterior Accessible Route	1	CALIFORNIA: The detectable warning for areas other than bus stop, reflecting pool, hazardous vehicular area, or track crossing is not compliant.	\$840
353646	Fire Station #7	2.05	Controls And Dispensers	1	Clear space is not provided at the control or operating mechanism.	\$200
353648	Fire Station #7	2.06A	Building Entrance-Door	1	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$458
353649	Fire Station #7	2.06B	Building Entrance-Door	1	The non-fire, automatic accessible door requires more than 5 pounds of pressure to operate.	\$458
317385	Public Works Services Center	Main Office - Entrance Door	Door	1	CALIFORNIA: The power operated door is not compliant.	\$2,600
317390	Public Works Services Center	Main Office - Rear Exit Door	Door	1	The threshold at the accessible door is greater than ½" in height.	\$500
317391	Public Works Services Center	Main Office - Rear Exit Door	Door	1	The bottom of the door vision light is higher than 43" and less than 66".	\$2,600
317392	Public Works Services Center	Main Office - Rear Exit Doors	Door	1	The surface of the swinging door within 10 inches of the finish floor or ground for the full width of the door on the push side is not smooth.	\$800
317393	Public Works Services Center	Main Office - Rear Exit Door	Building Entrance-Door	1	The accessible door with door closer has a sweep period of less than 5 seconds from 90 degrees to a position 12 degrees from latch.	\$366
317421	Public Works Services Center	Warehouse - Entrance Doors	Door	1	The threshold at the accessible door is greater than ½" in height.	\$358
317474	Public Works Services Center	Maintenance Garage - Entrance Door	Door	1	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317475	Public Works Services Center	Maintenance Garage - Entrance Door	Door	1	The threshold at the accessible door is greater than ½" in height.	\$179
358021	Police Department	1.06	Curb Ramp	1	CALIFORNIA: The curb ramp has non-compliant slopes.	\$2,188
358137	Police Department	1.08	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$840
358138	Police Department	1.09	Curb Ramp	1	CALIFORNIA: The curb ramp run does not have a compliant detectable warning.	\$840
358140	Police Department	2.03 A	Floor Surface	1	Gaps in the walking surface are over 1/2" wide, or elongated gaps are not perpendicular to the path of travel.	\$500
358141	Police Department	2.03 B	Building Entrance-Floor Surface	1	The edges of the carpet are not securely attached.	\$203
358144	Police Department	2.06 A	Door	1	The opening force required to open the accessible, hinged, non-fire door is more than 5 pounds.	\$458
358171	Police Department	2.06 B	Building Entrance-Door	1	CALIFORNIA: The non-fire, hinged accessible exterior door takes more than 5#s of pressure to operate.	\$458
352442	Fire Station #5	2.06	Door	2	CALIFORNIA: The surface of the swinging door within 10" of the finish floor or ground for the full width of the door on the push side is not smooth.	\$200
317386	Public Works Services Center	Main Office - Entrance Door	Operable Part	2	Clear floor space is not provided at the operable part.	\$238
317394	Public Works Services Center	Main Office - Lobby	Service Counter	2	CALIFORNIA: The service counter does not have 36" long section that is 34" maximum above finished floor that is oriented for a parallel approach, or the service counter does not have a 36" long section that is 34" maximum above the finished floor, with knee and toe clearance oriented for a forward approach.	\$1,805
317395	Public Works Services Center	Main Office - Conference Room	Assembly Area	2	An assistive listening system is required, but not provided.	\$500
317418	Public Works Services Center	Main Office - Breakroom	Sink	2	The accessible sink is not installed with the front of the higher of the rim or counter surface 34" maximum above finished floor.	\$720
317419	Public Works Services Center	Main Office - Breakroom	Interior Access Route	2	Clear widths at turning area are less than 60" minimum.	\$100

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317422	Public Works Services Center	Warehouse - Entrance Doors	Signage	2	Means of egress signage does not have tactile lettering.	\$550
317424	Public Works Services Center	Warehouse - Conference Room	Assembly Area	2	An assistive listening system is required, but not provided.	\$1,000
317425	Public Works Services Center	Warehouse - Conference Room	Sink	2	The accessible sink is not installed with the front of the higher of the rim or counter surface 34" maximum above finished floor.	\$720
317426	Public Works Services Center	Warehouse - Conference Room	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$1,500
317428	Public Works Services Center	Warehouse - Conference Room	Door	2	CALIFORNIA: The hardware at the accessible door is not compliant.	\$879
317471	Public Works Services Center	Maintenance Garage - Garage Area	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$200
317472	Public Works Services Center	Maintenance Garage - Egress Doors	Signage	2	Means of egress signage does not have tactile lettering.	\$220
317473	Public Works Services Center	Maintenance Garage - Hallway	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$2,184
323737	Public Works Services Center	Warehouse - Hallway	Protruding Object	2	Protruding objects in the 27" to 80" range above finished floor protrude more than 4" into the circulation path along the interior accessible route.	\$728
358142	Police Department	2.05A	Reach Range	2	Items requiring an unobstructed side reach motion are higher than 48" maximum and/or lower than 15" minimum height above finish floor.	\$125
358143	Police Department	2.05 B	Vending Machine	2	The vending machines have operable parts which are not within reach range.	\$4,068
358172	Police Department	2.24	Signage	2	The interior signage does not have compliant visual and tactile characters, with raised or indented characters or symbols.	\$69
329787	Fire Station #1 & Training Center Facility	3.03	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
353661	Fire Station #63	3.02	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$116
353662	Fire Station #63	3.04	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$116
353663	Fire Station #63	3.04	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$350

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
353650	Fire Station #7	3.02	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$116
353651	Fire Station #7	3.02	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
353652	Fire Station #7	3.04	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$350
317396	Public Works Services Center	Main Office - Circulation Hallway	Drinking Fountain/Water Cooler	3	CALIFORNIA: The drinking fountain is not located completely within alcoves, positioned completely between wing walls, or otherwise positioned so as not to encroach into pedestrian ways.	\$8,000
317398	Public Works Services Center	Main Office - Men's Restroom	Restroom/Bathroom	3	The entire restroom is not compliant due to limited room dimensions.	\$12,000
317399	Public Works Services Center	Main Office - Men's Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$65
317400	Public Works Services Center	Main Office - Men's Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.	\$3,000
317401	Public Works Services Center	Main Office - Men's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
317402	Public Works Services Center	Main Office - Men's Restroom	Restroom/Bathroom - Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	\$313
317403	Public Works Services Center	Main Office - Men's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$400
317404	Public Works Services Center	Main Office - Men's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400
317405	Public Works Services Center	Main Office - Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
317406	Public Works Services Center	Main Office - Men's Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
317407	Public Works Services Center	Main Office - Women's Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
317408	Public Works Services Center	Main Office - Women's Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317409	Public Works Services Center	Main Office - Women's Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.	\$3,000
317410	Public Works Services Center	Main Office - Women's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400
317411	Public Works Services Center	Main Office - Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$800
317412	Public Works Services Center	Main Office - Women's Restroom	Restroom/Bathroom - Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	\$313
317413	Public Works Services Center	Main Office - Women's Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$630
317414	Public Works Services Center	Main Office - Women's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
317415	Public Works Services Center	Main Office - Women's Restroom	Restroom/Bathroom	3	The entire restroom is not compliant due to limited room dimensions.	\$12,000
317416	Public Works Services Center	Main Office - Women's Restroom	Controls And Dispensers	3	Controls on dispensers are not compliant.	\$200
317423	Public Works Services Center	Warehouse - Lockers	Locker and Dressing Rooms	3	The locker room does not have accessible lockers.	\$991
317429	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom - Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
317430	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
317431	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom - Door	3	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$250
317432	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
317433	Public Works Services Center	Warehouse - Men's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$800

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317434	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom - Urinal	3	The urinal dimensions are not compliant.	\$935
317435	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom - Roll - In Shower Stall	3	CALIFORNIA: The controls, faucets, and shower spray unit are not compliant.	\$650
317436	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom-Roll-In Shower Stall	3	CALIFORNIA: A shower seat is not provided or is not compliant.	\$605
317437	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom - Roll - In Shower Stall	3	Grab bars are not provided.	\$1,250
317438	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom - Roll - In Shower Stall	3	The roll-in shower stall is not compliant.	\$4,750
317439	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom-Mirror	3	The mirror is mounted higher than 35" above finish floor to the bottom of the reflective surface, where it is not installed above a lavatory or counter.	\$200
317440	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom-Door	3	The push side of the door does not have the required maneuvering clearances.	\$1,250
317441	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
317442	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom-Water Closet	3	The grab bars at the water closet are not compliant.	\$1,420
317443	Public Works Services Center	Warehouse - Men's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$93
317444	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom - Roll - In Shower Stall	3	CALIFORNIA: The controls, faucets, and shower spray unit are not compliant.	\$650
317445	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom - Roll - In Shower Stall	3	The roll-in shower stall is not compliant.	\$4,750

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317446	Public Works Services Center	Warehouse - Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
317447	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The centerline of the toilet in the wheelchair stall or single-user restroom is not 17" minimum to 18" maximum from the sidewall.	\$1,368
317448	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom - Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$280
317449	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
317450	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Mirror	3	The mirror is mounted higher than 35" above finish floor to the bottom of the reflective surface, where it is not installed above a lavatory or counter.	\$200
317451	Public Works Services Center	Warehouse - Women's Restroom	Controls And Dispensers	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$800
317452	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom - Door	3	The wheelchair stall door is not self closing.	\$293
317454	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom - Door	3	The swinging door does not have a smooth surface within 10" of the ground measured vertically on the push side extending the full width of the door.	\$250
317455	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
317456	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The women's restroom does not have compliant signage at the door.	\$110
317458	Public Works Services Center	Maintenance Garage - Lockers	Locker and Dressing Rooms	3	The locker room does not have accessible lockers.	\$991
317459	Public Works Services Center	Maintenance Garage - Unisex Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400
317460	Public Works Services Center	Maintenance Garage - Unisex Restroom	Restroom/Bathroom - Lavatory	3	Pipes are not insulated.	\$65
317461	Public Works Services Center	Maintenance Garage - Unisex Restroom	Restroom/Bathroom - Water Closet	3	The toilet paper dispenser is not at a compliant location.	\$280

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317462	Public Works Services Center	Maintenance Garage - Unisex Restroom	Restroom/Bathroom - Water Closet	3	The flush control is located on the closed side and/or is not within reach range.	\$313
317463	Public Works Services Center	Maintenance Garage - Unisex Restroom	Restroom/Bathroom-Water Closet	3	The water closet in a single user / unisex restroom does not have the required clearance.	\$1,368
317464	Public Works Services Center	Maintenance Garage - Unisex Restroom	Restroom/Bathroom - Lavatory	3	CALIFORNIA: The centerline of the lavatory is less than 18" from the side wall or partition wall.	\$3,000
317465	Public Works Services Center	Maintenance Garage - Unisex Restroom	Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
317466	Public Works Services Center	Maintenance Garage - Unisex Restroom	Exterior Door	3	The door or gate in an recess greater than 8" deep does not have the required maneuvering clearances.	\$2,083
317467	Public Works Services Center	Maintenance Garage - Unisex Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The unisex restroom does not have compliant signage at the door.	\$110
317468	Public Works Services Center	Maintenance Garage - Unisex Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
317479	Public Works Services Center	Main Office - Men's Restroom	Restroom/Bathroom - Water Closet	3	The height of the water closet is not 17" minimum to 19" maximum above finished floor.	\$630
323724	Public Works Services Center	Warehouse - Men's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400
323725	Public Works Services Center	Warehouse - Men's Restroom	Locker and Dressing Rooms	3	The locker room does not have a compliant bench.	\$789
323726	Public Works Services Center	Warehouse - Men's Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The wheelchair stall with in-swinging door does not have the required dimensions.	\$1,100
323727	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Roll-In Shower Stall	3	CALIFORNIA: A shower seat is not provided or is not compliant.	\$605
323728	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Roll-In Shower Stall	3	CALIFORNIA: Grab bars are not provided or are not compliant in the roll-in shower stall.	\$1,250
323729	Public Works Services Center	Warehouse - Women's Restroom	Locker and Dressing Rooms	3	The locker room does not have a compliant bench.	\$789

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323730	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Door	3	The hardware at the wheelchair stall door is not compliant.	\$586
323731	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Coat Hook	3	The coat hook is not within an allowable reach range.	\$230
323732	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The wheelchair stall with out-swinging door does not have the required dimensions.	\$2,200
323733	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The disposal unit at the water closet is not compliant.	\$280
323734	Public Works Services Center	Warehouse - Women's Restroom	Restroom/Bathroom-Door	3	The pull side of the accessible door does not have the required maneuvering clearances.	\$1,250
323735	Public Works Services Center	Warehouse - Women's Restroom	Protruding Object	3	The restroom circulation path is not free of objects protruding more than 4" from wall in the space between 27" and 80" height above finish floor.	\$400
323736	Public Works Services Center	Warehouse - Women's Restroom	Controls And Dispensers	3	Controls throughout the common area are not compliant.	\$225
323738	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Signage	3	The restroom does not have compliant signage at the door with the International Symbol of Accessibility, raised characters, and Braille.	\$55
323739	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Signage	3	CALIFORNIA: The men's restroom does not have compliant signage at the door.	\$110
323740	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Door	3	The push side of the door does not have the required maneuvering clearances.	\$1,250
323741	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Door	3	CALIFORNIA: The hardware at the accessible door is not compliant.	\$293
323742	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Floor Space	3	The required turning space within the restroom is not provided.	\$9,250
323743	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$720
323744	Public Works Services Center	Maintenance Garage - Men's Restroom	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$200
323745	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Coat Hook	3	The coat hook is not within an allowable reach range.	\$115

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
323746	Public Works Services Center	Maintenance Garage - Men's Restroom	Locker and Dressing Rooms	3	The locker room does not have a compliant bench.	\$789
323747	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Urinal	3	The clear floor space at the urinal is less than minimum 30" by minimum 48".	\$1,100
323748	Public Works Services Center	Maintenance Garage - Men's Restroom	Restroom/Bathroom-Toilet Stall	3	A wheelchair stall is not provided in a multi-user restroom.	\$2,750
358173	Police Department	2.30	Assembly Area	3	Assistive listening signage is not compliant or is not provided.	\$69
358174	Police Department	3.02	Reach Range	3	CALIFORNIA: Dispensers in restrooms are not located maximum 40" AFF.	\$116
358175	Police Department	3.03	Restroom/Bathroom-Lavatory	3	CALIFORNIA: The lavatory does not have the required knee and toe clearance.	\$900
358176	Police Department	3.04	Restroom/Bathroom-Water Closet	3	CALIFORNIA: The toilet paper dispenser is not compliant.	\$350
317480	Public Works Services Center	Parking Lot	Parking Space - General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$280
329786	Fire Station #1 & Training Center Facility	3.02	Locker Rooms	4	The locker room does not have at least one of the coat hooks within reach range.	\$150
329788	Fire Station #1 & Training Center Facility	4.02	Drinking Fountain/Water Cooler	4	Knee and toe clearance is not provided at the lower level fountain.	\$980
352440	Fire Station #5	2.05A	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls and outlets are not compliant.	\$625
352441	Fire Station #5	2.05B	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls and outlets are not compliant.	\$625
353664	Fire Station #63	4.02	Drinking Fountain/Water Cooler	4	Clear floor space with knee and toe clearance is not provided at the lower level fountain.	\$1,225
317397	Public Works Services Center	Main Office - Circulation Hallway	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000

**PHASE FIVE BARRIERS**

<b>Id</b>	<b>Facility</b>	<b>Location Description</b>	<b>Category</b>	<b>Barrier Priority</b>	<b>Detail</b>	<b>Estimate</b>
317417	Public Works Services Center	Main Office - Throughout Building	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls and outlets are not compliant.	\$3,000
317427	Public Works Services Center	Warehouse - Conference Room	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
317453	Public Works Services Center	Warehouse - Men's and Women's Restroom	Controls And Dispensers	4	CALIFORNIA: The location of electrical controls and outlets are not compliant.	\$1,000
317469	Public Works Services Center	Maintenance Garage - Garage Area	Drinking Fountain/Water Cooler	4	The minimum number and types of drinking fountains are not provided.	\$8,000
358020	Police Department	1.02	Parking Spaces-General	4	CALIFORNIA: The parking facility does not have facility entrance/ accessible parking signage indicating that accessible parking violators will be towed, or the existing signage is not compliant.	\$350
					<b>Total Cost:</b>	<b>\$269,001</b>